

FORM
6Rev
11/20

State of Colorado

Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

403455714

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 47120

Contact Name: Lindsay Davis

Name of Operator: KERR MCGEE OIL & GAS ONSHORE LP

Phone: (970) 515-1616

Address: P O BOX 173779

Fax:

City: DENVER State: CO Zip: 80217-

Email: Lindsay_Davis@oxy.com

For "Intent" 24 hour notice required,

Name: Santistevan, Brittani

Tel: (720) 471-1110

COGCC contact:

Email: brittani.santistevan@state.co.us

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-123-14735-00

Well Name: BEEBE DRAW UPRR

Well Number: 32-5 (9)

Location: QtrQtr: SWNE Section: 5 Township: 3N Range: 65W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.256438

Longitude: -104.685213

GPS Data: GPS Quality Value: Type of GPS Quality Value: Date of Measurement:

Reason for Abandonment: ☐ Dry ☐ Production Sub-economic ☐ Mechanical Problems☒ Other Re-EntryCasing to be pulled: ☐ Yes ☒ No Estimated Depth:Fish in Hole: ☒ Yes ☐ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details: 3-7/8" bit, 4-1/2" casing scraper and 2-3/8" tubing were dropped in the hole. Fishing attempted but was not successful.

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7270	7280	08/02/2002	BRIDGE PLUG	4336
NIOBRARA	6985	7065	08/02/2002	BRIDGE PLUG	4336

Total: 2 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J-55	24	0	617	315	617	0	VISU
1ST	7+7/8	4+1/2	I-80	11.6	0	7385	225	7385	6385	CBL
	7+7/8	4+1/2	I-80	Stage Tool	0	4740	150	4740	4290	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 300 with 90 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.

CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.

CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 285 sks cmt from 3910 ft. to 3410 ft.

Plug Type: OPEN HOLE

Plug Tagged: ☐

Set 285 sks cmt from 2500 ft. to 2000 ft.

Plug Type: OPEN HOLE

Plug Tagged: ☐

Set 285 sks cmt from 1700 ft. to 1200 ft.

Plug Type: OPEN HOLE

Plug Tagged: ☐

Set 90 sks cmt from 300 ft. to 0 ft.

Plug Type: OPEN HOLE

Plug Tagged: ☐

Set _____ sks cmt from _____ ft. to _____ ft.

Plug Type: _____

Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 160 sacks half in. half out surface casing from 770 ft. to 515 ft.

Plug Tagged: ☐

Set 90 sacks at surface

Cut four feet below ground level, weld on plate

Above Ground Dry-Hole Marker: ☐ Yes

☒ No

Set _____ sacks in rat hole

Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing

Surface Plug Setting Date: _____ Cut and Cap Date: _____

Number of Days from Setting Surface Plug to Capping or Sealing the Well: _____

*Wireline Contractor: _____

*Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

BMPs

Signage for P&As:

Prior to commencing operations, KMG will post signs in conspicuous locations. The signs will indicate plugging and abandonment operations are being conducted, the well name, well, and the Operator's contact information. Signs will be placed so as not to create a potential traffic hazard.

Notifications:

Courtesy notifications will be sent to all parcel owners with building units within 1,500 feet of the location letting them know about out plugging and abandonment operations and providing contact information for Kerr McGee's response line and online resources.

Wellbore Pressure:

In some cases, wellbore pressure drawdown operations may occur approximately 1-2 days prior to Move In Rig Up (MIRU) of the workover rig. This is conducted to allow for reduced time that the workover rig is needed on location. These operations will be conducted in accordance with Form 4 and/or Form 6 requirements.

Water:

Water will be placed on dirt access roads to mitigate dust as needed.

Lighting:

Operations are daylight-only; no lighting impacts are anticipated from operations.

Noise:

Operations will be in compliance with Table 423-1 requirements. Based off the rig sound signature, rig orientation will be considered to reduce noise levels to nearby building units.

Environmental Concerns:

This location was reviewed using a desktop method to review publicly available wildlife data (including CPW & ECMC data) as well as internal wildlife datasets and aerial imagery. All field personnel are trained to identify wildlife risks and raise concerns noticed during operations with the KMOG Health, Safety, and Environment (HSE) department.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____

Print Name: Lindsay Davis

Title: Regulatory Tech

Date: _____

Email: Lindsay_Davis@oxy.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY:

Expiration Date: _____

COA Type

Description

0 COA	

Attachment List

Att Doc Num

Name

403455720	WELLBORE DIAGRAM
403455721	PROPOSED PLUGGING PROCEDURE
403455722	WELLBORE DIAGRAM
403455723	SURFACE OWNER CONSENT

Total Attach: 4 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
		Stamp Upon Approval

Total: 0 comment(s)