

# Construction and Stormwater Inspection

Date: 07/06/2023

Operator: MDS ENERGY DEVELOPMENT - 10814

Location ID: 477495

Inspection Document #: 708200369

Weld County, CO

NENW Section 33 T8N R59W

Dylan Edwardson  
Reclamation Specialist, COGCC



**COLORADO**

**Oil & Gas Conservation  
Commission**

Department of Natural Resources

Inspection Photos  
Location Name: Daffy Pad  
Location ID: 477495



**Photo 1.** The approved Form 2A was posted in a conspicuous location at the entrance to the new construction. However, a location sign was not posted per Rule 605.a.

Inspection Photos  
Location Name: Daffy Pad  
Location ID: 477495



**Photo 2.** Facing north near the location entrance. Topsoil salvage has not occurred on the new access road; this will need to be completed per Rule 1002.b.

Inspection Photos  
Location Name: Daffy Pad  
Location ID: 477495



**Photo 3.** Facing east; see comments in Photo 2.

Inspection Photos  
Location Name: Daffy Pad  
Location ID: 477495



**Photo 4.** Taken northwest of the location, facing southeast. See comments in Photo 2.

Inspection Photos  
Location Name: Daffy Pad  
Location ID: 477495



**Photo 5.** Taken from the northwest corner of the disturbance area. Photo illustrates that a perimeter ditch and berm has been constructed around the entire location.

Inspection Photos  
Location Name: Daffy Pad  
Location ID: 477495



**Photo 6.** Taken from the southwest corner; see comments in Photo 5.



**Photo 7.** Taken from the southeast corner. Berm material does not appear to be properly stabilized with evidence of unconsolidated material.



**Photo 8.** Taken near the southeast corner of the location. The berm material does not appear to be properly stabilized with evidence of unconsolidated material. It appears stormwater run-on has eroded a portion of the berm; additional maintenance or implementation of more robust BMPs is required.



**Photo 9.** Taken from the northeast corner; see comments in Photo 5.



**Photo 10.** Taken from the northern, central, portion of the stormwater ditch and berm. The berm material does not appear to be properly stabilized with evidence of unconsolidated material. It appears stormwater runoff has eroded a portion of the berm; additional maintenance or implementation of more robust BMPs is required.



**Photo 11.** Taken from the northern, central portion of the location. It appears that grubbing activities have recently occurred. The Operator shall ensure that all topsoil has been separated and stored in accordance with Rule 1002.b. A follow-up inspection will be performed at a later date to verify compliance with topsoil salvage operations.

Inspection Photos  
Location Name: Daffy Pad  
Location ID: 477495



**Photo 12.** Taken from the western portion of the construction area, facing south. It appears that material from the grubbing activities is being positioned on the western half of the location, e.g. the topsoil stockpile area. A follow-up inspection will be conducted at a future date to verify all topsoil has been salvaged from the location.

Inspection Photos  
Location Name: Daffy Pad  
Location ID: 477495



**Photo 13.** Taken from the center portion of the location; photo illustrates grubbing activities occurring within the fill areas.

Inspection Photos  
Location Name: Daffy Pad  
Location ID: 477495



**Photo 14.** Overview of cut and fill areas within the disturbance area.