

State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Document Number:

403446792

Date Received:

06/27/2023

FIR RESOLUTION FORM

Overall Status: CAC

CA Summary:

2 of 2 CAs from the FIR responded to on this Form

2 CA Completed
0 Factual Review Request

OPERATOR INFORMATION

OGCC Operator Number: 10749

Name of Operator: SIMCOE LLC

Address: 1199 MAIN AVE SUITE 101

City: DURANGO State: CO Zip: 81301

Contact Name and Telephone:

Name: _____

Phone: () _____ Fax: () _____

Email: _____

Additional Operator Contact:

Contact Name

Phone

Email

SIMCOE

sjninspections@ikavenergy.co

COGCC INSPECTION SUMMARY:

FIR Document Number: 690204125

Inspection Date: 04/18/2023

FIR Submit Date: 04/25/2023

FIR Status: _____

Inspected Operator Information:

Company Name: SIMCOE LLC

Company Number: 10749

Address: 1199 MAIN AVE SUITE 101

City: DURANGO State: CO Zip: 81301

LOCATION - Location ID: 312083

Location Name: Tiffany Number: 5 County: _____

Qtrqtr: SWSE Sec: 20 Twp: 33N Range: 6W Meridian: N

Latitude: 37.085058 Longitude: -107.519749

FACILITY - API Number: 05-067-00 Facility ID: 312083

Facility Name: Tiffany Number: 5

Qtrqtr: SWSE Sec: 20 Twp: 33N Range: 6W Meridian: N

Latitude: 37.085058 Longitude: -107.519749

CORRECTIVE ACTIONS:

1 ☒ CA# 170059

Corrective Action: To comply with Rule 1002.b. Operator needs to identify the additional topsoil required per the amount shown in the topsoil protection plan and and previous corrective action.

Date: 10/07/2022

Response: CA COMPLETED

Date of Completion: 05/24/2023

Operator Comment: Topsoil area of disturbance measures approx. 3.51 acres, average of 6-inches of topsoil removed at the start of the wellsite construction. Areas are stabilized with hydro-mulched seed.

COGCC Decision: Not Approved

COGCC Representative:	ECMC Drone aerial calculations of topsoil piles showed that only 1089 cubic feet of topsoil was salvaged and stored at the location. Operator needs to demonstrate with calculations, map, photos, ect., where 2800 cu. yds of topsoil was stockpiled or comply with the Corrective Action.		
2 <input checked="" type="checkbox"/> CA# 170060			
Corrective Action:	Install or repair required BMPs per Rule 1002.f.(2)		Date: <u>05/12/2023</u>
Response:	CA COMPLETED		Date of Completion: <u>06/05/2023</u>
Operator Comment:	BMPs have been addressed. See attached completion photos.		
COGCC Decision:	Approved pending re-inspection		
COGCC Representative:			

<u>OPERATOR COMMENT AND SUBMITTAL</u>	
Comment:	CA Completed. See attached completion photos.
I hereby certify that the statements made in this form are, to the best of my knowledge, true, correct, and complete.	
Print Name: <u>Gabby Riley</u>	Signed: _____
Title: <u>Permitting Specialist I</u>	Date: <u>6/27/2023 1:08:58 PM</u>

ATTACHMENT LIST

View Attachments in Imaged Documents on COGCC website (<http://ogccweblink.state.co.us/>) - Search by Document Number.

<u>Document Number</u>	<u>Description</u>
403446792	FIR RESOLUTION SUBMITTED
403446808	Tiffany 5-3 & 5-2; CA completion photos
403446811	Tiffany 5-3 & 5-2; CA completion photos

Total Attach: 3 Files