

Daily Operations	
Start Date	Summary
3/30/2023	CTL, HSM AND FILL OUT DAILY RIG INSPECTION. WINCH OUT RIG AND EQUIPMENT(MUDDY LOC) AND DROVE FROM THE PROSPECT CO26-0114 SPOT IN RIG AND EQUIPMENT (STRUGLE TO SPOT IN EQUIPMENT DO TO MUDDY LOC) RIG UP RIG- RD RIG DO TO UNEVEN BASE BEAM WAIT FOR CREW TO COME OUT AND LEVEL AROUND WELL HEAD. LEVEL OUT AROUND WELL HEAD. RE-SPOT IN RIG AND RIG UP. TEST BOP AND SRF EQUOPMENT LOW/HIGH=GOOD. ND WH-NU BOP AND TEST RING CONNECTION LOW/HIGH=GOOD. RU WORK FLOOR.
3/31/2023	CTL, HSM AND FILL OUT SWC. CHECK IWP= 0/0/0 OPEN WELL AND POOH TO DERRICK W/ 86 JTS AND POOH LD 108 JTS 2-3/8" TBG SN/NC. HSM W/ RANGER WL-MIRU WL-RIH W/ 4.5 CIBP SETTING TOOL AND CCL METER. RUN CORRELATION STRIP AND SET CIBP @ 2665'. POOH W/ SETTING TOOL-RDMO WL. SWIFD DO TO WEATHER CONDITIONS. CREW TO YARD
4/3/2023	WSR SAFETY TRAINING
4/4/2023	CTL, HSM AND FILL OUT SWC CHECK IWP=0 SICP/ 0 SIBHP OPEN WELL- RIH W/ 87 JTS 2-3/8" TBG. TAG CIBP @ 2665' W/ 6' IN ON JT 87. LD 1 JT AND PU 6' SUB. HSM W/ RANGER CMT-MIRU CMT CREW. TEST LINES AND ESTABLISH CIRC- MIX AND PUMP 10 SKS 15.8 PPG G NEAT CMT. DISPLACE W/ 9 BBL FW TO BALANCE EST CMT TOP @2536'. RD CMT CREW-POOH LD 21 JTS 2-3/8" REVERSE @ 1985'. POOH LD REST OF TBG(194 JTS ON T-101). HSM W/ RANGER WL. MIRU WL-RIH W/ PERF GUN AND CCL METER. RUN CORRELATION STRIP AND PERF @ 888'. POOH SPENT GUN-RDMO WL. LOAD HOLE AND ESTABLISH CIRC-CONDITION HOLE W/ 100 BBLS FW. NU DN BOP-NU WH AND SECURE WELL. WAIT ON RANGER CMT FOR 1.5 HRS-HSM W/ RANGER CMT. MIRU CMT CREW. GOT READY TO PUMP CMT AND CMT TRUCK BROCK DN. RD CMT CREW-SWIFD-CREW TO YARD.
4/5/2023	CTL, HSM AND FILL DAILY RIG INSPECTION AND SWC. CHECK IWP=0 SICP/ 0 SIBHP. HSM W/ RANGER CMT. MIRU CMT CREW. ESTABLISH CIRC W/ 2 BBLS FW- MIX AND PUMP 10 BBLS MUD FLUSH 5 BBL FW SPACER-353 SKS 15.8 PPG G NEAT CMT 72.3 BBLS SLURRY DN PRODUCTION CSG UP SRF. RDMO CMT CREW. MOVE RIG AND EQUIPMENT TO WESTERMAN 32-11 PERF @ 888' PU 353 SK G NEAT TO SRF.