



DE	ET	OE	ES
Document Number: 403536223			
Date Received:			

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Valerie Danson
 Name of Operator: PDC ENERGY INC Phone: (970) 506-9272
 Address: 1099 18TH STREET SUITE 1500 Fax: _____
 City: DENVER State: CO Zip: 80202 Email: regulatory@pdce.com

For "Intent" 24 hour notice required, Name: Peterson, Tom Tel: (970) 370-1281
COGCC contact: Email: tom.peterson@state.co.us

Type of Well Abandonment Report: Notice of Intent to Abandon Subsequent Report of Abandonment

API Number 05-123-22938-00
 Well Name: API Well Number: 5
 Location: QtrQtr: NESE Section: 2 Township: 4N Range: 66W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: _____
 Field Name: WATTENBERG Field Number: 90750

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.338333 Longitude: -104.738333
 GPS Data: GPS Quality Value: 2.9 Type of GPS Quality Value: PDOP Date of Measurement: 06/28/2010

Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other _____

Casing to be pulled: Yes No Estimated Depth: 2400
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
NIOBRARA-CODELL	6942	7284			

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J55	24	0	407	335	407	0	VISU
1ST	7+7/8	4+1/2	J55	11.6	0	7552	700	7552	2490	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6892 with 2 sacks cmt on top. CIBP #2: Depth 4367 with 2 sacks cmt on top.
 CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
 CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 100 sks cmt from 2450 ft. to 2200 ft. Plug Type: STUB PLUG Plug Tagged:
 Set 100 sks cmt from 1440 ft. to 1240 ft. Plug Type: OPEN HOLE Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
(Cast Iron Cement Retainer Depth)

Set 222 sacks half in. half out surface casing from 607 ft. to 0 ft. Plug Tagged:
 Set _____ sacks at surface
 Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No
 Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Number of Days from Setting Surface Plug to Capping or Sealing the Well: _____
 Surface Plug Setting Date: _____ Cut and Cap Date: _____
 *Wireline Contractor: _____ *Cementing Contractor: _____
 Type of Cement and Additives Used: _____
 Flowline/Pipeline has been abandoned per Rule 1105 Yes No

Technical Detail/Comments:

API 5 (05-123-22938)/Plugging Procedure (Intent)
 Producing Formations: Niobrara/Codell: 6942'-7284'
 Upper Pierre Aquifer: 350'-1340'
 TD: 7552' PBTD: 7414' (10/15/14)
 Surface Casing: 8 5/8" 24# @ 407' w/ 335 sxs cmt
 Production Casing: 4 1/2" 11.6# @ 7552' w/ 700 sxs cmt (TOC @ 2490' - CBL)

Tubing: 2 3/8" tubing set @ 7255' (12/30/14)
 Proposed Procedure:
 1. MIRU pulling unit. Pull 2 3/8" tubing.
 2. RU wireline company.
 3. TIH with CIBP. Set BP at 6892'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Nio perms @ 6942')
 4. TIH with CIBP. Set BP at 4367'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Sussex @ 4417')
 5. TIH with casing cutter. Cut 4 1/2" casing @ 2400'. Pull cut casing.
 6. TIH with tubing to 2450'. RU cementing company. Mix and pump 100 sxs 15.8#/gal CI G cement down tubing. (Stub plug from 2450'-2200')
 7. Wait a sufficient time to confirm static conditions. If at any time after placing this plug there is evidence of pressure or fluid migration, contact engineering before continuing operations.
 8. TIH with tubing to 1440'. Mix and pump 100 sxs 15.8#/gal CI G cement down tubing. (Pierre coverage from 1440'-1240')
 9. Pick up tubing to 607'. Mix and pump 222 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface.
 10. Well casing cut and capped per COGCC guidelines at a depth as not to interfere with soil cultivation.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Valerie Danson

Title: Reg Analyst

Date:

Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

COA Type

Description

0 COA	

Attachment List

Att Doc Num

Name

403536239	WELLBORE DIAGRAM
403536243	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

User Group

Comment

Comment Date

		Stamp Upon Approval
--	--	---------------------

Total: 0 comment(s)