

**FORM
INSP**Rev
X/20**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

10/04/2023

Submitted Date:

10/07/2023

Document Number:

708301016

FIELD INSPECTION FORMLoc ID 323960 Inspector Name: Morris, Matthew On-Site Inspection ☐ 2A Doc Num: _____**Operator Information:**

OGCC Operator Number: 96850

Name of Operator: TEP ROCKY MOUNTAIN LLC

Address: 1058 COUNTY ROAD 215

City: PARACHUTE State: CO Zip: 81635

Status Summary:

- ☒ THIS IS A FOLLOW UP INSPECTION
- ☒ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

Findings:

9 Number of Comments

1 Number of Corrective Actions

- ☒ Corrective Action Response Requested

**ANY CORRECTIVE ACTION(S) FROM
PREVIOUS INSPECTIONS THAT HAVE NOT
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
, TEP		COGCCInspectionReports@terraep.com	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
211359	WELL	PR	07/31/1997	GW	045-07119	FEDERAL GM 201-4	PR

General Comment:**COGCC Inspection Report Summary**

On 10/4/2023 at approximately 10:45, Compliance Inspector Matthew Morris conducted a follow-up inspection at TEP ROCKY MOUNTAIN LLC, FEDERAL-67S96W/4NWNE at Location ID #323960 in Garfield County, Colorado.

Normal production operations were observed.

During the inspection, the following compliance issues were observed:

1) Stormwater; refer to Stormwater section

A follow-up on this site inspection will be conducted to ensure the compliance issues have been corrected to comply with COGCC rules.

This location is within or in close proximity to, a CPW Density/High Priority Habitat, Black Bear, NSO Habitat, or Wildlife Management area.

LocationOverall Good: ☐**Signs/Marker:**

Type	BATTERY		
Comment:			
Corrective Action:		Date:	
Type	TANK LABELS/PLACARDS		
Comment:			
Corrective Action:		Date:	
Type	WELLHEAD		
Comment:			
Corrective Action:		Date:	
Type	OTHER		
Comment:	Separator units include attached storage tanks. The sight glass on the side of the unit indicates that the storage tank contains an unknown fluid. No form of labeling or markers is present to identify a potential hazard or the contents of the storage tank.		
Corrective Action:		Date:	

Emergency Contact Number:

Comment: 911/(970) 285-9377

Corrective Action:

Date: _____

Overall Good: ☐**Spills:**

Type	Area	Volume		
------	------	--------	--	--

In Containment: No

Comment:

☐ Multiple Spills and Releases?**Fencing/:**

Type	SEPARATOR		
Comment:	Livestock fencing		
Corrective Action:		Date:	
Type	WELLHEAD		
Comment:	Pipe rail fencing		
Corrective Action:		Date:	
Type	TANK BATTERY		
Comment:	Livestock fencing		
Corrective Action:		Date:	

Equipment:

Type: Horizontal Heated Separator	# 1		corrective date
Comment:			
Corrective Action:		Date:	

Type: Bird Protectors	# 2		
Comment:			
Corrective Action:			Date:
Type: Bradenhead	# 1		
Comment:			
Corrective Action:			Date:
Type: Plunger Lift	# 1		
Comment:			
Corrective Action:			Date:
Type: Gas Meter Run	# 1		
Comment:			
Corrective Action:			Date:

Tanks and Berms:

Contents	#	Capacity	Type	Tank ID	SE GPS	
PRODUCED WATER	1	<100 BBLS	STEEL AST		,	
Comment:						
Corrective Action:						Date:

Paint

Condition	Adequate	
Other (Content)		
Other (Capacity)	80 bbls	
Other (Type)		

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Earth	Adequate	Walls Sufficent	Base Sufficent	Adequate
Comment:				
Corrective Action:				
			Date:	

Venting:

Yes/No	NO		
Comment:			
Corrective Action:			Date:

Flaring:

Type		
Comment:		
Corrective Action:		Date:

Inspected Facilities				
Facility ID: 211359	Type: WELL	API Number: 045-07119	Status: PR	Insp. Status: PR
Producing Well				
Comment:				
Corrective Action:				Date:

Reclamation - Storm Water - Pit**Storm Water:**

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
Ditches						
		Sediment Traps				
		Compaction	Fail			Lack of stabilization
		Check Dams				
		Rip Rap				
Compaction						
		Retention Ponds				
		Other	Fail			Insufficient erosion controls
		Ditches				
Gravel						
		Gravel				
		Culverts				
		Berms				
Berms						

Comment: [Insufficient erosion controls; rill erosion cutting through lease road.](#)

Corrective Action: [Oil and gas operators shall implement and maintain Best Management Practices \(BMPs\) at all oil and gas locations to comply with Rule 1002.](#)

Date: 10/22/2023

Pits: ☒ NO SURFACE INDICATION OF PIT

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
708301017	Photo Log	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=6277120