



DE	ET	OE	ES
Document Number: 403587137			
Date Received:			

**WELL ABANDONMENT REPORT**

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Valerie Danson  
 Name of Operator: PDC ENERGY INC Phone: (970) 506-9272  
 Address: 1099 18TH STREET SUITE 1500 Fax: \_\_\_\_\_  
 City: DENVER State: CO Zip: 80202 Email: regulatory@pdce.com

**For "Intent" 24 hour notice required,** Name: Serna, Abe Tel: (720) 661-7317  
**COGCC contact:** Email: abe.serna@state.co.us

Type of Well Abandonment Report:  Notice of Intent to Abandon  Subsequent Report of Abandonment

API Number 05-123-25409-00  
 Well Name: HALL Well Number: 42-33  
 Location: QtrQtr: SENE Section: 33 Township: 7N Range: 66W Meridian: 6  
 County: WELD Federal, Indian or State Lease Number: \_\_\_\_\_  
 Field Name: EATON Field Number: 19350

*Only Complete the Following Background Information for Intent to Abandon*

Latitude: 40.533080 Longitude: -104.776580  
 GPS Data: GPS Quality Value: 2.8 Type of GPS Quality Value: PDOP Date of Measurement: 03/07/2008

Reason for Abandonment:  Dry  Production Sub-economic  Mechanical Problems  
 Other \_\_\_\_\_

Casing to be pulled:  Yes  No Estimated Depth: \_\_\_\_\_  
 Fish in Hole:  Yes  No If yes, explain details below  
 Wellbore has Uncemented Casing leaks:  Yes  No If yes, explain details below  
 Details: \_\_\_\_\_

**Current and Previously Abandoned Zones**

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
NIOBRARA-CODELL	7068	7374			

Total: 1 zone(s)

**Casing History**

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J55	24	0	902	640	902	0	VISU
1ST	7+7/8	4+1/2	J55	11.6	0	7507	865	7533	125	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7018 with 2 sacks cmt on top. CIBP #2: Depth 2500 with 2 sacks cmt on top.  
 CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
 CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:

Perforate and squeeze at 110 ft. with 29 sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 (Cast Iron Cement Retainer Depth)

Set 112 sacks half in. half out surface casing from 1480 ft. to 0 ft. Plug Tagged:   
 Set \_\_\_\_\_ sacks at surface  
 Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker:  Yes  No  
 Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Number of Days from Setting Surface Plug to Capping or Sealing the Well: \_\_\_\_\_  
 Surface Plug Setting Date: \_\_\_\_\_ Cut and Cap Date: \_\_\_\_\_  
 \*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_  
 Type of Cement and Additives Used: \_\_\_\_\_  
 Flowline/Pipeline has been abandoned per Rule 1105  Yes  No

Technical Detail/Comments:

Hall 42-33 (05-123-25409)/Plugging Procedure (Intent)  
 Producing Formations: Niobrara/Codell: 7068' – 7374'  
 Upper Pierre Aquifer: 340'-1380'  
 TD: 7536' PBTD: 7491' (2/03/08)  
 Surface Casing: 8 5/8" 24# @ 902' w/ 640 sxs cmt  
 Production Casing: 4 1/2" 11.6# @ 7507' w/ 865 sxs cmt (TOC @ 125' - CBL)

Tubing: 2 3/8" tubing set @ 7356' (3/11/09)  
 Proposed Procedure:  
 1. MIRU pulling unit. Pull 2 3/8" tubing.  
 2. RU wireline company.  
 3. TIH with CIBP. Set BP at 7018'. Top with 2 sxs 15.8#/gal CI G cement. (Top of Nio perfs @ 7068')  
 4. TIH with CIBP. Set BP at 2500'. Top with 2 sxs 15.8#/gal CI G cement.  
 5. Wait a sufficient time to confirm static conditions. If at any time after placing this plug there is evidence of pressure or fluid migration, contact engineering before continuing operations.  
 6. TIH with perf gun. Shoot holes at 110'.  
 7. TIH with tubing to 1480'. RU cementing company. Mix and pump 112 sxs 15.8#/gal CI G cement down tubing. (Pierre coverage from 1480' to Surface) Cement should circulate to surface.  
 8. Close off casing returns. Hook up cement line to cement flange and pump 29 sxs 15.8#/gal CI G cement downhole and squeeze through perfs at 110' into annular space. Cement should circulate to surface.  
 9. Well casing cut and capped per COGCC guidelines at a depth as not to interfere with soil cultivation.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Valerie Danson

Title: Reg Analyst

Date:

Email: valerie.danson@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_

Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: \_\_\_\_\_

<b>COA Type</b>	<b>Description</b>
0 COA	

**Attachment List**

<b>Att Doc Num</b>	<b>Name</b>
403587161	WELLBORE DIAGRAM
403587163	WELLBORE DIAGRAM

Total Attach: 2 Files

**General Comments**

<b>User Group</b>	<b>Comment</b>	<b>Comment Date</b>
		Stamp Upon Approval

Total: 0 comment(s)