

FORM  
6Rev  
11/20

## State of Colorado

## Energy &amp; Carbon Management Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

403575767

Date Received:

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 10633

Contact Name: Adam Conry

Name of Operator: CRESTONE PEAK RESOURCES OPERATING LLC

Phone: (303) 883-3351

Address: 555 17TH STREET SUITE 3700

Fax:

City: DENVER

State: CO

Zip: 80202

Email: AConry@civiresources.com

**For "Intent" 24 hour notice required,**

Name: Revas, Robbie

Tel: (720) 661-7242

**COGCC contact:**

Email: robbie.revas@state.co.us

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-123-25486-00

Well Name: RAY NELSON

Well Number: 23-32

Location: QtrQtr: NESW

Section: 32

Township: 2N

Range: 68W

Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: SPINDLE

Field Number: 77900

*Only Complete the Following Background Information for Intent to Abandon*

Latitude: 40.093003

Longitude: -105.029319

GPS Data: GPS Quality Value: 2.7 Type of GPS Quality Value: Date of Measurement: 04/21/2008

Reason for Abandonment: ☐ Dry ☐ Production Sub-economic ☐ Mechanical Problems☒ Other P&A due to sensitive areaCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 3000

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7582	7602			
J SAND	8016	8036			
NIOBRARA	7350	7366			

Total: 3 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J-55	24	0	706	350	706	0	CALC
1ST	7+7/8	4+1/2	P-110	11.6	0	8128	340	8128	6706	CBL
S.C. 1.1						5186	340	5186	4115	CBL

### Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7925 with 2 sacks cmt on top. CIBP #2: Depth 7230 with 2 sacks cmt on top.  
CIBP #3: Depth 4375 with 2 sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 20 sks cmt from 6500 ft. to 6300 ft. Plug Type: CASING Plug Tagged: ☐  
Set 83 sks cmt from 3100 ft. to 2800 ft. Plug Type: STUB PLUG Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at 6550 ft. with 45 sacks. Leave at least 100 ft. in casing 6500 CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 260 sacks half in. half out surface casing from 825 ft. to 0 ft. Plug Tagged: ☐

Set 10 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Number of Days from Setting Surface Plug to Capping or Sealing the Well: \_\_\_\_\_  
Surface Plug Setting Date: \_\_\_\_\_ Cut and Cap Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

Proposed WBD Attached  
No HPH (no consult necessary)

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Ashley Noonan  
Title: Sr. Regulatory Analyst Date: \_\_\_\_\_ Email: regulatory@civiresources.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_ Date: \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY: \_\_\_\_\_ Expiration Date: \_\_\_\_\_

<u>COA Type</u>	<u>Description</u>
0 COA	

### Attachment List

<u>Att Doc Num</u>	<u>Name</u>
403575807	WELLBORE DIAGRAM

Total Attach: 1 Files

### General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
		Stamp Upon Approval

Total: 0 comment(s)