

## Daily Operations

Well Name	Surface UWI	Primary Job Typ	Start Date	Summary
MILLAGE C11-07	0512322641	Abandon Well - Permanent	11/3/2023	<p>SAFETY MEETING            SI CSG 1300PSI            SI TBG 1400PSI            SI BH 0PSI            RIG PUSHER CONDUCTED ROUTE SURVEY W/ PILOT CAR. JSA MEETING W/ RIG CREW AND TRUCKERS. SWC/SYLA ON LIFTING AND RIGGING. MOVE IN FROM THE WAHLERT AC33-68HN. SWC/SYLA ON LIFTING AND RIGGING, SPOT WORK TANKS, PUMP AND FRAC TANK. PLACE BEAM ON ONE SIDE OF THE WH, WINCH TRUCK UN-HOOKED AND MOVED TO THE OTHER SIDE OF THE BEAM AND HOOKED BACK TO THE BEAM AND DRAGGED THE BEAM INTO POSITION. SPOT RIG. CHANGE PIPE RAMS TO 2.375". CHECK PRESSURES. LAYDOWN FLOWLINES AND GROUNDS, CHECK OHMS ON GROUNDS. ACCUMULATOR TEST, GOOD TEST, FUNCTION TEST BOPS. TEST BOPS 2.375" PIPE RAMS AND BLIND RAMS ON STUMP W/ HARDLINES AND 2.375" TIW VALVE AND 2.375" STABBING VALVE LOW/HIGH, GOOD TESTS. MIRU SELECT FLOWBACK. JSA MEETING W/ SLICK LINE. SWC/SYLA ON LIFTING AND RIGGING. MIRU CORE TECH, FISH OUT PADDED PLUNGER, FLOATING SPRING, STAGE TOOL AND ANOTHER PADDED PLUNGER. RDMO CORE TECH. RIG INSPECTION AND DROPS INSPECTION. SWI, WINTERIZE EQUIP, SECURE LOCATION, DE-BRIEF, SDFN.</p>
MILLAGE C11-07	0512322641	Abandon Well - Permanent	11/6/2023	<p>SAFETY MEETING            SI CSG 1300PSI            SI TBG 1400PSI            SI BH 0PSI            JSA MEETING. BLOW AIR THROUGH FLOW LINES. CHECK PRESSURES. JSA MEETING W/ FLOWBACK AND RIG HANDS. SWC/SYLA ON HOT WORKS. INCINERATE CSG DOWN TO 500PSI. PUMP FRESH DOWN CSG AND INCINERATE TBG. CIRC WELL CLEAN W/ 130BBLS. RDMO SELECT FLOWBACK. MONITOR WELL FOR 15MIN. RU AXIS 726. LOAD WELL W/ 5BBLS OF FRESH, MONITOR WELL FOR 15MIN. ND WH, NU 7-1/16" 5K BOPS W/ 2.375" PIPE RAMS AND MUD-CROSS. RU RIG FLOOR AND EQUIP. STACK TEST LOW/HIGH FOR 5MIN, GOOD TEST. SWC/SYLA ON TUBULAR'S AND WORKING AT HEIGHTS. TOOH SB 64JTS OF 2.375" J55 4.7# TBG INTO DERRICK. SWI, WINTERIZE EQUIP, SECURE LOCATION, SDFN</p>

## Daily Operations

Well Name	Surface UWI	Primary Job Typ	Start Date	Summary
MILLAGE C11-07	0512322641	Abandon Well - Permanent	11/7/2023	<p>SAFETY MEETING            SI CSG 0PSI            SI TBG 0PSI            SI BH 0PSI            JSA MEETING. GO OVER PIPE WRANGLER W/ CREW. BLOW AIR THROUGH FLOW LINES. CHECK PRESSURES. LOAD WELL W/ 40BBLs OF FRESH, 15MIN FLOW CHECK. SWC/SYLA ON TUBULAR'S, TOOHL 140JTS OF 2.375" J55 4.7# TBG ONTO GROUND W/ PIPE WRANGLER. JSA MEETING W/ RIG CREW AND WL HANDS, SWC/SYLA ON LIFTING AND RIGGING. MIRU AXIS WL, PU 3.5"OD 10K CIBP, RIH CORRELATE CCL, SET @6,701.0', POOH. PU 3.0" DB, PLACE 2SKS OF CMT ON CIBP @6,701.0', POOH. LOAD WELL W/ 20BBLs OF FRESH, PT TO 1500PSI FOR 15MIN, GOOD TEST. PU 3.5"OD 10K CIBP, RIH CORRELATE CCL, SET @6,326.0', POOH. PU 3.0" DB, PLACE 2SKS OF CMT ON CIBP @6,326.0', POOH. P/U &amp; RIH W/ TWO 6 SHOT SQZ GUN. SHOT HOLES @ 2,245.0'. PUH, SHOOT SECOND 6 SHOT SQZ GUN. SHOT HOLES @ 1,745.0'. OOH W/ SPENT GUNS. P/U &amp; RIH W/ CICR &amp; SET @ 2,145.0'. POOH W/ SETTING TOOL. RDMO WL. SWI, WINTERIZE EQUIP, SECURE LOCATION, DE-BRIEF, SDFN.</p> <p>50BBLs TO NGL C6</p>
MILLAGE C11-07	0512322641	Abandon Well - Permanent	11/8/2023	<p>SAFETY MEETING            SI CSG 0PSI            SI BH 0PSI            CREW HAD MEETING AT THEIR YARD TO GO OVER THEIR BENEFITS. JSA MEETING. BLOW AIR THROUGH FLOW LINES. CHECK PRESSURES, LOAD WELL W/ 2BBLs OF FRESH. 15MIN FLOW CHECK. SWC/SYLA ON TUBULAR'S AND WORKING AT HEIGHTS. TIH WHILE TALLYING 64JTS OF 2.375" J55 4.7# TBG FROM DERRICK, PU 1JT AND 4.0' SUB. STING INTO CICR @2,145.0'. JSA MEETING W/ RIG CREW AND CMT HANDS, SWC/SYLA ON LIFTING AND RIGGING. MIRU AXIS CMT, BREAK CIRC, PUMP 10BBLs OF FRESH, 10BBLs OF M/F, 5BBL SPACER, MIX AND PUMP 190SKS (38.9BBLs) OF CLASS G NEAT 1.15YLD 15.8# CMT PLACING 35SKS ON TOP OF CICR. RDMO CMT. SWC/SYLA ON TUBULAR'S. TOOHL, LD SUB AND 13JTS OF 2.375" J55 4.7# TBG TO 1,645.0', REVERSE CIRC 15BBLs. CONT TO TOOHL 52JTS W/ PIPE WRANGLER. LOAD WELL, 30MIN FLOW CHECK, NO BUBBLES, NO PSI BUILD UP. JSA MEETING W/ RIG CREW AND WL HANDS, SWC/SYLA ON LIFTING AND RIGGING. MIRU AXIS WL, PU 1.0' 6SPF PERF GUN, RIH AND PERF 4.5" CSG @748.0', POOH, RDMO WL. RU RIG PUMP, CIRC AND COND WELL DOWN CSG AND UP BH 80BBLs. MONITOR WELL, NO FLOW/NO PSI. SWC/SYLA ON WORKING AT HEIGHTS AND LIFTING AND RIGGING. RD RIG FLOOR, ND BOPS. NU WH. SWI, WINTERIZE EQUIP, SECURE LOCATION, DE-BRIEF, SDFN.</p> <p>120BBLs TO REPUBLIC</p>

## Daily Operations

Well Name	Surface UWI	Primary Job Typ	Start Date	Summary
MILLAGE C11-07	0512322641	Abandon Well - Permanent	11/9/2023	SAFETY MEETING SI CSG 0PSI SI BH 0PSI JSA MEETING, BLOW AIR THROUGH AIR LINES. CHECK PRESSURES, 30MIN FLOW CHECK, NO FLOW/NI PSI. JSA MEETING W/ RIG CREW AND CMT HANDS, MIRU AXIS CMT. BREAK CIRC, PUMP 10BBLS OF M/F, 5BBLS SPACER, MIX AND PUMP 288SKS (59BBLS) OF CLASS G NEAT 1.15YLD 15.8# CMT TO SURFACE, CMT IN RETURNS. RDMO CMT. CLEAN WORK TANK. REPLACE VALVE ON SURFACE W/ BULL PLUG. R/D FLOW LINES, SWC/SYLA ON LIFTING AND RIGGING, RDMO TO THE MILLAGE C11-22.  120BBLS TO REPUBLIC
MILLAGE C11-07	0512322641	Abandon Well - Permanent	11/14/2023	SI CSG 0PSI SI BH 0SPI TAG TOC @60.0' W/ KB 30MIN FLOW CHECK, NO FLOW/NO PSI BUILD UP.