

Inspection Photos

2/27/2024

Operator: CAERUS PICEANCE LLC #10456

Location ID: 335780

Inspection Doc: 696205626

Garfield County, CO

Aaron Trujillo
NW Reclamation Specialist
CECMC



COLORADO

Energy & Carbon Management
Commission

Department of Natural Resources

Inspection Photos

Operator Name: CAERUS PICEANCE LLC #10456

Location ID: 335780



February 27, 2024

Photo 1: Photo taken from the south end of the Location, facing north. Photo provides an overview of the Location.



COLORADO

**Energy & Carbon Management
Commission**

Department of Natural Resources

Inspection Photos

Operator Name: CAERUS PICEANCE LLC #10456

Location ID: 335780



Photo 2: Photos taken from the sediment trap on the west end of the Location. Sediment material has been removed from the BMP and berms have been maintained.



COLORADO

**Energy & Carbon Management
Commission**

Department of Natural Resources

Inspection Photos

Operator Name: CAERUS PICEANCE LLC #10456

Location ID: 335780



February 27, 2024

Photo 3: Continued from photo 2. Photo shows outlet of the sediment trap. Outlet has not yet been fully installed in accordance with good engineering practices, as geotextile lining in conjunction with combination coarse aggregate and riprap material was not observed; currently only large diameter rock material appears to have been placed at the outlet.



COLORADO

**Energy & Carbon Management
Commission**

Department of Natural Resources

Inspection Photos

Operator Name: CAERUS PICEANCE LLC #10456

Location ID: 335780



Photo 4: Photos taken from the working pad surface. BMPs to stabilize the working pad surface appears to have been maintained; additional compaction is apparent, and potentially addition of road base material. Continue to monitor and maintain BMPs to ensure location remains stabilized.



COLORADO

**Energy & Carbon Management
Commission**

Department of Natural Resources

Inspection Photos

Operator Name: CAERUS PICEANCE LLC #10456

Location ID: 335780



Photo 5: Photos 5-6 taken from the tank battery facility. Photos examples showing holes and tears remain apparent within the liner of the secondary containment measure.



COLORADO

**Energy & Carbon Management
Commission**

Department of Natural Resources

Inspection Photos

Operator Name: CAERUS PICEANCE LLC #10456

Location ID: 335780



Photo 6: See comments under photo 5. Photo right example showing patches from previous repair work have not been maintained.



COLORADO

**Energy & Carbon Management
Commission**

Department of Natural Resources

Inspection Photos

Operator Name: CAERUS PICEANCE LLC #10456

Location ID: 335780



Photo 7: Photo example showing Operator appears to have conducted some maintenance work at the containment measure. Work is insufficient as holes/tears remain.

Inspection Photos

Operator Name: CAERUS PICEANCE LLC #10456

Location ID: 335780



Photo 8: Photo taken from the slopes on the east end of the Location. Operator appears to have placed additional soil to repair the erosion degradation observed on the slopes on the east end of the Location. BMPs to stabilize the soils not observed per the CA. Unclear if additional reclamation work, such as seeding, has been performed.



COLORADO

**Energy & Carbon Management
Commission**

Department of Natural Resources

Inspection Photos

Operator Name: CAERUS PICEANCE LLC #10456

Location ID: 335780



Photo 9: Photo taken from the east end of the working pad surface, facing south. Photo shows stormwater ponding has persisted on the east end of the Pad.



COLORADO

**Energy & Carbon Management
Commission**

Department of Natural Resources