

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

ECMC Operator Number: 10487 Contact Name: Deborah Abrams
 Name of Operator: SPRINGDALE PARTNERS LLC Phone: (303) 8942100
 Address: 3409 MONTECLAIRE DR Fax: _____
 City: SHERMAN State: TX Zip: 75092 Email: deborah.abrams@state.co.us

For "Intent" 24 hour notice required, Name: Schure, Kym Tel: (970) 520-3832
 Email: kym.schure@state.co.us
ECMC contact: _____

Type of Well Abandonment Report: Notice of Intent to Abandon Subsequent Report of Abandonment

API Number 05-075-09249-00
 Well Name: SPRINGDALE Well Number: 6 (OWP)
 Location: QtrQtr: NESW Section: 15 Township: 8N Range: 53W Meridian: 6
 County: LOGAN Federal, Indian or State Lease Number: _____
 Field Name: SPRINGDALE Field Number: 78300

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.658500 Longitude: -103.289330
 GPS Data: GPS Quality Value: 2.4 Type of GPS Quality Value: _____ Date of Measurement: 12/18/2013
 Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other OWP
 Casing to be pulled: Yes No Estimated Depth: _____
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
J SAND	4868	4886			
Total: 1 zone(s)					

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+7/8	UNK	23	0	525	298	525	0	VISU
1ST	7+7/8	4+1/2	UNK	10.5	0	4979	125	4979	4100	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 4787 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at 3890 ft. with 40 sacks. Leave at least 100 ft. in casing 3800 CICR Depth

Perforate and squeeze at 1385 ft. with 40 sacks. Leave at least 100 ft. in casing 1295 CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 40 sacks half in. half out surface casing from 590 ft. to 475 ft. Plug Tagged:

Set 35 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing

Surface Plug Setting Date: _____ Cut and Cap Date: _____ Number of Days from Setting Surface Plug to Capping or Sealing the Well: _____

*Wireline Contractor: _____

*Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 Yes No

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Deborah Abrams

Title: OWP Date: 4/1/2024 Email: deborah.abrams@state.co.us

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with ECMC Rules and applicable orders and is hereby approved.

ECMC Approved: Wolfe, Stephen

Date: 4/9/2024

CONDITIONS OF APPROVAL, IF ANY LIST

Expiration Date: 10/8/2024

COA Type	Description
	<p>Bradenhead Testing Prior to starting plugging operations a bradenhead test shall be performed if there has not been a reported bradenhead test within the 60 days immediately preceding the start of plugging operations.</p> <ol style="list-style-type: none"> 1) If, before opening the bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required. 2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required. <p>The Form 17 shall be submitted within 10 days of the test. Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions. If samples are collected, copies of all final laboratory analytical results shall be provided to the ECMC within three (3) months of collecting the samples.</p> <p>If there is a need for sampling, contact ECMC engineering for verification of plugging procedure.</p>
	<p>Consistent with Rule 911.a, a Form 27 must be approved prior to cut and cap, conducting flowline abandonment, or removing production equipment. Allow 30 days for Director review of the Form 27; include the Form 27 document number on the Form 44 for offsite flowline abandonment (if applicable) and on the Form 6 Subsequent.</p>
	<p>Properly abandon flowlines per Rule 1105. If flowlines will be abandoned in place, include with the Form 27: pressure test results conducted in the prior 12 months as well as identification of any document numbers for a ECMC Spill/Release Report, Form 19, associated with the abandoned line.</p>
	<p>Plugging</p> <ol style="list-style-type: none"> 1) Provide electronic Form 42 Notice of MIRU 2 business days ahead of operations and electronic Form 42 Notice of Plugging Operations 48 hours prior to mobilizing for plugging operations. 2) Plugs and squeezes will be placed as stated in the Plugging Procedure section of the approved NOIA unless revised by COA or prior approval from ECMC is obtained. 3) The wellbore must be static prior to placing cement plugs which are to be a minimum of 100' in length for all but surface plugs. Mechanical isolation requires a 25' cement plug, minimum. For plugs not specified to be tagged, a tag is required if circulation is not maintained while pumping plug and displacing to depth. Wait on cement(WOC) a minimum of 4 hrs before tagging a plug. Tag at tops specified or shallower. Notify ECMC Area Engineer before adding cement to previous plug due to low cement top. 4) Place a 50' plug (minimum) at the surface, both inside the inner most casing and in all annular spaces. Surface plugs shall be circulated to surface or placed in such a way as to ensure the full 50' plug. Confirm cement to surface and complete isolation in all strings during cut and cap. After cut and prior to cap, verify isolation by either a 15 minute bubble test or 15 minute optical gas imaging recording. If there is indication of flow contact ECMC Engineering. Provide a statement on the 6 SRA which method was used and what was observed. Retain records of final isolation test for 5 years. 5) With the Form 6 SRA operator must provide written documentation which positively affirms each COA has been addressed. 6) No current Form 17 on file with ECMC. Contact ECMC area engineer with results of pre-plugging bradenhead test for confirmation of plugging procedure prior to commencing plugging operations. 7) Operator must wait a sufficient time on all plugs to achieve the intended design. If at any time during the plugging there is evidence of previously unreported pressure or fluid migration, contact ECMC Area Engineer before continuing operations. 8) Plugging procedure has been modified as follows, Plug #1 - 4787', CIBP with 2 sx of cement, Plug #2 - 3890', perf and squeeze with 40 sx of cement through a CICR set at 3800', spot 10 sx of cement on top of the CICR, Plug #3 - 1385', perf and squeeze with 40 sx of cement through a CICR set at 1295', spot 10 sx of cement on top of the CICR, Plug #4 - 590', perf and squeeze 40 sx, WOC and tag at 475' or shallower Plug #5 - 50' of cement at the surface in both the casing and the annulus per COA #4. 9) Submit any logs run during the plugging with the Form 6 SRA.
4 COAs	

ATTACHMENT LIST

<u>Att Doc Num</u>	<u>Name</u>
403736635	FORM 6 INTENT SUBMITTED
403738661	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Engineer	Groundwater=Laramie-Fox Hills, Upper Pierre Deepest water well=540'(1mi, 20 records) Logs=075-09249 10/5/1992 GR=4144' L-FH behind SC	04/09/2024
Permit	Confirmed as-drilled well location. No other forms in process. Production reporting up-to-date. Confirmed productive interval docnum: 210722. Reviewed WBDs. Pass.	04/08/2024
OGLA	LAS review completed. Well is not in an HPH. No RBU's within 1000 feet. No wetlands of concern.	04/02/2024

Total: 3 comment(s)