

**FORM
INSP**

Rev
X/20

**State of Colorado
Oil and Gas Conservation Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

05/14/2024

Submitted Date:

05/15/2024

Document Number:

715500024

FIELD INSPECTION FORM

Loc ID 312932 Inspector Name: Burchett, Kirby On-Site Inspection 2A Doc Num: _____

Status Summary:

- THIS IS A FOLLOW UP INSPECTION
- FOLLOW UP INSPECTION REQUIRED
- NO FOLLOW UP INSPECTION REQUIRED

Operator Information:

ECMC Operator Number: 3975
Name of Operator: ARGALI EXPLORATION COMPANY
Address: PO BOX 416
City: RANGELY State: CO Zip: 81648

Findings:

- 11 Number of Comments
- 4 Number of Corrective Actions
- Corrective Action Response Requested

ANY CORRECTIVE ACTION(S) FROM PREVIOUS INSPECTIONS THAT HAVE NOT BEEN ADDRESSED ARE STILL APPLICABLE

Contact Information:

Contact Name	Phone	Email	Comment
Rector, Jeff	(970) 629-2614	jbrduco@yahoo.com	
Rector, Brian	(970) 629-1906	brector1983@gmail.com	
Wilson, Justin	(970) 878-3825	jrwilson@blm.gov	
, Inspections		argaliexplorationcompany@gmail.com	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
222889	WELL	PR	02/01/2024	GW	081-06249	FEDERAL 1-23	PR

General Comment:

[ECMC Inspection Report Summary](#)

On Tuesday, 05/14/2024, Inspector Kirby Burchett, conducted a routine field inspection at Argali Exploration Company on the Federal 1-23 well, Location #312932, in Moffat County, Colorado.

This location is within or in close proximity to Parks and Wildlife (CPW) District with High Priority, NSO, Density and Other Consultation Habitat regulations.

Any Corrective Actions from previous Inspections are still applicable.

While there during normal operations the following compliance issues were observed:

1. Random debris.
 2. Unmarked anchor.
 3. Equipment open to wildlife.
 4. Cap missing on relief riser.
 5. Bradenhead open and venting. Contacted Operator.
- Followed up on Bradenhead venting on 5/15/24. Valve had been shut and handle removed.
Refer to Inspection Photos for observed compliance issues.

A follow up on this site inspection will be conducted to ensure all compliance issues have been corrected to comply with ECMC rules.

Location			
Overall Good: <input type="checkbox"/>			
Signs/Marker:			
Type	OTHER		
Comment:	Separator units include attached storage tanks. No form of labeling or markers are present to identify a potential hazard or the contents of the storage tank.		
Corrective Action:			Date:
Type	WELLHEAD		
Comment:			
Corrective Action:			Date:
Emergency Contact Number:			
Comment:	970-629-1906 or 911		Date: _____
Corrective Action:			
Good Housekeeping:			
Type	OTHER		
Comment:	Separator lines open to wildlife		
Corrective Action:	All stacks, vents, or other openings will be equipped with screens or other appropriate equipment to prevent entry by wildlife, including birds and bats.		Date: <u>05/25/2024</u>
Type	DEBRIS		
Comment:	Random debris		
Corrective Action:	All excess materials, rubbish, supplies, trash, or other waste material will be properly contained until removed from the Oil and Gas Location. At no time will debris be placed or remain on the ground.		Date: <u>05/22/2024</u>
Overall Good: <input type="checkbox"/>			
Spills:			
Type	Area	Volume	
In Containment: No _____			
Comment: _____			
<input type="checkbox"/> Multiple Spills and Releases?			
Equipment:			
Type: Horizontal Heated Separator # 1			corrective date
Comment: Relief riser missing cap			
Corrective Action: Vents on pressure safety devices will terminate in a manner so as not to endanger the public or adjoining facilities. They will be designed to be clear and free of debris and water at all times.		Date: <u>05/30/2024</u>	
Type: Bird Protectors # 2			
Comment:			
Corrective Action:		Date:	
Type: Other # 1			
Comment: Wellhead tree			
Corrective Action:		Date:	
Type: Flow Line # 1			
Comment:			

Corrective Action:		Date:	
Type: Deadman # & Marked	# 3		
Comment:	1 unmarked anchor		
Corrective Action:	All guy line anchors left buried for future use will be identified by a marker of bright color not less than 4 feet in height and not greater than 1 foot east of the guy line anchor.		Date: 05/29/2024

Venting:

Yes/No	YES		
Comment:	Bradenhead open and venting. Contacted Operator. Response received that action would be taken within 24 hrs. Verified on 5/15/24. Valve was shut and handle removed.		
Corrective Action:		Date:	

Flaring:

Type			
Comment:			
Corrective Action:		Date:	

Inspected Facilities

Facility ID: 222889 Type: WELL API Number: 081-06249 Status: PR Insp. Status: PR

Producing Well

Comment: [March 2024 Production Report](#)

Corrective Action:

Date:

The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12

Reclamation - Storm Water - Pit

Storm Water:

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
Ditches						

Comment: [Operator is responsible for maintaining Best Management Practices \(BMPs\) to control vehicle tracking and potential sediment discharges from operational roads, well pads, and other unpaved surfaces.](#)

Corrective Action:

Date: _____

Pits: NO SURFACE INDICATION OF PIT

Attached Documents

You can go to ECMC Images (<https://ecmc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
403792501	INSPECTION SUBMITTED	https://ecmc.state.co.us/weblink/DownloadDocumentPDF.aspx?DocumentId=6549373
715500025	Inspection Photos	https://ecmc.state.co.us/weblink/DownloadDocumentPDF.aspx?DocumentId=6549362