

Document Number:
403828414

Date Received:
06/18/2024

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

ECMC Operator Number: 47120 Contact Name: Lorena Ruiz
 Name of Operator: KERR MCGEE OIL & GAS ONSHORE LP Phone: (970) 336-3535
 Address: P O BOX 173779 Fax: _____
 City: DENVER State: CO Zip: 80217- Email: lorena_ruiz@oxy.com

For "Intent" 24 hour notice required, Name: Carlile, Craig Tel: (970) 629-8279
 Email: craig.carlile@state.co.us

Type of Well Abandonment Report: Notice of Intent to Abandon Subsequent Report of Abandonment

API Number 05-123-08232-00
 Well Name: UPRR 42 PAN AM GAS UNIT X Well Number: 1
 Location: QtrQtr: SWNE Section: 31 Township: 3N Range: 66W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: _____
 Field Name: WATTENBERG Field Number: 90750

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.184270 Longitude: -104.815320
 GPS Data: GPS Quality Value: 2.6 Type of GPS Quality Value: _____ Date of Measurement: 07/24/2008

Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other _____

Casing to be pulled: Yes No Estimated Depth: 1535
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
J SAND	7771	7820			

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J-55	24	0	601	475	601	0	VISU
1ST	7+7/8	4+1/2	I-80	10.5	0	7900	200	7938	6430	CALC

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7700 with 2 sacks cmt on top. CIBP #2: Depth 260 with 80 sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 5 sks cmt from 7030 ft. to 6970 ft. Plug Type: CASING Plug Tagged:
Set 20 sks cmt from 4105 ft. to 3845 ft. Plug Type: CASING Plug Tagged:
Set 55 sks cmt from 2500 ft. to 1800 ft. Plug Type: CASING Plug Tagged:
Set 80 sks cmt from 260 ft. to 0 ft. Plug Type: CASING Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at 7060 ft. with 95 sacks. Leave at least 100 ft. in casing 7030 CICR Depth

Perforate and squeeze at 4525 ft. with 145 sacks. Leave at least 100 ft. in casing 4105 CICR Depth

Perforate and squeeze at 2500 ft. with 165 sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 400 sacks half in. half out surface casing from 1535 ft. to 551 ft. Plug Tagged:

Set 80 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing

Surface Plug Setting Date: _____ Cut and Cap Date: _____ Number of Days from Setting Surface Plug to Capping or Sealing the Well: _____

*Wireline Contractor: _____

*Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 Yes No

Technical Detail/Comments:

Signage for P&As:

Prior to commencing operations, KMG will post signs in conspicuous locations. The signs will indicate plugging and abandonment operations are being conducted, the well name, well, and the Operator's contact information. Signs will be placed so as not to create a potential traffic hazard.

Notifications:

Courtesy notifications will be sent to all parcel owners with building units within 1,500 feet of the location letting them know about out plugging and abandonment operations and providing contact information for Kerr McGee's response line and online resources.

Wellbore Pressure:

In some cases, wellbore pressure drawdown operations may occur approximately 1-2 days prior to Move In Rig Up (MIRU) of the workover rig. This is conducted to allow for reduced time that the workover rig is needed on location. These operations will be conducted in accordance with Form 4 and/or Form 6 requirements.

Water:

Water will be placed on dirt access roads to mitigate dust as needed.

Lighting:

Operations are daylight-only; no lighting impacts are anticipated from operations.

Noise:

Operations will be in compliance with Table 423-1 requirements. Based off the rig sound signature, rig orientation will be considered to reduce noise levels to nearby building units.

Environmental Concerns:

This location was reviewed using a desktop method to review publicly available wildlife data (including CPW & ECMC data) as well as internal wildlife datasets and aerial imagery. All field personnel are trained to identify wildlife risks and raise concerns noticed during operations with the KMOG Health, Safety, and Environment (HSE) department.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Lorena Ruiz
Title: Regulatory Tech Date: 6/18/2024 Email: lorena_ruiz@oxy.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with ECMC Rules and applicable orders and is hereby approved.

ECMC Approved: McFarland, Nick Date: 6/24/2024

CONDITIONS OF APPROVAL, IF ANY LIST

Expiration Date: 12/23/2024

<u>COA Type</u>	<u>Description</u>
	<p>Prior to starting plugging operations a bradenhead test shall be performed if there has not been a reported bradenhead test within the 60 days immediately preceding the start of plugging operations.</p> <p>1) If, before opening the bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required.</p> <p>2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required.</p> <p>The Form 17 shall be submitted within 10 days of the test. Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions. If samples are collected, copies of all final laboratory analytical results shall be provided to the ECMC within three (3) months of collecting the samples.</p> <p>If there is a need for sampling, contact ECMC engineering for verification of plugging procedure.</p>
	<p>Operator shall implement measures to control venting, to protect health and safety, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare.</p>

	<p>Consistent with Rule 911.a, a Form 27 must be approved prior to cut and cap, conducting flowline abandonment, or removing production equipment. Allow 30 days for Director review of the Form 27; include the Form 27 document number on the Form 44 for offsite flowline abandonment (if applicable) and on the Form 6 Subsequent.</p> <p>Properly abandon flowlines per Rule 1105. If flowlines will be abandoned in place, include with the Form 27: pressure test results conducted in the prior 12 months as well as identification of any document numbers for a ECMC Spill/Release Report, Form 19, associated with the abandoned line.</p>
	<ol style="list-style-type: none"> 1) Provide electronic Form 42 Notice of MIRU 2 business days ahead of operations and electronic Form 42 Notice of Plugging Operations 48 hours prior to mobilizing for plugging operations. These are two separate notifications, required by Rules 405.e and 405.i. 2) Operator shall run a new CBL to verify existing cement coverage. Provide a copy to ECMC engineering for verification of plugging orders. 3) After placing the squeeze at 2500' assure that all fluid migration has been eliminated by monitoring the well for a minimum of 8 hours before proceeding to the next plug. If at any time after placing this plug there is evidence of pressure or of fluid migration, contact ECMC engineering before continuing operations. 4) Prior to placing cement above the base of the Upper Pierre (1530') : verify that all fluid (liquid and gas) migration has been eliminated. If evidence of fluid migration or pressure remains, contact ECMC Engineer for an update to plugging orders. 5) Pump surface casing shoe plug only after isolation has been verified. If surface casing cement is not circulated to surface, shut-in, WOC 4 hours then tag plug – must be at 551' or shallower and provide a minimum of 10 sx plug at the surface. 6) Leave at least 100' of cement in the wellbore for each plug without mechanical isolation. 7) After surface plug and prior to cap, verify isolation by either a 15 minute bubble test or 15 minute optical gas imaging recording. If there is indication of flow contact ECMC Engineering. Provide a statement on the 6SRA which method was used and what was observed. Retain records of final isolation test for 5 years. 8) With the Form 6 SRA operator must provide written documentation which positively affirms each COA listed above has been addressed.
	<p>Due to proximity to a mapped wetland and surface water, operator will use secondary containment for all tanks and other liquid containers. Operator will implement stormwater BMPs and erosion control measures as needed to prevent sediment and stormwater runoff from entering the wetland and surface water.</p>

Operator committed to the following Best Management Practices under the Technical Detail/ Comments section on the Submit Tab:

Signage for P&As:
 Prior to commencing operations, KMG will post signs in conspicuous locations. The signs will indicate plugging and abandonment operations are being conducted, the well name, well, and the Operator's contact information. Signs will be placed so as not to create a potential traffic hazard.

Notifications:
 Courtesy notifications will be sent to all parcel owners with building units within 1,500 feet of the location letting them know about out plugging and abandonment operations and providing contact information for Kerr McGee's response line and online resources.

Wellbore Pressure:
 In some cases, wellbore pressure drawdown operations may occur approximately 1-2 days prior to Move In Rig Up (MIRU) of the workover rig. This is conducted to allow for reduced time that the workover rig is needed on location. These operations will be conducted in accordance with Form 4 and/or Form 6 requirements.

Water:
 Water will be placed on dirt access roads to mitigate dust as needed.

Lighting:
 Operations are daylight-only; no lighting impacts are anticipated from operations.

Noise:
 Operations will be in compliance with Table 423-1 requirements. Based off the rig sound signature, rig orientation will be considered to reduce noise levels to nearby building units.

Environmental Concerns:
 This location was reviewed using a desktop method to review publicly available wildlife data (including CPW & ECOM data) as well as internal wildlife datasets and aerial imagery. All field personnel are trained to identify wildlife risks and raise concerns noticed during operations with the KMOG Health, Safety, and Environment (HSE) department.

6 COAs

ATTACHMENT LIST

Att Doc Num	Name
403828414	FORM 6 INTENT SUBMITTED
403828427	PROPOSED PLUGGING PROCEDURE
403828429	WELLBORE DIAGRAM

Total Attach: 3 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Engineer	06/19/24 - BH test 7 psi w/ liquid. SI since August 2020. 6A filed July 2022. SB5 Base of Fox Hills: 423' Deepest Water Well Within One Mile: 487' Number of Wells: 70 UPA Base 1530' - Induciton Log Production within one mile: JSND, CODL, NBRR, SUSX	06/24/2024
Permit	Confirmed as-drilled well location. Production reporting up-to-date. No other forms in process. Confirmed productive intervals docnum: 103541. Reviewed procedure and WBD. Pass.	06/24/2024
OGLA	Location Assessment Specialist (LAS) review complete. Well is not in a HPH and not near RBUs.	06/21/2024

Total: 3 comment(s)