

OCCIDENTAL PETROLEUM CORPORATION

Please contact your area engineer with any questions concerning this procedure.

7/1/2024

PLUG and ABANDONMENT PROCEDURE

MOSER 14-28

API: 05-123-29439

**Step Description**

1	Review Previous Open Wells Reports/Well History. If you have questions or concerns, contact Foreman/Engineer.
2	COA: Provide 48 hour notice to Colorado ECMC prior to rig up per request on approved Form 6 (e.g. call field coordinator, submit Form 42, etc.).
3	Notify Automation Removal Group at least 24 hours prior to rig move. Request they catch and remove plunger, isolate production equipment, and remove any automation prior to rig MIRU.
4	MIRU Slickline. Pull production equipment and tag bottom. Record tag depth, casing/tubing pressures and fluid level in Open Wells. Gyro was run on 12/16/11. RDMO Slickline.
5	Prepare location for base beam equipped rig. Install perimeter fence as needed.
6	COA: Verify Form 17 (State Bradenhead Test) has been run within 60 days of RU.
7	Refer to the Rockies Well Services Guidelines document whenever rigging up BOP and WL, or whenever tripping in or out of the well. Consult with Foreman/Engineer before deviating from these guidelines. All cement jobs (excluding injections squeezes) must be pumped at 4-6 BPM. All cement plugs pumped through tubing must use the Diverter tool. Final top-out can be pumped between 2-4 BPM.
8	Upon RU, check and record bradenhead pressure. If bradenhead valve is not accessible, re-plumb so that valve is above GL. Blow down bradenhead and leave open during working hours. Re-check pressure each day and input value in the "Casing press." box in Open Wells.
9	MIRU WO rig. Spot a min of 226 jts of 2-3/8", 4.7#, J-55, EUE tbg. Verify BOP and wellhead rating, inspect for appropriate API standards, pressure test BOP. Kill well as necessary using biocide treated fresh water. ND WH. NU BOP. Unland tbg. **Barrier Management** Fluid will be the only barrier while NU BOP. Stop and review JSA.
10	TOOH and SB all 2-3/8" tbg.
11	Niobrara Injection Squeeze
12	PU and TIH with (4-1/2", 11.6#) CIRC on 2-3/8" tbg. Set CIRC at 6878'.
13	Establish an injection rate with treated water. Record rate and pressure results and report them to the Foreman/Engineer. Plugging orders may change based on results. When 1 bpm is achieved, record pressure and successful test has been completed.
14	Note: Do not exceed 40 bbls of cement on injection squeezes.
15	MIRU cementers. Pump Niobrara Injection Squeeze: 100 sx (27.1 bbl or 152 cf) of the Niobrara Cement blend: Class G with 0.4% B547 Gas Block (Latex) and 0.4% D255 FLA (Fluid Loss) and 35% D066 Silica Flour and 0.2% D800 (Retardant) and 0.3% D065 (Dispersant). Underdisplace by 2 bbls, leaving 10 sx on top of CIRC. Collect wet and dry samples of cement to be left on rig. RDMO cementers.
16	Pull tbg up to 6650' and reverse circulate 2x well volume until well is clean.
17	Pull out of cement. TOOH, SB 4250' of 2-3/8" tbg. LD remaining tbg.
18	Ensure hole has been circulated clean to remove gas interference. Run CCL/GR/CBL/VDL log from +/- 6000' to surface to confirm squeeze location. Future operations may change depending on CBL results.
19	Forward logs to engineering and in addition to the normal handling of logs/job summaries, email copies of all cement job logs/job summaries and invoices to DJVendors@oxy.com within 24 hours of job completion. Note that squeeze hole locations and cement volumes may vary depending on CBL results.
20	Sussex Injection Squeeze
21	PU and RIH with THREE 4', 3-1/8" deep penetrating perf gun wth 4 spf. Shoot squeeze holes at 4280', 2700', AND 990'. POOH. RDMO WL.
22	PU and TIH with (4-1/2", 11.6#) CIRC on 2-3/8" tbg. Set CIRC at 4250'.
23	Establish an injection rate with treated water. Record rate and pressure results and report them to the Foreman/Engineer. Plugging orders may change based on results. When 1 bpm is achieved, record pressure and successful test has been completed.

24	If gas is present, consider swabbing and venting before pumping injection squeeze.
25	Note: Do not exceed 40 bbls of cement on injection squeezes.
26	MIRU cementers. Pump Sussex Squeeze: 100 sx (21.2 bbl or 119 cf) of the Sussex AGM: Class G with 0.4% B547 Gas Block (Latex) and 2% D053 Expansion (Gyp) and 0.25% D255 FLA (Fluid Loss) 0.3% D065 (Dispersant). Underdisplace by 1 bbls, leaving 5 sx on top of CICR. Collect wet and dry samples of cement to be left on rig. RDMO Cementers.
27	Pull tbq up to 4090' and reverse circulate 2x well volume until well is clean.
28	TOOH and SB 2770' of 2-3/8" tbq. LD stinger, and remaining tbq.
29	Lower AGM Injection Squeeze
30	PU and TIH with (4-1/2", 11.6#) packer on 2-3/8" tbq. Set packer at 2670'.
31	Establish an injection rate with treated water. Record rate and pressure results and report them to the Foreman/Engineer. Plugging orders may change based on results. When 1 bpm is achieved, record pressure and successful test has been completed.
32	Release packer. TOOH, SB 2-3/8" tbq. LD packer.
33	If gas is present, consider swabbing and venting before pumping injection squeeze.
34	PU and TIH with (4-1/2", 11.6#) CICR on 2-3/8" tbq. Set CICR at 2670'.
35	Note: Do not exceed 40 bbls of cement on injection squeezes.
36	MIRU cementers. Pump Squeeze: 100 sx (21.6 bbl or 121 cf) of the Lower AGM blend: Class G with 0.4% B547 Gas Block (Latex) and 1% S001 CC (Calcium Chloride) and 4% D053 Expansion (Gyp). Underdisplace by 1 bbls, leaving 5 sx on top of CICR. Collect wet and dry samples of cement to be left on rig. RDMO Cementers.
37	Pull out of cement. TOOH to 2610'. Reverse circulate a minimum of 2 hole volume after cementing to ensure no cement is left in the tbq or annulus.
38	TOOH and SB 960' of 2-3/8" tbq. LD stinger, and remaining tbq.
39	COA: Prior to placing cement above the base of the Upper Pierre (1668'): verify that all fluid (liquid and gas) migration has been eliminated. If evidence of fluid migration or pressure remains, contact ECMC Engineer for an update to plugging orders.
40	Upper AGM Injection Squeeze
41	PU and TIH with (4-1/2", 11.6#) packer on 2-3/8" tbq. Set packer at 960'.
42	Establish an injection rate with treated water. Record rate and pressure results and report them to the Foreman/Engineer. Plugging orders may change based on results. When 1 bpm is achieved, record pressure and successful test has been completed.
43	Release packer. TOOH, SB 2-3/8" tbq. LD packer.
44	If gas is present, consider swabbing and venting before pumping injection squeeze.
45	PU and TIH with (4-1/2", 11.6#) CICR on 2-3/8" tbq. Set CICR at 960'.
46	Note: Do not exceed 40 bbls of cement on injection squeezes.
47	MIRU cementers. Pump Squeeze: 95 sx (20.6 bbl or 116 cf) of the Upper AGM blend: Class G with 0.4% B547 Gas Block (Latex) and 1.5% S001 CC (Calcium Chloride) and 4% D053 Expansion (Gyp). Underdisplace by 1 bbls, leaving 0 sx on top of CICR. Collect wet and dry samples of cement to be left on rig. RDMO Cementers.
48	Pull out of cement. TOOH to 950'. Reverse circulate a minimum of 2 hole volume after cementing to ensure no cement is left in the tbq or annulus.
49	TOOH and SB 960 of 2-3/8" tbq. LD stinger, and remaining tbq.
50	SC Shoe Plug
51	Raise mechanical cutter on 2-3/8" tbq. Cut 4-1/2", 11.6# casing at 650'. TOOH and LD cutter.
52	Attempt to establish circulation with biocide treated fresh water.
53	ND BOP. ND TH. Un-land casing. Rig max pull shall be 100,000#. Max pull over string weight shall be 50,000#. If unable to unland, contact Foreman/Engineer. **Barrier Management** Fluid will be the only barrier while unlanding casing. Stop and review JSA.
54	Install BOP on casing head with 4-1/2", 11.6# pipe rams. **Barrier Management** Fluid will be the only barrier while NU BOP. Stop and review JSA.
55	TOOH and LD all 4-1/2", 11.6# casing. Remove 4-1/2", 11.6# pipe rams and install 2-3/8" pipe rams.
56	TIH with diverter tool on 2-3/8" tbq to 830'. Establish circulation to surface with biocide treated fresh water and circulate bottoms up.

57	Initiate circulation at low rate monitoring returns for fluid. Add mud thinner to hydrate/clean mud. Slowly increase circulation rate to 4-6 BPM using mud thinner and gel polymer sweeps as needed.
58	Pump 30 bbls of 160F HSF (0.125 gals/bbl or 0.5 lbs/bbl) and let soak for ~1 hour.
59	Continue circulating at 4-6 BPM if possible. If returns show hydrocarbons or a 1 hr build-up shows pressure, swab and vent well and clean open tank. Circulate clean fluid before pumping cement.
60	COA: Verify and document that all pressure and fluid migration has been eliminated prior to placing the SC shoe plug at 830'. If there is evidence of pressure or fluid migration, contact Engineering.
61	MIRU cementers. Pump Surface Casing Shoe Plug: Pump 55 sx (11.8 bbl or 66.6 cf) of the Upper AGM blend: Class G with 0.4% B547 Gas Block (Latex) and 1.5% S001 CC (Calcium Chloride) and 4% D053 Expansion (Gyp). Volume is based on 230' in 4-1/2", 11.6# production casing with no excess. 100' in the 8-5/8", 24# surface casing with no excess. The plug is designed to cover 960'-550'. Collect wet and dry samples of cement to be left on rig. RDMO Cementers.
62	COA: If cement was not circulated to surface, then WOC 4 hours. Tag TOC. TOC must be 600' or shallower. If tag is too deep or there is evidence of pressure or fluid migration, contact Engineering.
63	Pull out of cement. TOO H to 260'. Forward circulate tbg clean with fresh water. TOO H & SB 260' of tubing. WOC 4 hours.
64	Note: Plug can be tagged after a 4 hour WOC, but must have a 6 hour WOC prior to pressure testing.
65	Surface Plug
66	ND 7-1/16" BOP. NU 9" or 11" BOP. RIH with bit and scraper. Clean csg and tag TOC. Circulate Clean. POOH. PT casing to 500 psi. Contact engineering if test fails.
67	RIH w/ 8-5/8" 24# CIBP on Mechanical Setting Tool on 2-3/8" Tbg to set at 260'. POOH & LD tools.
68	TIH with diverter tool on 2-3/8" tubing to 260'. Either swab well down or use rig air to remove water from well. (Note: Do not exceed 175 psi if using rig air). If either methods cannot be performed, contact engineering to discuss excess cement volume for top out plug.
69	DO NOT PUMP WATER AHEAD OF CEMENT. MIRU Cementers. Pump Surface Plug: Pump 80 sx (17.3 bbl or 97 cf) of the Surface AGM blend: Class G with 0.4% B547 Gas Block (Latex) and 2% S001 CC (Calcium Chloride) and 4% D053 Expansion (Gyp). Volume based on 260' inside 8-5/8", 24# surface casing with no excess. Cement will be from 260' to surface. Verify and document cement to surface. Collect wet and dry samples of cement to be left on rig.
70	TOOH and remove diverter tool. Insert ~5' of 2-3/8" Tbg. Circulate FW to clean Csg & Csg Valves. LD final joint of 2-3/8" Tbg. RDMO cementers. ND BOP. Install night cap. RDMO WO rig.
71	Instruct cementing, tools and wireline contractors to e-mail copies of all job logs/job summaries to rscDJVendors@oxy.com within 24 hours of completion of the job.
72	Supervisor submit paper copies of all invoices, logs, and reports to Well Services Engineering Specialist.
73	Excavation crew to notify One Call to clear excavation area around wellhead and for flow lines.
74	Excavate hole around surface casing enough to allow welder to cut casing a minimum 5' below ground level.
75	Welder cut casing minimum 5' below ground level.
76	Spot weld on steel marker plate. Marker should contain Well name, Well number, legal location (1/4 1/4 descriptor) and API number.
77	Obtain GPS location data as per ECMC Rule 215 and provide to GPS Teams page and Oxy GIS database.
78	Properly abandon flow lines per Rule 1105. File electronic Form 42 and/or Form 44 once abandonment is complete.
79	Back fill hole with fill. Clean location, and level.
80	Submit Form 6 Subsequent Report to ECMC ensuring to provide 'As performed' WBD identifying operations completed.