

**FORM
INSP**Rev
X/20**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

07/25/2024

Submitted Date:

08/05/2024

Document Number:

708201440**FIELD INSPECTION FORM**Loc ID 333124 Inspector Name: Edwardson, Dylan On-Site Inspection ☐ 2A Doc Num: _____**Operator Information:**ECMC Operator Number: 46290Name of Operator: KP KAUFFMAN COMPANY INCAddress: 1700 LINCOLN ST STE 4550City: DENVER State: CO Zip: 80203**Status Summary:**

- ☒
- THIS IS A FOLLOW UP INSPECTION
-
- ☒
- FOLLOW UP INSPECTION REQUIRED
-
- ☐
- NO FOLLOW UP INSPECTION REQUIRED

Findings:8 Number of Comments3 Number of Corrective Actions

- ☒
- Corrective Action Response Requested

**ANY CORRECTIVE ACTION(S) FROM
PREVIOUS INSPECTIONS THAT HAVE NOT
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
,		dnr_ecmc_engineering@state.co.us	
,		cogcc@kpk.com	ALL INSPECTIONS
Watzman, Ross	303-825-4822	rwatzman@kpk.com	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
240925	WELL	SI	04/01/2021	OW	123-08713	NESSU-KINDER 16	RI
333124	LOCATION	AC			-	NESSSU-KINDER-62N66W 20NESE	RI

General Comment:

This is a follow-up Field Inspection Report for Location ID (333124) in response to the previous Field Inspection Report (doc #708201405) conducted on 07/09/2024.

Operator submitted FIRR (doc #403852133) stating that corrective action(s) have been completed.

Any corrective action(s) from previous inspections that have not been resolved are still applicable.

LocationOverall Good: ☐**Signs/Marker:**

Type	WELLHEAD		
Comment:	Previous FIRs (doc #711700005; 05/22/2024) and (doc #708201405; 07/09/2024) documented that the wellhead sign (Nessu 16) does not match registered well name (Nessu-Kinder 16). At the time of this inspection, it does not appear that the wellhead sign has been updated.		
Corrective Action:	Install sign to comply with Rule 605.d.	Date:	09/05/2024

Emergency Contact Number:

Comment:		
Corrective Action:		Date: _____

Good Housekeeping:

Type	OTHER		
Comment:	Wellhead valve is unreadable/disfunctional as needle is not attached to dial.		
Corrective Action:		Date:	
Type	UNUSED EQUIPMENT		
Comment:	Previous FIRs (doc #711700005; 05/22/2024) and (doc #708201405; 07/09/2024) documented that a dismantled pumping unit sits adjacent to wellhead enclosure. Unused equipment should be removed. At the time of this inspection, it does not appear that equipment has been returned to service or removed from the location.		
Corrective Action:	Comply with Rule 606 and remove unused equipment or return to service.	Date:	09/05/2024
Type	WEEDS		
Comment:	Previous FIRs (doc #711700005; 05/22/2024) and (doc #708201405; 07/09/2024) documented weed growth around the wellhead and spreading onto adjacent areas. It was observed that undesirable vegetation does not appear to have been managed since the last inspection. CO List B Noxious Weed (musk thistle); List C Noxious Weed (canada thistle); and undesirable vegetation (kochia, prickly lettuce) was observed throughout the well location. Refer to attached inspection photos.		
Corrective Action:	Comply with Rule 606 to manage weedy vegetation. This has been out of compliance since it was previously observed on FIR (doc #711700005) on 05/22/2024. Original Corrective Action date remains applicable.	Date:	07/19/2024

Overall Good: ☐**Spills:**

Type	Area	Volume		
------	------	--------	--	--

In Containment: No

Comment: ☐ Multiple Spills and Releases?**Venting:**

Yes/No			
Comment:	Previous FIRs (doc #711700005; 05/22/2024) and (doc #708201405; 07/09/2024) documented that venting was observed as bubbles in standing water at the top of casing head assembly. Operator submitted FIRR (doc #403852133) with photo documentation stating that the corrective action has been completed and the wellhead pack off rubber was replaced. At the time of this inspection, it appears that the casing head assembly has been repaired and no audio/visual indications of venting were observed. Refer to attached inspection photos.		
Corrective Action:		Date:	

Flaring:

Type		
Comment:		
Corrective Action:		Date:

Inspected Facilities

Facility ID: 240925 Type: WELL API Number: 123-08713 Status: SI Insp. Status: RI

Idle Well

Purpose: ☐ Shut In ☐ Temporarily Abandoned Reminder: _____

Comment: Comment from previous FIR (doc #711700005 and #708201405) documented that well was last produced 3/2021. Well does not meet definition of Shut-In but does meet the definition of Temporarily Abandoned. Well is overdue for MIT under either definition. MIT requires 10day notification via Form 42. Well plugging requires an approved Form 6 Intent to Abandon to Plug Well. Note: FIR Doc 702403248 included a Corrective Action to MIT and plug or produce. No documentation on file supports that the CA has been complied with.

This well has been previously identified as being overdue for an MIT. It does not appear that any MIT has been performed at the time of submitting this Field Inspection Report.

Corrective Action: _____ Date: _____

The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12

Facility ID: 333124 Type: LOCATION API Number: - Status: AC Insp. Status: RI

The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12

Attached Documents

You can go to ECMC Images (<https://ecmc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
403877213	INSPECTION SUBMITTED	https://ecmc.state.co.us/weblink/DownloadDocumentPDF.aspx?DocumentId=6652288
708201479	Inspection Photos	https://ecmc.state.co.us/weblink/DownloadDocumentPDF.aspx?DocumentId=6652287