



<div>FORM 6</div> <div>Rev 11/20</div>	<div>State of Colorado</div> <div>Energy &amp; Carbon Management Commission</div> <div>1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109</div>	<div></div>	<table><tr><td>DE</td><td>ET</td><td>OE</td><td>ES</td></tr></table>	DE	ET	OE	ES																													
	DE	ET	OE	ES																																
<div>WELL ABANDONMENT REPORT</div> <div><p>This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.</p></div>			<div>Document Number: 403894704</div> <div>Date Received:</div>																																	
<div><div>ECMC Operator Number: 100322</div><div>Contact Name: Charles Schendzielos</div><div>Name of Operator: NOBLE ENERGY INC</div><div>Phone: (970) 342-6667</div><div>Address: 1099 18TH STREET SUITE 1500</div><div>Fax:</div><div>City: DENVER State: CO Zip: 80202</div><div>Email: charles.schendzielos@chevron.com</div><div>For "Intent" 24 hour notice required, Name: Evins, Bret Tel: (970) 420-6699</div><div>ECMC contact: Email: bret.evins@state.co.us</div></div>																																				
<div>Type of Well Abandonment Report: <input checked="" type="checkbox"/> Notice of Intent to Abandon <input type="checkbox"/> Subsequent Report of Abandonment</div>																																				
<div><div>API Number 05-123-23810-00</div><div>Well Name: CECIL Well Number: 32-32</div><div>Location: QtrQtr: NWSW Section: 32 Township: 7N Range: 64W Meridian: 6</div><div>County: WELD Federal, Indian or State Lease Number:</div><div>Field Name: WATTENBERG Field Number: 90750</div></div>																																				
<div>Only Complete the Following Background Information for Intent to Abandon</div> <div><div>Latitude: 40.527220 Longitude: -104.580510</div><div>GPS Data: GPS Quality Value: 2.8 Type of GPS Quality Value: PDOP Date of Measurement: 12/18/2007</div><div>Reason for Abandonment: <input type="checkbox"/> Dry <input checked="" type="checkbox"/> Production Sub-economic <input type="checkbox"/> Mechanical Problems</div><div><input type="checkbox"/> Other</div><div>Casing to be pulled: <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No Estimated Depth: 1025</div><div>Fish in Hole: <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No If yes, explain details below</div><div>Wellbore has Uncemented Casing leaks: <input type="checkbox"/> Yes <input type="checkbox"/> No If yes, explain details below</div><div>Details: Fish-stage tool 4274'-4279'</div></div>																																				
<div>Current and Previously Abandoned Zones</div> <table><thead><tr><th>Formation</th><th>Perf. Top</th><th>Perf. Btm</th><th>Abandoned Date</th><th>Method of Isolation</th><th>Plug Depth</th></tr></thead><tbody><tr><td>CODELL</td><td>7047</td><td>7062</td><td></td><td></td><td></td></tr><tr><td>NIOBRARA</td><td>6900</td><td>6931</td><td></td><td></td><td></td></tr></tbody></table> <div>Total: 2 zone(s)</div>				Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth	CODELL	7047	7062				NIOBRARA	6900	6931																		
Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth																															
CODELL	7047	7062																																		
NIOBRARA	6900	6931																																		
<div>Casing History</div> <table><thead><tr><th>Casing Type</th><th>Size of Hole</th><th>Size of Casing</th><th>Grade</th><th>Wt/Ft</th><th>Csg/Liner Top</th><th>Setting Depth</th><th>Sacks Cmt</th><th>Cmt Btm</th><th>Cmt Top</th><th>Status</th></tr></thead><tbody><tr><td>SURF</td><td>12+1/4</td><td>8+5/8</td><td>NA</td><td>24</td><td>0</td><td>825</td><td>400</td><td>825</td><td>0</td><td>VISU</td></tr><tr><td>1ST</td><td>7+7/8</td><td>4+1/2</td><td>LT&amp;C</td><td>11.6</td><td>0</td><td>7235</td><td>655</td><td>7235</td><td>2662</td><td>CBL</td></tr></tbody></table>				Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status	SURF	12+1/4	8+5/8	NA	24	0	825	400	825	0	VISU	1ST	7+7/8	4+1/2	LT&C	11.6	0	7235	655	7235	2662	CBL
Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status																										
SURF	12+1/4	8+5/8	NA	24	0	825	400	825	0	VISU																										
1ST	7+7/8	4+1/2	LT&C	11.6	0	7235	655	7235	2662	CBL																										

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6852 with 2 sacks cmt on top. CIBP #2: Depth 3637 with 2 sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 35 sks cmt from 2471 ft. to 2071 ft. Plug Type: CASING Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at 2571 ft. with 155 sacks. Leave at least 100 ft. in casing 2471 CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 345 sacks half in. half out surface casing from 1025 ft. to 0 ft. Plug Tagged: ☒

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing

Surface Plug Setting Date: \_\_\_\_\_ Cut and Cap Date: \_\_\_\_\_ Number of Days from Setting Surface Plug to Capping or Sealing the Well: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_

\*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

Previously approved Form 6 Intent expired 5/2 and with work planned in November resubmitting for approval.

3rd party wildlife surveys will be conducted on this well prior to rigging up for P&A activities.

Notification will be given to any adjacent building unit occupants within a 1000 feet of the wellhead of planned P&A start date.

Please be aware that Form 6 Approval can predate actual rig work by up to several months and that environmental conditions can change quickly over that time. Chevron's Environmental Site Screening Process incorporates full environmental field clearances within 7 days of a scheduled well-work activity once the well is added to the active workover rig schedule. Should sensitive HPH conditions be identified during the screening process, Chevron will delay the work until conditions (nesting) clear and/or consult directly with CPW for guidance and discussion of potential mitigation measures that may be incorporated.

CPW consult not required.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_

Print Name: Sharon Strum

Title: Lead Wells Technical Asst

Date: \_\_\_\_\_

Email: sharon.strum@chevron.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with ECMC Rules and applicable orders and is hereby approved.

ECMC Approved: \_\_\_\_\_

Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY LIST**

Expiration Date: \_\_\_\_\_

<u>COA Type</u>	<u>Description</u>
0 COA	

**ATTACHMENT LIST**

<u>Att Doc Num</u>	<u>Name</u>
403894729	WELLBORE DIAGRAM
403894734	WELLBORE DIAGRAM

Total Attach: 2 Files

**General Comments**

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
		Stamp Upon Approval

Total: 0 comment(s)