

FORM
6
Rev
11/20

State of Colorado

Energy & Carbon Management Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
Document Number: 403895591			
Date Received: 08/20/2024			

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

ECMC Operator Number: 47120 Contact Name: Lorena Ruiz
 Name of Operator: KERR MCGEE OIL & GAS ONSHORE LP Phone: (970) 336-3535
 Address: P O BOX 173779 Fax: _____
 City: DENVER State: CO Zip: 80217- Email: lorena_ruiz@oxy.com

For "Intent" 24 hour notice required, Name: Santistevan, Brittani Tel: (720) 471-1110
 Email: brittani.santistevan@state.co.us
ECMC contact: _____

Type of Well Abandonment Report: Notice of Intent to Abandon Subsequent Report of Abandonment

API Number 05-123-34289-00 Well Number: X08-10X
 Well Name: Dechant
 Location: QtrQtr: NWSE Section: 8 Township: 2N Range: 65W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: _____
 Field Name: WATTENBERG Field Number: 90750

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.151440 Longitude: -104.684950
 GPS Data: GPS Quality Value: 2.3 Type of GPS Quality Value: PDOP Date of Measurement: 08/16/2011
 Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other _____
 Casing to be pulled: Yes No Estimated Depth: 975
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7266	7280			
J SAND	7718	7758			
NIOBRARA	7049	7147			

Total: 3 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J-55	24	0	811	300	811	0	VISU
1ST	7+7/8	4+1/2	M-80	11.6	0	7900	680	7900	1500	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7700 with 2 sacks cmt on top. CIBP #2: Depth 260 with 80 sacks cmt on top.
 CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
 CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 10 sks cmt from 7019 ft. to 6895 ft. Plug Type: CASING Plug Tagged:
 Set 5 sks cmt from 4285 ft. to 4225 ft. Plug Type: CASING Plug Tagged:
 Set 5 sks cmt from 2190 ft. to 2130 ft. Plug Type: CASING Plug Tagged:
 Set 10 sks cmt from 1160 ft. to 1035 ft. Plug Type: CASING Plug Tagged:
 Set 80 sks cmt from 260 ft. to 0 ft. Plug Type: CASING Plug Tagged:

Perforate and squeeze at 7049 ft. with 90 sacks. Leave at least 100 ft. in casing 7019 CICR Depth

Perforate and squeeze at 4315 ft. with 95 sacks. Leave at least 100 ft. in casing 4285 CICR Depth

Perforate and squeeze at 2220 ft. with 95 sacks. Leave at least 100 ft. in casing 2190 CICR Depth

(Cast Iron Cement Retainer Depth)

Set 155 sacks half in. half out surface casing from 975 ft. to 761 ft. Plug Tagged:

Set 80 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing

Surface Plug Setting Date: _____ Cut and Cap Date: _____ Number of Days from Setting Surface Plug to Capping or Sealing the Well: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 Yes No

Technical Detail/Comments:

Additional Plugging Information:

Perforate and squeeze at 1490 ft. with 115 sacks. Leave at least 100 ft. in casing 1160 CICR Depth (Cast Iron Cement Retainer)

BMPs

Signage for P&As:

Prior to commencing operations, Kerr McGee will post signs in conspicuous locations. The signs will indicate plugging and abandonment operations are being conducted, the well name, well, and the Operator's contact information. Signs will be placed so as not to create a potential traffic hazard.

Notifications:

Courtesy notifications will be sent to all parcel owners with building units within 1,500 feet of the location letting them know about out plugging and abandonment operations and providing contact information for Kerr McGee's response line and online resources.

Wellbore Pressure:

In some cases, wellbore pressure drawdown operations may occur approximately 1-2 days prior to Move In Rig Up (MIRU) of the workover rig. This is conducted to allow for reduced time that the workover rig is needed on location. These operations will be conducted in accordance with Form 4 and/or Form 6 requirements.

Water:

Water will be placed on dirt access roads to mitigate dust as needed.

Lighting:

Operations are daylight-only; no lighting impacts are anticipated from operations.

Noise:

Operations will be in compliance with Table 423-1 requirements. Based off the rig sound signature, rig orientation will be considered to reduce noise levels to nearby building units.

Environmental Concerns:

This location was reviewed using a desktop method to review publicly available wildlife data (including CPW & ECMC data) as well as internal wildlife datasets and aerial imagery. All field personnel are trained to identify wildlife risks and raise concerns noticed during operations with the KMOG Health, Safety, and Environment (HSE) department.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Lorena Ruiz
Title: Regulatory Tech Date: 8/20/2024 Email: lorena_ruiz@oxy.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with ECMC Rules and applicable orders and is hereby approved.

ECMC Approved: JENKINS, STEVE Date: 9/3/2024

CONDITIONS OF APPROVAL, IF ANY LIST

Expiration Date: 3/2/2025

COA Type	Description
	<p>FLOWLINE AND SITE CLOSURE</p> <p>1) Consistent with Rule 911.a, a Form 27 must be approved prior to cut and cap, conducting flowline abandonment, or removing production equipment. Allow 30 days for Director review of the Form 27; include the Form 27 document number on the Form 44 for offsite flowline abandonment (if applicable) and on the Form 6 Subsequent.</p> <p>2) Properly abandon flowlines per Rule 1105. If flowlines will be abandoned in place, include with the Form 27: pressure test results conducted in the prior 12 months as well as identification of any document numbers for a ECMC Spill/Release Report, Form 19, associated with the abandoned line.</p>

	<p>1) Provide 2 business day notice of plugging MIRU via electronic Form 42, and provide 48 hours Notice of Plugging Operations, prior to mobilizing for plugging operations via electronic Form 42. These are 2 separate notifications, required by Rules 405.e and 405.l.</p> <p>2) Prior to placing the 975' plug: verify that all fluid migration (liquid and gas) has been eliminated. If evidence of fluid migration or pressure remains, contact ECMC Engineer for an update to plugging orders.</p> <p>3) After isolation has been verified, pump surface casing shoe plug. If cement is not circulated to surface, shut-in, WOC 4 hours then tag plug – must be at 761' or shallower and provide 10 sx plug at the surface.</p> <p>4) Leave at least 100' of cement in the wellbore for each plug without mechanical isolation.</p> <p>5) After surface plug and prior to cap, verify isolation by either a 15 minute bubble test or 15 minute optical gas imaging recording. If there is indication of flow contact ECMC Engineering. Provide a statement on the 6SRA which method was used and what was observed. Retain records of final isolation test for 5 years.</p> <p>6) With the Form 6 SRA operator must provide written documentation which positively affirms each COA listed above has been addressed.</p>
	<p>Operator shall implement measures to control venting, to protect health and safety, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare.</p>
	<p>Prior to starting plugging operations a Bradenhead test shall be performed if there has not been a reported Bradenhead test within the 60 days immediately preceding the start of plugging operations.</p> <p>1) If, before opening the Bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required.</p> <p>2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required.</p> <p>The Form 17 shall be submitted within 10 days of the test. Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions. If samples are collected, copies of all final laboratory analytical results shall be provided to the ECMC within three (3) months of collecting the samples.</p>

Operator committed to the following Best Management Practices under the Technical Detail/ Comments section on the Submit Tab:

Signage for P&As:
 Prior to commencing operations, Kerr McGee will post signs in conspicuous locations. The signs will indicate plugging and abandonment operations are being conducted, the well name, well, and the Operator's contact information. Signs will be placed so as not to create a potential traffic hazard.

Notifications:
 Courtesy notifications will be sent to all parcel owners with building units within 1,500 feet of the location letting them know about out plugging and abandonment operations and providing contact information for Kerr McGee's response line and online resources.

Wellbore Pressure:
 In some cases, wellbore pressure drawdown operations may occur approximately 1-2 days prior to Move In Rig Up (MIRU) of the workover rig. This is conducted to allow for reduced time that the workover rig is needed on location. These operations will be conducted in accordance with Form 4 and/or Form 6 requirements.

Water:
 Water will be placed on dirt access roads to mitigate dust as needed.

Lighting:
 Operations are daylight-only; no lighting impacts are anticipated from operations.

Noise:
 Operations will be in compliance with Table 423-1 requirements. Based off the rig sound signature, rig orientation will be considered to reduce noise levels to nearby building units.

Environmental Concerns:
 This location was reviewed using a desktop method to review publicly available wildlife data (including CPW & ECMC data) as well as internal wildlife datasets and aerial imagery. All field personnel are trained to identify wildlife risks and raise concerns noticed during operations with the KMOG Health, Safety, and Environment (HSE) department.

5 COAs

ATTACHMENT LIST

Att Doc Num	Name
403895591	FORM 6 INTENT SUBMITTED
403895602	PROPOSED PLUGGING PROCEDURE
403895603	WELLBORE DIAGRAM

Total Attach: 3 Files

General Comments

User Group	Comment	Comment Date
Engineer	1) Deepest Water Well within 1 mile = 875'. 2) Fox Hills Bottom- 697', per SB5.	09/03/2024
OGLA	Location Assessment Specialist (LAS) review complete. Well is not in a HPH, not near surface waters or wetlands, and not near RBUs.	09/02/2024
Permit	selected PDOP from dropdown box Verified as drilled lat/long Verified completed intervals - 400302615, 400302615(2) Verified production reporting pass	08/21/2024

Total: 3 comment(s)