

## Inspection Photos

Location Name: TEP Rocky Mountain LLC FEDERAL PA 44-13 Pad

Location # 457469



Photo # 703 From entrance to location

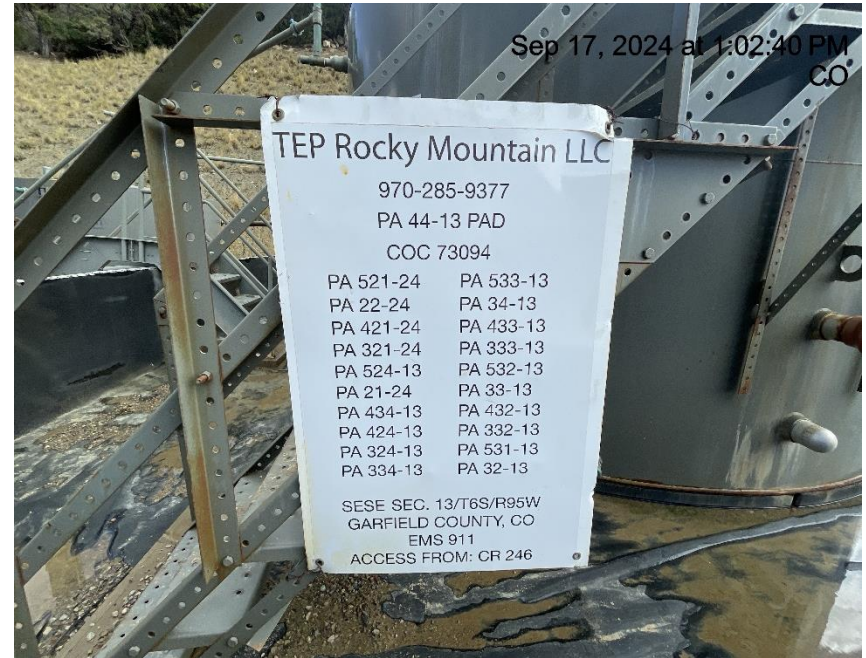


Photo # 704 Location



## Inspection Photos

Location Name: TEP Rocky Mountain LLC FEDERAL PA 44-13 Pad

Location # 457469



Photo # 705 Location



Photo # 706 Location



## Inspection Photos

Location Name: TEP Rocky Mountain LLC FEDERAL PA 44-13 Pad

Location # 457469



Photo # 707 Location



Photo # 708 Location



# Inspection Photos

Location Name: TEP Rocky Mountain LLC FEDERAL PA 44-13 Pad  
Location # 457469



Photo # 709 Location



Photo # 710 Location



## Inspection Photos

Location Name: TEP Rocky Mountain LLC FEDERAL PA 44-13 Pad

Location # 457469



Photo # 711 Location



Photo # 712 Location



## Inspection Photos

Location Name: TEP Rocky Mountain LLC FEDERAL PA 44-13 Pad

Location # 457469



Photo # 713 Location



Photo # 714 Location



## Inspection Photos

Location Name: TEP Rocky Mountain LLC FEDERAL PA 44-13 Pad

Location # 457469



**Photo # 715 Secondary containment does not comply with CECMC secondary containment rules (additionally 80 bbl tank does not appear to be in operators Form 2A or any Form 4 Sundry as required by CECMC rules)**



**Photo # 716 Open ended load line**

## Inspection Photos

Location Name: TEP Rocky Mountain LLC FEDERAL PA 44-13 Pad

Location # 457469



**Photo # 717 Rupture disc vent line does not comply with CECMC pressure safety device rules**



**Photo # 718 Rupture disc vent line does not comply with CECMC pressure safety device rules**



## Inspection Photos

Location Name: TEP Rocky Mountain LLC FEDERAL PA 44-13 Pad

Location # 457469



**Photo # 719 PRV vent line does not comply with CECMC pressure safety device rules**



**Photo # 720 PRV vent line does not comply with CECMC pressure safety device rules**



## Inspection Photos

Location Name: TEP Rocky Mountain LLC FEDERAL PA 44-13 Pad

Location # 457469



**Photo # 721 PRV vent line does not comply with CECMC pressure safety device rules**



**Photo # 722 PRV vent line does not comply with CECMC pressure safety device rules**



## Inspection Photos

Location Name: TEP Rocky Mountain LLC FEDERAL PA 44-13 Pad

Location # 457469



**Photo # 723 PRV vent line does not comply with CECMC pressure safety device rules**



**Photo # 724 PRV vent line does not comply with CECMC pressure safety device rules**



## Inspection Photos

Location Name: TEP Rocky Mountain LLC FEDERAL PA 44-13 Pad

Location # 457469



**Photo # 725 PRV vent line does not comply with CECMC pressure safety device rules**



**Photo # 726 PRV vent line does not comply with CECMC pressure safety device rules**

# Inspection Photos

Location Name: TEP Rocky Mountain LLC FEDERAL PA 44-13 Pad  
Location # 457469



Photo # 727 Chemical tank label damaged & some required info is illegible/does not comply with CECMC rules



Photo # 728 Debris



## Inspection Photos

Location Name: TEP Rocky Mountain LLC FEDERAL PA 44-13 Pad

Location # 457469



Photo # 729 Location



Photo # 730 Location

