

Interim Reclamation and Stormwater Inspection

October 17, 2024

Operator: PETROLEUM RESOURCE MANAGEMENT CORP
#10421

Location ID: 436485

Inspection Document #: 712300102

Moffat County, CO

Logan Maxwell
Reclamation Specialist, ECMC



COLORADO

**Energy & Carbon Management
Commission**

Department of Natural Resources

Inspection Photos
Location Name: WPU 36-1
Location ID: 436485



Photo 1. Photo taken from western portion of Location, facing south. Photo illustrates that the cuttings pile is missing containment measures. At the time of inspection, cuttings were in process of being removed from the Location.



Photo 2. Photo taken from southern portion of Location, facing southwest. Operator previously implemented silt fence to protect offsite movement of E&P waste. BMP was not properly maintained and inadequate in containing E&P waste. Operator indicated that they removed silt fence 10/18/2024.



Inspection Photos
Location Name: WPU 36-1
Location ID: 436485



Photo 3. Photo taken from southern portion of working pad surface, facing west. Photo illustrates inadequate/missing secondary containment measures around cuttings pile.



Photo 4. On 10/18/2024, photo submitted by Operator. Photo illustrates adequate containment measures implemented around the cuttings pile 10/18/24.

Inspection Photos
Location Name: WPU 36-1
Location ID: 436485



Photo 5. On 10/18/2024, photo submitted by Operator. Photo illustrates adequate containment measures implemented 10/18/24. Adequate containment measures implemented 10/18/24.



Photo 6. On 10/18/2024, photo submitted by Operator. Photo illustrates adequate containment measures implemented 10/18/24. Adequate containment measures implemented 10/18/24.

Inspection Photos
Location Name: WPU 36-1
Location ID: 436485



Photo 7. Photo taken of northern fill slope, illustrating the stormwater outlet. Geotextile lining in conjunction with multiangular rip-rap material has been implemented at the outlet on the north end of the Location.



Photo 8. Photo taken on eastern edge of Location, illustrating the stormwater outlet has been lined with a geotextile material in conjunction with multiangular rip-rap.

Inspection Photos
Location Name: WPU 36-1
Location ID: 436485



Photo 9. Photo taken on northern edge of location, facing north, illustrating the fill slopes. Undesirable weed species observed in the red circles (Canada Thistle had already seeded at this time). Weeds observed on the cut and fill slopes.



Photo 10. Photo taken on northern edge of location, facing north, illustrating the fill slopes. Undesirable weed species observed in the red circles (Canada Thistle had already seeded at this time).

Inspection Photos
Location Name: WPU 36-1
Location ID: 436485



Photo 11. Photo taken of the topsoil stockpile. BMPs (hydromulch) have been implemented to reduce slope erosion and degradation.



Photo 12. Photo taken of eastern fill slope area, facing northeast. BMPs (hydromulch) have been implemented to reduce slope erosion and degradation.

Inspection Photos
Location Name: WPU 36-1
Location ID: 436485



Photo 13. Photo taken from western portion of Location, facing southwest. Photo illustrates that all risers and flowline equipment have been removed.



Photo 14. Photo taken from western edge of Location, facing southeast. Photo illustrates that all risers and flowline equipment have been removed.