

**FORM  
INSP**Rev  
X/20**State of Colorado  
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203  
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

12/09/2024

Submitted Date:

12/10/2024

Document Number:

713601676**FIELD INSPECTION FORM**Loc ID 309041 Inspector Name: COSTA, RYAN On-Site Inspection ☐ 2A Doc Num: \_\_\_\_\_**Operator Information:**ECMC Operator Number: 10351Name of Operator: WAPITI OPERATING LLCAddress: 1251 LUMPKIN RDCity: HOUSTON State: TX Zip: 77043**Status Summary:**

- ☒
- THIS IS A FOLLOW UP INSPECTION
- 
- ☒
- FOLLOW UP INSPECTION REQUIRED
- 
- ☐
- NO FOLLOW UP INSPECTION REQUIRED

**Findings:**3 Number of Comments2 Number of Corrective Actions

- ☒
- Corrective Action Response Requested

**ANY CORRECTIVE ACTION(S) FROM  
PREVIOUS INSPECTIONS THAT HAVE NOT  
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
Madison, Randy	575-445-6706/575-420-1120	rmadison@wapitienergy.com	
Madison, Randy	575-445-6706/575-420-1120	rmadison@wapitienergy.com	

**Inspected Facilities:**

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
287227	WELL	PR	10/03/2006	CBM	071-09013	VPR C 130	RI

**General Comment:**

This is a follow up inspection of the VPR C #130.

**Location**Overall Good: ☐**Signs/Marker:**

Type	WELLHEAD		
Comment:			
Corrective Action:		Date:	

**Emergency Contact Number:**

Comment:		
Corrective Action:		Date: _____

**Good Housekeeping:**

Type		
Comment:		
Corrective Action:		Date:

Overall Good: ☒**Spills:**

Type	Area	Volume		
Produced Water	WELLHEAD			
Comment:	There was produced water leaking out of the wellhead which prompted immediate notification. The Operator was observed soon after and responded to the spill. It appears CA was immediately completed.			
Corrective Action:	Control and contain spills/releases and clean up per Rule 912.a.			Date: 12/09/2024

In Containment: No

Comment: ☐ Multiple Spills and Releases?**Venting:**

Yes/No		
Comment:		
Corrective Action:		Date:

**Flaring:**

Type		
Comment:		
Corrective Action:		Date:

Reclamation - Storm Water - Pit

Storm Water:

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment

Comment: There was worked performed at the location for stormwater management however, the BMP's installed are insufficient. There is erosion beginning to occur where soils were pushed out to fill in the previous erosion gully at the northwest side. The existing vegetation was disturbed and loose soils are susceptible to erosion. The hydro-mulch used in this area was clumped and did not provide sufficient coverage. The erosion along the access road was not stabilized with sufficient BMP's. The were two small rock check dams along this area which are insufficiently sized or constructed. Additional installation of BMP's will need to be installed including reseeding.

Corrective Action: Install or repair required BMPs per Rule 1002.f.(2)C

Date:

Pits: ☒ NO SURFACE INDICATION OF PIT

Attached Documents

You can go to ECMC Images (<https://ecmc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
713601677	Inspection Photos	<a href="https://ecmc.state.co.us/weblink/DownloadDocumentPDF.aspx?DocumentId=6819206">https://ecmc.state.co.us/weblink/DownloadDocumentPDF.aspx?DocumentId=6819206</a>