

**FORM  
INSP**Rev  
X/20**State of Colorado  
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203  
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

01/18/2025

Submitted Date:

01/23/2025

Document Number:

713601798**FIELD INSPECTION FORM**Loc ID 488238 Inspector Name: COSTA, RYAN On-Site Inspection ☐ 2A Doc Num: \_\_\_\_\_**Operator Information:**ECMC Operator Number: 10763Name of Operator: BNL (ENTERPRISE) INCAddress: 2011 FOREST AVENUECity: DURANGO State: CO Zip: 81301**Status Summary:**

- ☐ THIS IS A FOLLOW UP INSPECTION
- ☐ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

**Findings:**6 Number of Comments0 Number of Corrective Actions☐ Corrective Action Response Requested**ANY CORRECTIVE ACTION(S) FROM  
PREVIOUS INSPECTIONS THAT HAVE NOT  
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
Kondrat, Peter	970-759-5370	pkondrat@bluestarhelium.com	

**Inspected Facilities:**

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
488238	LOCATION	AC			-	Jackson 31 SENW 3054	CI
488476	WELL	AP	11/13/2024		071-09943	JACKSON 31 SENW 3054	CI

**General Comment:**

This is a construction inspection at the JACKSON #31 SENW 3054 location.  
See all comments and attached photos for inspection observations.

**Location Construction**

Location ID: 488476 CDP: \_\_\_\_\_

**Comment:** The topsoil along the access road and location have been salvaged and stored for topsoil protection. The topsoil piles have been tracked for temporary stabilization and wattles are installed around the perimeter. Topsoil piles should be seeded if stored for more than 6 months.

Corrective Action: \_\_\_\_\_

Date: \_\_\_\_\_

**Form 2A COAs:**

**Comment:** A liner has been installed on the pad in preparation for drilling operations.

Corrective Action: \_\_\_\_\_

Date: \_\_\_\_\_

**Wildlife BMPs:**

**Comment:** The lined pit at the location has no wildlife or livestock protection to prevent entrapment. BMP's such as panels or safety fence should be installed.

Corrective Action: \_\_\_\_\_

Date: \_\_\_\_\_

**Stormwater:**

Erosion BMPs	Present	Other BMPs	Present
	Yes		Yes

**Comments:** Erosion BMPs: There is a culvert and cattle guard installed at the beginning of the access road. The road was crowned and road base was being applied to the road surface. There were filter wattles installed around the perimeter of the location.

Other BMPs: The location slopes to the northeast corner and additional BMP's need to be installed in this area.

Corrective Action: \_\_\_\_\_

Date: \_\_\_\_\_

**Comment:** There was still construction work being conducted at the time of inspection.

**Corrective Action:**

Date: \_\_\_\_\_

**On Site Inspection (305):**Surface Owner Contact Information:

Name: \_\_\_\_\_

Address: \_\_\_\_\_

Phone Number: \_\_\_\_\_

Cell Phone: \_\_\_\_\_

Operator Rep. Contact Information:

Landman Name: \_\_\_\_\_

Phone Number: \_\_\_\_\_

Date Onsite Request Received: \_\_\_\_\_

Date of Rule 306 Consultation: \_\_\_\_\_

Request LGD Attendance: \_\_\_\_\_

LGD Contact Information:

Name: \_\_\_\_\_ Phone Number: \_\_\_\_\_ Agreed to Attend: \_\_\_\_\_

Summary of Landowner Issues:

\_\_\_\_\_

Summary of Operator Response to Landowner Issues:

\_\_\_\_\_

Onsite Inspection Memorandum Summarizing Discussions at Inspection as Attachment:

\_\_\_\_\_

**Attached Documents**

You can go to ECMC Images (<https://ecmc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
713601799	Inspection Photos	<a href="https://ecmc.state.co.us/weblink/DownloadDocumentPDF.aspx?DocumentId=6887014">https://ecmc.state.co.us/weblink/DownloadDocumentPDF.aspx?DocumentId=6887014</a>