

**FORM
INSP**Rev
X/20**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

02/11/2025

Submitted Date:

02/12/2025

Document Number:

708303440**FIELD INSPECTION FORM**Loc ID 335394 Inspector Name: Morris, Matthew On-Site Inspection ☐ 2A Doc Num: _____**Operator Information:**ECMC Operator Number: 96850Name of Operator: TEP ROCKY MOUNTAIN LLCAddress: 1058 COUNTY ROAD 215City: PARACHUTE State: CO Zip: 81635**Status Summary:**

- ☒
- THIS IS A FOLLOW UP INSPECTION
-
- ☒
- FOLLOW UP INSPECTION REQUIRED
-
- ☐
- NO FOLLOW UP INSPECTION REQUIRED

Findings:9 Number of Comments1 Number of Corrective Actions

- ☒
- Corrective Action Response Requested

**ANY CORRECTIVE ACTION(S) FROM
PREVIOUS INSPECTIONS THAT HAVE NOT
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
Popejoy, Dusty		dusty.popejoy@state.co.us	
, TEP		COGCCInspectionReports@terraep.com	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
256599	WELL	PR	01/04/2000	GW	045-07475	PUCKETT GM 12-32	PR
260665	WELL	PR	06/16/2002	GW	045-07895	PUCKETT GM 11-32	PR

General Comment:**CECMC Inspection Report Summary**

On 2/11/2025 at approximately 14:40, Compliance Inspector Matthew Morris conducted a follow-up audit at TEP ROCKY MOUNTAIN LLC, PUCKETT-66S96W/32SWNW at Location ID #335394 in Garfield County, Colorado.

During the audit, the following compliance issues were observed:

- 1) Stormwater; refer to Stormwater section

A follow-up on this site audit will be conducted to ensure the compliance issues have been corrected to comply with CECMC rules.

This location is within or in close proximity to, a CPW Density/High Priority Habitat, Black Bear, NSO Habitat, or Wildlife Management area.

LocationOverall Good: ☐**Signs/Marker:**

Type	BATTERY		
Comment:			
Corrective Action:		Date:	
Type	TANK LABELS/PLACARDS		
Comment:			
Corrective Action:		Date:	
Type	OTHER		
Comment:	Separator units include attached storage tanks. The sight glass on the side of the unit indicates that the storage tank contains an unknown fluid. No form of labeling or markers is present to identify a potential hazard or the contents of the storage tank.		
Corrective Action:		Date:	
Type	WELLHEAD		
Comment:			
Corrective Action:		Date:	

Emergency Contact Number:

Comment: 911/(970)285-9377

Corrective Action:

Date: _____

Overall Good: ☐**Spills:**

Type	Area	Volume		
------	------	--------	--	--

In Containment: No

Comment:

☐ Multiple Spills and Releases?**Fencing/:**

Type	WELLHEAD		
Comment:	Hog panels		
Corrective Action:		Date:	
Type	SEPARATOR		
Comment:	Hog panels		
Corrective Action:		Date:	
Type	TANK BATTERY		
Comment:	Hog panels		
Corrective Action:		Date:	

Equipment:

Type: Horizontal Heated Separator	# 3		corrective date
Comment:			
Corrective Action:		Date:	

Type: Gas Meter Run	# 3		
Comment:			
Corrective Action:			Date:
Type: Bradenhead	# 2		
Comment:			
Corrective Action:			Date:
Type: Dehydrator	# 1		
Comment:			
Corrective Action:			Date:
Type: Bird Protectors	# 4		
Comment:			
Corrective Action:			Date:
Type: Plunger Lift	# 2		
Comment:			
Corrective Action:			Date:

Tanks and Berms:

Contents	#	Capacity	Type	Tank ID	SE GPS	
PRODUCED WATER	1	<100 BBLs	STEEL AST		,	
Comment:						
Corrective Action:						Date:

Paint

Condition	Adequate	
Other (Content)		
Other (Capacity)	80 bbls	
Other (Type)		

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Metal	Adequate	Walls Sufficient	Base Sufficient	Adequate
Comment:				
Corrective Action:				
	Date:			

Venting:

Yes/No	NO	
Comment:		
Corrective Action:	Date:	

Flaring:

Type		
Comment:		
Corrective Action:	Date:	

Inspected Facilities									
Facility ID:	256599	Type:	WELL	API Number:	045-07475	Status:	PR	Insp. Status:	PR
Producing Well									
Comment:									
Corrective Action:						Date:			
The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12									
Facility ID:	260665	Type:	WELL	API Number:	045-07895	Status:	PR	Insp. Status:	PR
Producing Well									
Comment:									
Corrective Action:						Date:			
The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12									

Reclamation - Storm Water - Pit**Storm Water:**

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
Other	Fail					Insufficient erosion controls/site degradation
		Ditches				
		Check Dams				
		Gravel				
		Culverts				
		Rip Rap				
		Compaction				
		Other	Fail			Insufficient erosion controls
Berms						
		Sediment Traps				
Compaction						
Gravel						

Comment: 1) Insufficient erosion controls and site degradation; sediment being transported onto location and encroaching on production equipment.
2) Insufficient erosion controls; sediment being transported onto access road with no BMPs in place.

Corrective Action: 1002.f.(2): Oil and gas operators shall implement and maintain Best Management Practices (BMPs) at all oil and gas locations to control Stormwater runoff in a manner that minimizes erosion, transport of sediment offsite, and site degradation. BMPs shall be maintained until the facility is abandoned and final reclamation is achieved pursuant to Rule 1004.

Date: 02/28/2025

Pits: ☒ NO SURFACE INDICATION OF PIT

Attached Documents

You can go to ECMC Images (<https://ecmc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
708303441	Photo Log	https://ecmc.state.co.us/weblink/DownloadDocumentPDF.aspx?DocumentId=6916895