

**FORM
INSP**

Rev
X/20

**State of Colorado
Oil and Gas Conservation Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

02/24/2025

Submitted Date:

02/26/2025

Document Number:

710500428

FIELD INSPECTION FORM

Loc ID 324837 Inspector Name: Sanchez, Chris On-Site Inspection 2A Doc Num: _____

Operator Information:

ECMC Operator Number: 83130
Name of Operator: STRACHAN EXPLORATION INC
Address: 992 S 4TH AVE SUITE 100-461
City: BRIGHTON State: CO Zip: 80601

Status Summary:

- THIS IS A FOLLOW UP INSPECTION
- FOLLOW UP INSPECTION REQUIRED
- NO FOLLOW UP INSPECTION REQUIRED

Findings:

- 7 Number of Comments
- 4 Number of Corrective Actions
- Corrective Action Response Requested

ANY CORRECTIVE ACTION(S) FROM PREVIOUS INSPECTIONS THAT HAVE NOT BEEN ADDRESSED ARE STILL APPLICABLE

Contact Information:

Contact Name	Phone	Email	Comment
Harms, Jason		Jason@strachanexploration.com	Strachan Exploration
L, Stacy		stacy@strachanexploration.com	Field inspections

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
213033	WELL	PR	09/01/2024	OW	061-06394	STAVELY 1-26	EI
324837	LOCATION	AC			-	STAVELY-618S51W 26SESE	EI

General Comment:

[This is an Environmental Inspection for the Stavely 1-26 API 05-061-06394](#)

Location

Overall Good:

Signs/Marker:			
Type	WELLHEAD		
Comment:	Wrong API # is listed on the well placard.		
Corrective Action:	Install sign to comply with Rule 605.d.	Date:	04/24/2025

Emergency Contact Number:			
Comment:	<input type="text"/>		
Corrective Action:	<input type="text"/>		Date: <input type="text"/>

Good Housekeeping:			
Type	STORAGE OF SUPL		
Comment:	Lube Oil stored on pump jack without containment		
Corrective Action:	Implement or modify BMPs for improved material handling and spill prevention per Rule 1002.f.(2)B	Date:	02/28/2025

Overall Good:

Spills:			
Type	Area	Volume	
Other	Separator	<= 1 bbl	
Comment:	At the time of inspection there was a leak observed on a valve between the separator and tank. Lease Operator, Wayne, who was on a neighboring location was informed of leak on 2/24/2025, 1:28 p.m.		
Corrective Action:	Securely fasten all valves, pipes, fittings, and Production Facilities to ensure good mechanical condition, inspect at regular intervals and maintain in good mechanical condition per Rule 608.e.		Date: 02/28/2025
Lube Oil	Pump Jack	<= 1 bbl	
Comment:	Stained soils observed at rear of Pump Jack		
Corrective Action:	Securely fasten all valves, pipes, fittings, and Production Facilities to ensure good mechanical condition, inspect at regular intervals and maintain in good mechanical condition per Rule 608.e.		Date: 03/12/2025

In Containment: Yes

Comment:

Multiple Spills and Releases?

Venting:			
Yes/No			
Comment:			
Corrective Action:			Date:

Flaring:			
Type			

Comment:	
Corrective Action:	Date:

Inspected Facilities

Facility ID: 213033 Type: WELL API Number: 061-06394 Status: PR Insp. Status: EI

The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12

Facility ID: 324837 Type: LOCATION API Number: - Status: AC Insp. Status: EI

The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12

Attached Documents

You can go to ECMC Images (<https://ecmc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
404108499	INSPECTION SUBMITTED	https://ecmc.state.co.us/weblink/DownloadDocumentPDF.aspx?DocumentId=6936272
710500429	Inspection Photos	https://ecmc.state.co.us/weblink/DownloadDocumentPDF.aspx?DocumentId=6936265