

**FORM
INSP**Rev
X/20**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

03/05/2025

Submitted Date:

03/07/2025

Document Number:

708303544**FIELD INSPECTION FORM**Loc ID 334932 Inspector Name: Morris, Matthew On-Site Inspection ☐ 2A Doc Num: _____**Operator Information:**ECMC Operator Number: 96850Name of Operator: TEP ROCKY MOUNTAIN LLCAddress: 1058 COUNTY ROAD 215City: PARACHUTE State: CO Zip: 81635**Status Summary:**☐ THIS IS A FOLLOW UP INSPECTION☒ FOLLOW UP INSPECTION REQUIRED☐ NO FOLLOW UP INSPECTION REQUIRED**Findings:**9 Number of Comments1 Number of Corrective Actions☒ Corrective Action Response Requested**ANY CORRECTIVE ACTION(S) FROM
PREVIOUS INSPECTIONS THAT HAVE NOT
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
, TEP		COGCCInspectionReports@terraep.com	
Popejoy, Dusty		dusty.popejoy@state.co.us	

General Comment:**CECMC Audit Report Summary**

On 3/5/2025 at approximately 11:30, Compliance Inspector Matthew Morris conducted an on-site audit at TEP ROCKY MOUNTAIN LLC, AMERICAN SODA-67S96W/2SWSE at Location ID #334932 in Garfield County, Colorado.

During the audit, the following compliance issues were observed:

1) Stormwater; refer to Stormwater section

A follow-up on this site audit will be conducted to ensure the compliance issues have been corrected to comply with CECMC rules.

This location is within or in close proximity to, a CPW Density/High Priority Habitat, Black Bear, NSO Habitat, or Wildlife Management area.

LocationOverall Good: ☐**Signs/Marker:**

Type	BATTERY		
Comment:	Battery sign is weathered but legible.		
Corrective Action:		Date:	
Type	WELLHEAD		
Comment:			
Corrective Action:		Date:	
Type	OTHER		
Comment:	Separator units include attached storage tanks. The sight glass on the side of the unit indicates that the storage tank contains an unknown fluid. No form of labeling or markers is present to identify a potential hazard or the contents of the storage tank.		
Corrective Action:		Date:	
Type	TANK LABELS/PLACARDS		
Comment:			
Corrective Action:		Date:	

Emergency Contact Number:

Comment: 911/(970)285-9377

Corrective Action:

Date: _____

Overall Good: ☐**Spills:**

Type	Area	Volume		
------	------	--------	--	--

In Containment: No

Comment:

☐ Multiple Spills and Releases?**Fencing/:**

Type	SEPARATOR		
Comment:	Hog panels		
Corrective Action:		Date:	
Type	WELLHEAD		
Comment:	Hog panels		
Corrective Action:		Date:	
Type	TANK BATTERY		
Comment:	Hog panels		
Corrective Action:		Date:	

Equipment:

Type: Bird Protectors	# 3		corrective date
Comment:			
Corrective Action:		Date:	

Type: Gas Meter Run	# 3	
Comment:		
Corrective Action:		Date:
Type: Horizontal Heated Separator	# 3	
Comment:		
Corrective Action:		Date:
Type: Bradenhead	# 3	
Comment:		
Corrective Action:		Date:
Type: Plunger Lift	# 3	
Comment:		
Corrective Action:		Date:

Tanks and Berms:

Contents	#	Capacity	Type	Tank ID	SE GPS
METHANOL	1	OTHER	STEEL AST		,
Comment:					
Corrective Action:					Date:

Paint

Condition	Adequate	
Other (Content)		
Other (Capacity)	500 gal	
Other (Type)		

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Metal	Adequate	Walls Sufficent	Base Sufficent	Adequate
Comment:				
Corrective Action:				Date:

Contents	#	Capacity	Type	Tank ID	SE GPS
PRODUCED WATER	1	<100 BBLS	STEEL AST		,
Comment:					
Corrective Action:					Date:

Paint

Condition	Adequate	
Other (Content)		
Other (Capacity)	80 bbls	
Other (Type)		

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Metal	Adequate	Walls Sufficent	Base Sufficent	Adequate
Comment:				

Corrective Action:		Date:	
--------------------	--	-------	--

Venting:

Yes/No	NO		
Comment:			
Corrective Action:		Date:	

Flaring:

Type		
Comment:		
Corrective Action:		Date:

Reclamation - Storm Water - Pit

Storm Water:

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
		Check Dams				
Berms						
		Ditches				
		Compaction				
Gravel						
		Other	Fail			Insufficient erosion controls
		Culverts				
Compaction						
		Gravel				
		Sediment Traps				
		Rip Rap				

Comment: Insufficient erosion controls; transportation of sediment from rill erosion cutting through lease road. No BMPs in place on this section of lease road to location.

Corrective Action: 1002.f.(2): Oil and gas operators shall implement and maintain Best Management Practices (BMPs) at all oil and gas locations to control Stormwater runoff in a manner that minimizes erosion, transport of sediment offsite, and site degradation. BMPs shall be maintained until the facility is abandoned and final reclamation is achieved pursuant to Rule 1004.

Date: 03/16/2025

Pits: ☒ NO SURFACE INDICATION OF PIT

Attached Documents

You can go to ECMC Images (<https://ecmc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
404120487	INSPECTION SUBMITTED	https://ecmc.state.co.us/weblink/DownloadDocumentPDF.aspx?DocumentId=6950502
708303545	Photo Log	https://ecmc.state.co.us/weblink/DownloadDocumentPDF.aspx?DocumentId=6950496