

Inspection Photos

Loc: 484357

Operator: DESERT EAGLE OPERATING LLC

Inspection Date: 3/13/2025

County: LAS ANIMAS



COLORADO

**Energy & Carbon Management
Commission**

Department of Natural Resources

Inspection Photos



Photo 1. Facing south toward the access road and location. There has been roadbase applied along the road and wellsite.



Inspection Photos



Photo 2. Facing southwest toward the wellsite. It appears clean up was performed but there still remains greyish material in this area.



Inspection Photos



Photo 3. Facing northwest at the location. It appears the spill in this area was cleaned up but there was also fresh soil spread along this area.



COLORADO
Energy & Carbon Management
Commission
Department of Natural Resources

Loc:484357 | Date: 3/13/2025

Inspection Photos



Photo 4. Facing east toward the flowline. There has been soil piles placed along the flowline in this area. This area will need to be graded and reseeded.



Inspection Photos



Photo 5. Facing east toward the flowline disturbance. There are fresh vehicle tracks which are causing unnecessary disturbance. This will require signage and BMP's to prevent vehicle access.



COLORADO
Energy & Carbon Management
Commission

Department of Natural Resources

Loc:484357 | Date: 3/13/2025

Inspection Photos



Photo 6. Facing west at south side of the location. There are signs of erosion undercutting the wattles which will require maintenance.



COLORADO
Energy & Carbon Management
Commission
Department of Natural Resources

Loc:484357 | Date: 3/13/2025

Inspection Photos

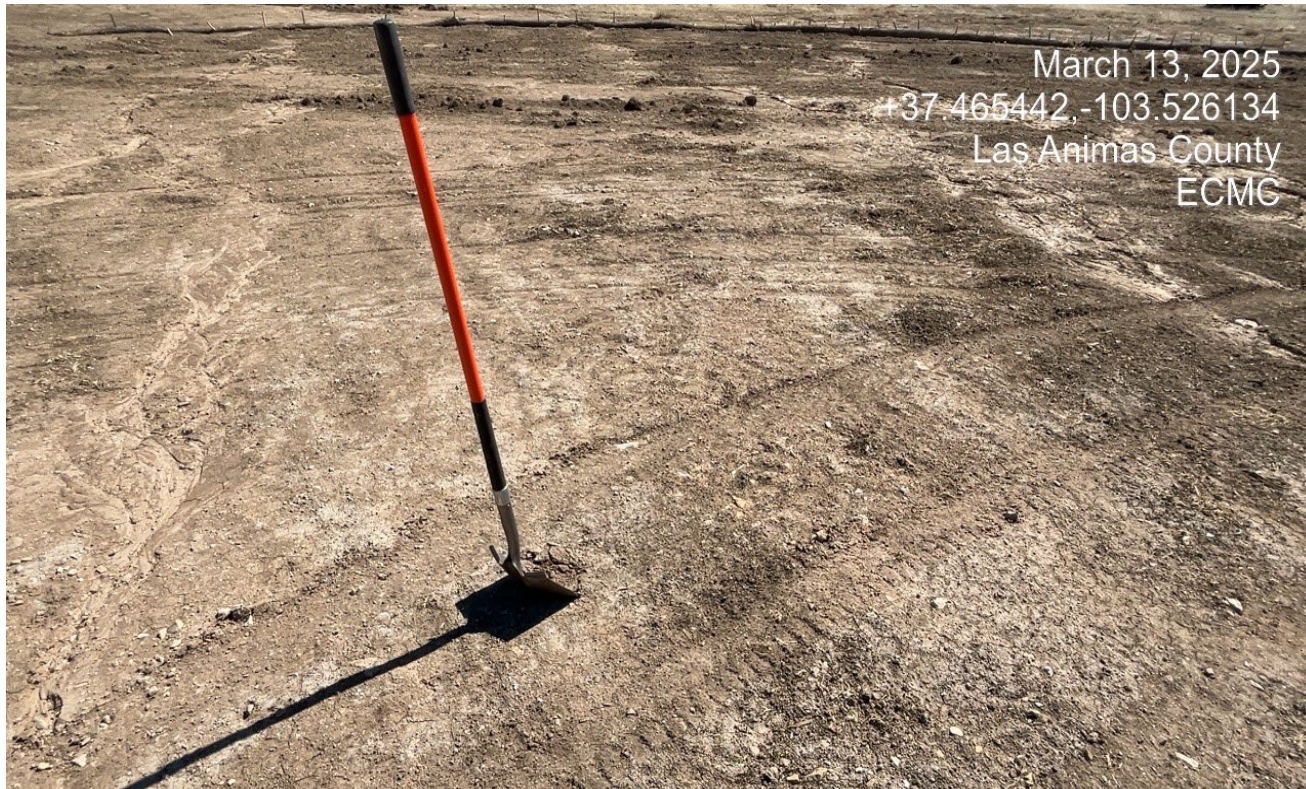


Photo 7. Using the shovel tye test for compaction, it seems area where vegetation is not establishing may have compacted soils. Decompaction must occur by cross-ripping to a depth of 18 inches per 1003 rules.



COLORADO
Energy & Carbon Management
Commission

Department of Natural Resources

Loc:484357 | Date: 3/13/2025