

**FORM
INSP**Rev
X/20**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

04/30/2025

Submitted Date:

04/30/2025

Document Number:

709100514

FIELD INSPECTION FORMLoc ID 317280 Inspector Name: Heibel, Krystal On-Site Inspection ☐ 2A Doc Num: _____**Operator Information:**

ECMC Operator Number: 76830

Name of Operator: SCHMID PROPERTIES INC

Address: PO BOX 389

City: HICO State: TX Zip: 76457

Status Summary:

- ☒ THIS IS A FOLLOW UP INSPECTION
- ☒ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

Findings:

10 Number of Comments

6 Number of Corrective Actions

- ☒ Corrective Action Response Requested

**ANY CORRECTIVE ACTION(S) FROM
PREVIOUS INSPECTIONS THAT HAVE NOT
BEEN ADDRESSED ARE STILL APPLICABLE****Contact Information:**

Contact Name	Phone	Email	Comment
Krystal Heibel		krystal.heibel@state.co.us	
Kyle Waggoner		kyle.waggoner@state.co.us	
Dylan Edwardson		dylan.edwardson@state.co.us	
Schmid, William	337-261-1500	tenniswilliam123@cs.com	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
102673	PIT	AC			-	FASSLER	EI
119517	PIT	CL			-	FASSLER 1-28	EI
237713	WELL	PR	08/01/2021	OW	121-10216	FASSLER 1-28	EI
317280	LOCATION	AC			-	FASSLER-62N53W 28NENE	EI

General Comment:

This is an environmental progress inspection. Any corrective actions from previous inspections that have not been addressed are still applicable. Photos attached to document site conditions.

LocationOverall Good: ☐**Signs/Marker:**

Type			
Comment:	Signage present		
Corrective Action:		Date:	

Emergency Contact Number:

Comment:	Emergency contact number not visible from a distance. Operator shall add emergency contact number signage that is visible from a distance in the case of an emergency.		
Corrective Action:		Date:	

Good Housekeeping:

Type			
Comment:	Unused equipment and trash observed on location		
Corrective Action:	Comply with Rule 606	Date:	05/14/2025

Overall Good: ☐**Spills:**

Type	Area	Volume		
Comment:	Hydrocarbons observed along the lease road, on the site, within the metal shed, beside the pits, beneath tank battery valves, and next to wellhead.			
Corrective Action:	Operator shall investigate, clean up, and document impacts resulting from Spills and Releases as soon as the impacts are discovered, per Rule 912.a.(2). It appears that the impacted soil quantity requires a Form 19-Initial submittal for the spills in the metal shed and around the wellhead. Operator shall provide documentation of the remediation on a supplemental form 19 submittal, required within 10 days of the spill discovery.			Date: 05/03/2025

In Containment: No

Comment: ☒ Multiple Spills and Releases?**Fencing/:**

Type			
Comment:	Fencing present		
Corrective Action:		Date:	

Equipment:

Type:	#		corrective date
Comment:	No wildlife protection equipment (e.g. netting) installed at poly tank secondary containment, as noted in Field Inspection Doc# 718700241.		
Corrective Action:	Comply with Rule 902.b to install or repair wildlife protection equipment.		
Date:	05/13/2025		
Type:	#		
Comment:	Several 5 gallon buckets not being stored within secondary containment, as noted in Field Inspection Doc# 718700241.		
Corrective Action:	Implement or modify BMPs for improved material handling and spill prevention per Rule 1002.f.(2)B.		
Date:	04/03/2025		

Tanks and Berms:

Contents	#	Capacity	Type	Tank ID	SE GPS	
----------	---	----------	------	---------	--------	--

Comment:					
Corrective Action:					Date:

Paint

Condition				
Other (Content)				
Other (Capacity)				
Other (Type)				

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Comment:	Burrows/holes present in earthen berms. Earthen berms eroded around tank battery and vertical separator.			
Corrective Action:	Repair or install berms or other secondary containment devices per Rule 603.o.			Date: 05/30/2025

Venting:

Yes/No			
Comment:			
Corrective Action:	Date:		

Flaring:

Type			
Comment:			
Corrective Action:	Date:		

Reclamation - Storm Water - Pit

Storm Water:

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
Comment:		During time of inspection, it appears as though recent soil work has been conducted around the produced water pit. There appears to still be hydrocarbon impacted soil on the outside of the bermed and fenced area. See photo documentation.				
Corrective Action:		Control and contain spills/releases and clean up per Rule 912.a.				Date: 05/03/2025
Pits: <input type="checkbox"/> NO SURFACE INDICATION OF PIT						

Attached Documents

You can go to ECMC Images (<https://ecmc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
404186100	INSPECTION SUBMITTED	https://ecmc.state.co.us/weblink/DownloadDocumentPDF.aspx?DocumentId=7030432
709100515	Photos	https://ecmc.state.co.us/weblink/DownloadDocumentPDF.aspx?DocumentId=7030430