

Document Number:
 404243828

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

ECMC Operator Number: 69175 Contact Name: Charles Schendzielos
 Name of Operator: PDC ENERGY INC Phone: (970) 342-6667
 Address: 1099 18TH STREET SUITE 1500 Fax: _____
 City: DENVER State: CO Zip: 80202 Email: charles.schendzielos@chevron.com

For "Intent" 24 hour notice required, Name: Santistevan, Brittani Tel: (720) 471-1110
 Email: brittani.santistevan@state.co.us

ECMC contact:

Type of Well Abandonment Report: Notice of Intent to Abandon Subsequent Report of Abandonment

API Number 05-123-14480-00
 Well Name: RIGGS Well Number: 44-16
 Location: QtrQtr: SESE Section: 16 Township: 6N Range: 65W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: 56222
 Field Name: GREELEY Field Number: 32760

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.480690 Longitude: -104.661310
 GPS Data: GPS Quality Value: 1.8 Type of GPS Quality Value: PDOP Date of Measurement: 08/25/2006

Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other _____

Casing to be pulled: Yes No Estimated Depth: 450

Fish in Hole: Yes No If yes, explain details below

Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below

Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7100	7121			
FORT HAYS	7073	7098			
NIOBRARA	6792	7016			

Total: 3 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	NA	24	0	309	175	309	0	VISU
1ST	7+7/8	4+1/2	L80	11.6	0	7211	250	7211	6278	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6744 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
 CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
 CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 10 sks cmt from 3631 ft. to 3551 ft. Plug Type: CASING Plug Tagged:
 Set 35 sks cmt from 1998 ft. to 1598 ft. Plug Type: CASING Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at 3651 ft. with 35 sacks. Leave at least 100 ft. in casing 3631 CICR Depth
 Perforate and squeeze at 2098 ft. with 155 sacks. Leave at least 100 ft. in casing 1998 CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 215 sacks half in. half out surface casing from 450 ft. to 0 ft. Plug Tagged:
 Set _____ sacks at surface
 Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No
 Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing
 Surface Plug Setting Date: _____ Cut and Cap Date: _____ Number of Days from Setting Surface Plug to Capping or Sealing the Well: _____
 *Wireline Contractor: _____ *Cementing Contractor: _____
 Type of Cement and Additives Used: _____
 Flowline/Pipeline has been abandoned per Rule 1105 Yes No

Technical Detail/Comments:
 3rd party wildlife surveys will be conducted on this well prior to rigging up for P&A activities. Notification will be given to any adjacent building unit occupants within a 1000 feet of the wellhead of planned P&A start date. Please be aware that Form 6 Approval can predate actual rig work by up to several months and that environmental conditions can change quickly over that time. Chevron's Environmental Site Screening Process incorporates full environmental field clearances within 7 days of a scheduled well-work activity once the well is added to the active workover rig schedule. Should sensitive HPH conditions be identified during the screening process, Chevron will delay the work until conditions (nesting) clear and/or consult directly with CPW for guidance and discussion of potential mitigation measures that may be incorporated.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Sharon Strum
 Title: Lead Wells Technical Asst Date: _____ Email: sharon.strum@chevron.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with ECMC Rules and applicable orders and is hereby approved.

ECMC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY LIST

Expiration Date: _____

COA Type	Description
0 COA	

ATTACHMENT LIST

Att Doc Num	Name
404243866	WELLBORE DIAGRAM
404243868	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

User Group	Comment	Comment Date
		Stamp Upon Approval

Total: 0 comment(s)