

FORM
6Rev
11/20

State of Colorado

Energy & Carbon Management Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

404242047

Date Received:

06/16/2025

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

ECMC Operator Number: 47120

Contact Name: Lorena Ruiz

Name of Operator: KERR MCGEE OIL & GAS ONSHORE LP

Phone: (970) 336-3535

Address: P O BOX 173779

Fax:

City: DENVER State: CO Zip: 80217-

Email: lorena_ruiz@oxy.com

For "Intent" 24 hour notice required,

Name: Carlile, Craig

Tel: (970) 629-8279

ECMC contact:

Email: craig.carlile@state.co.us

Type of Well Abandonment Report: ☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

API Number 05-123-25930-00

Well Name: BROWN

Well Number: 25-35

Location: QtrQtr: SENW Section: 35 Township: 3N Range: 66W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.182398

Longitude: -104.745185

GPS Data: GPS Quality Value: 2.1 Type of GPS Quality Value: PDOP Date of Measurement: 07/26/2007

Reason for Abandonment: ☐ Dry ☒ Production Sub-economic ☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes ☐ No Estimated Depth: 780Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7441	7457			
NIOBRARA	7168	7320			

Total: 2 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	9+7/8	7	J-55	17	0	831	380	831	0	VISU
1ST	6+1/4	4+1/2	I-80	11.6	0	7641	220	7641	4738	CBL
S.C. 1.1	6+1/4	4+1/2	I-80	11.6	0	7641	60	4620	3985	CBL
S.C. 1.2	6+1/4	4+1/2	I-80	11.6	0	7641	95	1660	822	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 260 with 55 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 5 sks cmt from 7118 ft. to 7055 ft. Plug Type: CASING Plug Tagged: ☐
Set 5 sks cmt from 4424 ft. to 4360 ft. Plug Type: CASING Plug Tagged: ☐
Set 15 sks cmt from 2030 ft. to 1870 ft. Plug Type: CASING Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at 7168 ft. with 9 sacks. Leave at least 100 ft. in casing 7118 CICR Depth
Perforate and squeeze at 4474 ft. with 95 sacks. Leave at least 100 ft. in casing 4424 CICR Depth
Perforate and squeeze at 2470 ft. with 85 sacks. Leave at least 100 ft. in casing 2030 CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 75 sacks half in. half out surface casing from 1550 ft. to 730 ft. Plug Tagged: ☐
Set 55 sacks at surface
Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☒ No
Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Number of Days from Setting Surface Plug to Capping or Sealing the Well: _____
Surface Plug Setting Date: _____ Cut and Cap Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 ☐ Yes ☐ No

Technical Detail/Comments:

BMPs
Signage for P&As:
Prior to commencing operations, Kerr McGee will post signs in conspicuous locations. The signs will indicate plugging and abandonment operations are being conducted, the well name, well, and the Operator's contact information. Signs will be placed so as not to create a potential traffic hazard.

Notifications:
Courtesy notifications will be sent to all parcel owners with building units within 1,500 feet of the location letting them know about out plugging and abandonment operations and providing contact information for Kerr McGee's response line and online resources.

Wellbore Pressure:
In some cases, wellbore pressure drawdown operations may occur approximately 1-2 days prior to Move In Rig Up (MIRU) of the workover rig. This is conducted to allow for reduced time that the workover rig is needed on location. These operations will be conducted in accordance with Form 4 and/or Form 6 requirements.

Water:
Water will be placed on dirt access roads to mitigate dust as needed.

Lighting:
Operations are daylight-only; no lighting impacts are anticipated from operations.

Noise:
Operations will be in compliance with Table 423-1 requirements. Based off the rig sound signature, rig orientation will be considered to reduce noise levels to nearby building units.

Environmental Concerns:
This location was reviewed using a desktop method to review publicly available wildlife data (including CPW & ECMC data) as well as internal wildlife datasets and aerial imagery. All field personnel are trained to identify wildlife risks and raise concerns noticed during operations with the KMOG Health, Safety, and Environment (HSE) department.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Lorena Ruiz
Title: Regulatory Tech Date: 6/16/2025 Email: lorena_ruiz@oxy.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with ECMC Rules and applicable orders and is hereby approved.

ECMC Approved: Jacobson, Eric Date: 6/30/2025

CONDITIONS OF APPROVAL, IF ANY LIST

Expiration Date: 12/29/2025

COA Type	Description
	Operator shall implement measures to control venting, to protect health and safety, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare.
	Due to proximity to a wetland, operator will use secondary containment for all tanks and other liquid containers. Operator will implement stormwater BMPs and erosion control measures as needed to prevent sediment and stormwater runoff from entering the wetland.

	<p>COA's provided by the operator as Best Management Practices under Technical Detail / Comments:</p> <p>Signage for P&As: Prior to commencing operations, Kerr McGee will post signs in conspicuous locations. The signs will indicate plugging and abandonment operations are being conducted, the well name, well, and the Operator's contact information. Signs will be placed so as not to create a potential traffic hazard.</p> <p>Notifications: Courtesy notifications will be sent to all parcel owners with building units within 1,500 feet of the location letting them know about out plugging and abandonment operations and providing contact information for Kerr McGee's response line and online resources.</p> <p>Wellbore Pressure: In some cases, wellbore pressure drawdown operations may occur approximately 1-2 days prior to Move In Rig Up (MIRU) of the workover rig. This is conducted to allow for reduced time that the workover rig is needed on location. These operations will be conducted in accordance with Form 4 and/or Form 6 requirements.</p> <p>Water: Water will be placed on dirt access roads to mitigate dust as needed.</p> <p>Lighting: Operations are daylight-only; no lighting impacts are anticipated from operations.</p> <p>Noise: Operations will be in compliance with Table 423-1 requirements. Based off the rig sound signature, rig orientation will be considered to reduce noise levels to nearby building units.</p> <p>Environmental Concerns: This location was reviewed using a desktop method to review publicly available wildlife data (including CPW & ECMC data) as well as internal wildlife datasets and aerial imagery. All field personnel are trained to identify wildlife risks and raise concerns noticed during operations with the KMOG Health, Safety, and Environment (HSE) department.</p>	
	<p>Prior to starting plugging operations a bradenhead test shall be performed if there has not been a reported bradenhead test within the 60 days immediately preceding the start of plugging operations.</p> <p>1) If, before opening the bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required.</p> <p>2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required.</p> <p>The Form 17 shall be submitted within 10 days of the test. Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions. If samples are collected, copies of all final laboratory analytical results shall be provided to the ECMC within three (3) months of collecting the samples.</p> <p>If there is a need for sampling, contact ECMC engineering for verification of plugging procedure.</p>	
	<p>Consistent with Rule 911.a, a Form 27 must be approved prior to cut and cap, conducting flowline abandonment, or removing production equipment. Allow 30 days for Director review of the Form 27; include the Form 27 document number on the Form 44 for offsite flowline abandonment (if applicable) and on the Form 6 Subsequent.</p> <p>Properly abandon flowlines per Rule 1105. If flowlines will be abandoned in place, include with the Form 27: pressure test results conducted in the prior 12 months as well as identification of any document numbers for a ECMC Spill/Release Report, Form 19, associated with the abandoned line.</p>	

	<p>1) Provide electronic Form 42 Notice of MIRU 2 business days ahead of operations and electronic Form 42 Notice of Plugging Operations 48 hours prior to mobilizing for plugging operations. These are two separate notifications, required by Rules 405.e and 405.l.</p> <p>2) Prior to placing cement above the base of the Upper Pierre (1770') : verify that all fluid (liquid and gas) migration has been eliminated. If evidence of fluid migration or pressure remains, contact ECMC Engineer for an update to plugging orders.</p> <p>3) Pump surface casing shoe plug at 1550' only after isolation has been verified. If surface casing cement is not circulated to surface, shut-in, WOC 4 hours then tag plug – must be at 781' or shallower and provide a minimum of 10 sx plug at the surface.</p> <p>4) Leave at least 100' of cement in the wellbore for each plug without mechanical isolation.</p> <p>5) After cut and prior to cap, verify isolation by either a 15 minute bubble test or 15 minute optical gas imaging recording. If there is indication of flow contact ECMC Engineering. Provide a statement on the 6SRA which method was used and what was observed. Retain records of final isolation test for 5 years.</p> <p>6) With the Form 6 SRA operator must provide written documentation which positively affirms each COA listed above has been addressed.</p>
--	--

6 COAs

ATTACHMENT LIST

<u>Att Doc Num</u>	<u>Name</u>
404242047	FORM 6 INTENT SUBMITTED
404242058	WELLBORE DIAGRAM
404242060	PROPOSED PLUGGING PROCEDURE

Total Attach: 3 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
OGLA	Location Assessment review complete.	06/27/2025
Engineer	Deepest Water Well within 1 Mile – 580' SB5 Base of Fox Hills – 680'	06/24/2025
Permit	selected PDOP from dropdown box Verified as drilled lat/long Verified completed intervals: 1012749, 269601 Verified production reporting pass	06/17/2025

Total: 3 comment(s)