

**FORM
INSP**

Rev
X/20

**State of Colorado
Oil and Gas Conservation Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

06/25/2025

Submitted Date:

07/11/2025

Document Number:

699700476

FIELD INSPECTION FORM

Loc ID _____ Inspector Name: Heil, John On-Site Inspection 2A Doc Num: _____

Status Summary:

- THIS IS A FOLLOW UP INSPECTION
- FOLLOW UP INSPECTION REQUIRED
- NO FOLLOW UP INSPECTION REQUIRED

Operator Information:

ECMC Operator Number: 10539
Name of Operator: UTAH GAS OP LTD DBA UTAH GAS CORP
Address: 734 MAIN STREET 3RD FLOOR
City: GRAND JUNCTION State: CO Zip: 81501

Findings:

- 5 Number of Comments
- 1 Number of Corrective Actions
- Corrective Action Response Requested

ANY CORRECTIVE ACTION(S) FROM PREVIOUS INSPECTIONS THAT HAVE NOT BEEN ADDRESSED ARE STILL APPLICABLE

Contact Information:

Contact Name	Phone	Email	Comment
, "	970-675-7928	inspections@utahgascorp.com	All Inspections
Fischer, Alex		alex.fischer@state.co.us	
Roberts, James		j75rober@blm.gov	BLM meeker
Pollack, Dana		dpollack@utahgascorp.com	Environmental Specialist II
Cholas, Nick		nick.cholas@state.co.us	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
45072	LEASE	PR	05/08/1996		-	FEDERAL D-22-3-101-W	EI

General Comment:

ECMC Environmental Inspection.

Inspected Facilities

Facility ID: 45072 Type: LEASE API Number: - Status: PR Insp. Status: EI

The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12

Environmental

Spills/Releases:

Type of Spill: PRODUCED WATER Estimated Spill Volume: _____

Comment: See Initial Form 19 Doc #404252800 and Supplemental Form 19 Doc #404267391 for more information. ECMC staff John Heil conducted an Environmental Inspection of the point of release as well as the potentially impacted stock pond. Fluids within the potentially impacted stock pond had been removed by the operator and fresh water was trucked in for wildlife and was placed in a stock pond adjacent to the potentially impacted stock pond. Operator personnel were on location at time of inspection removing any residual fluids that accumulated in the base of the potentially impacted stock pond. ECMC did not observe any hydrocarbon sheen, staining or odor within the potentially impacted stock pond. Evidence of wildlife was observed within the potentially impacted stock pond and the operator was contacted via cellphone on June 25, 2025. ECMC environmental staff advised the operator to implement BMPs to minimize the impacts to wildlife within the potentially impacted stock pond. See attached Photo Log for details.

Corrective Action: Comply with COAs on Form 19 Initial Doc #404252800. Date: _____

Reportable: YES GPS: Lat _____ Long _____

Proximity to Surface Water: _____ Depth to Ground Water: _____

Water Well Complaint:

DWR Receipt Num: _____ Owner Name: _____ GPS : _____ Lat _____ Long _____

Field Parameters:

Sample Location: _____ Comment: _____

Attached Documents

You can go to ECMC Images (<https://ecmc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
699700477	20250625 Photo Log	https://ecmc.state.co.us/weblink/DownloadDocumentPDF.aspx?DocumentId=7138442