

Inspection/Audit Photos

Location Name: TEP ROCKY MOUNTAIN LLC GM 42-3 Frac Pad

Location ID: 323951



Photo # 6385 From entrance to location



Photo # 6386 Location

Inspection/Audit Photos

Location Name: TEP ROCKY MOUNTAIN LLC GM 42-3 Frac Pad

Location ID: 323951



Photo # 6387 Location



Photo # 6388 Location

Inspection/Audit Photos

Location Name: TEP ROCKY MOUNTAIN LLC GM 42-3 Frac Pad

Location ID: 323951



Photo # 6389 Location

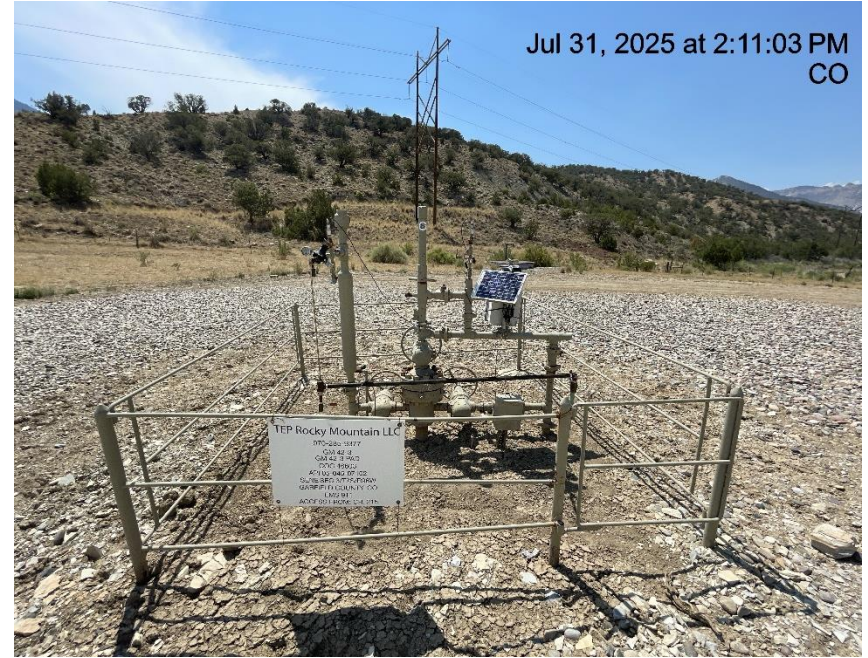


Photo # 6390 Location

Inspection/Audit Photos

Location Name: TEP ROCKY MOUNTAIN LLC GM 42-3 Frac Pad

Location ID: 323951



Jul 31, 2025 at 1:55:19 PM
CO

Photo # 6391 Location



Jul 31, 2025 at 1:56:54 PM
CO

Photo # 6392 Location

Inspection/Audit Photos

Location Name: TEP ROCKY MOUNTAIN LLC GM 42-3 Frac Pad

Location ID: 323951



Photo # 6393 Location



Photo # 6394 Location

Inspection/Audit Photos

Location Name: TEP ROCKY MOUNTAIN LLC GM 42-3 Frac Pad

Location ID: 323951

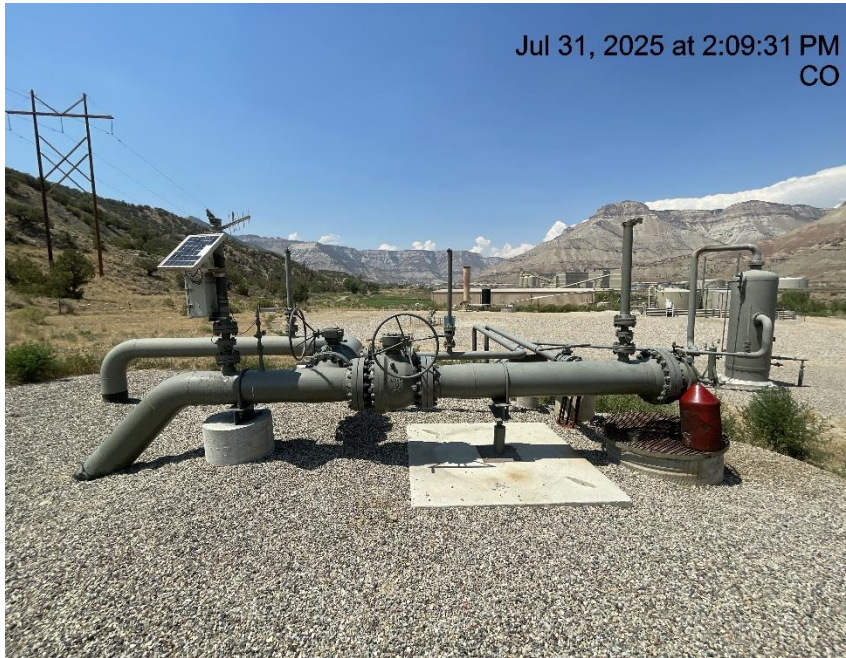


Photo # 6395 Location



Photo # 6396 Location

Inspection/Audit Photos

Location Name: TEP ROCKY MOUNTAIN LLC GM 42-3 Frac Pad

Location ID: 323951



Photo # 6397 Barbed wire fence needs maintenance/wildlife hazard



Photo # 6398 Barbed wire fence needs maintenance/wildlife hazard

Inspection/Audit Photos

Location Name: TEP ROCKY MOUNTAIN LLC GM 42-3 Frac Pad

Location ID: 323951



Photo # 6399 Barbed wire fence needs maintenance/wildlife hazard



Photo # 6400 Barbed wire fence needs maintenance/wildlife hazard

Inspection/Audit Photos

Location Name: TEP ROCKY MOUNTAIN LLC GM 42-3 Frac Pad

Location ID: 323951

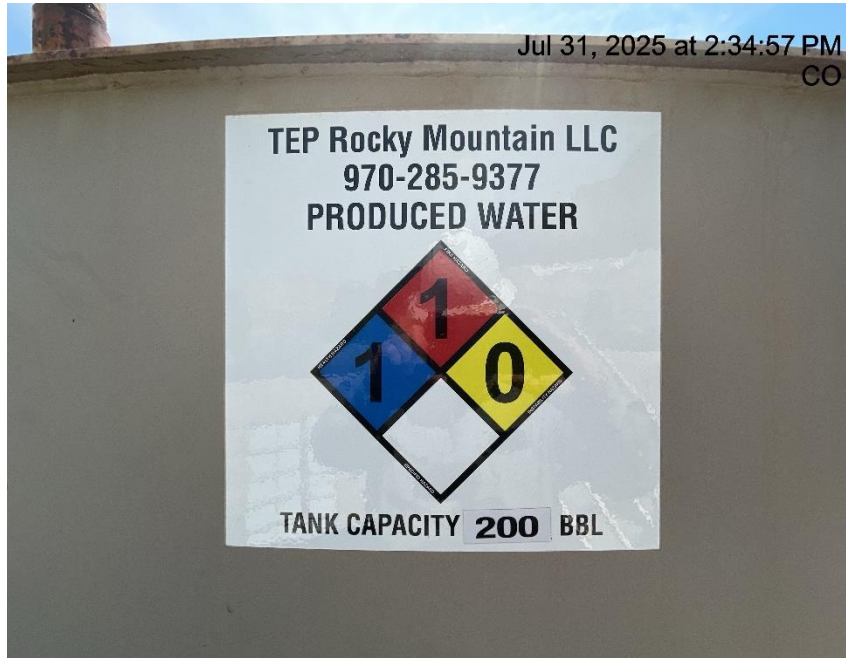


Photo # 6401 Tank capacity incorrect

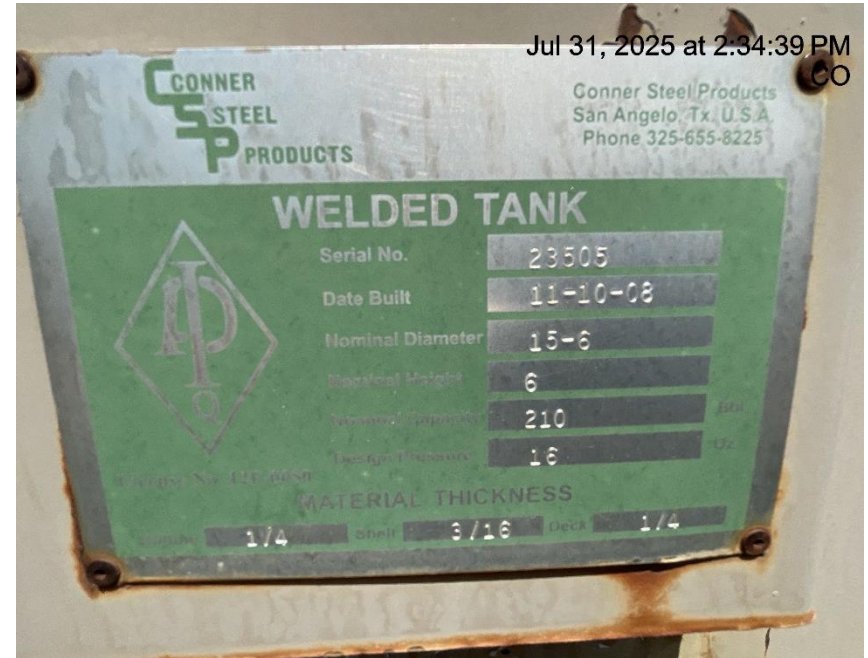


Photo # 6402 Tank capacity

Inspection/Audit Photos

Location Name: TEP ROCKY MOUNTAIN LLC GM 42-3 Frac Pad

Location ID: 323951



Photo # 6403 PRV vent line on tank burner does not comply with CECMC pressure safety device rules & general safety rules



Photo # 6404 Open ended load line