

**FORM  
INSP**

Rev  
X/20

**State of Colorado  
Energy and Carbon Management Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203  
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

09/05/2025

Submitted Date:

09/17/2025

Document Number:

713602410

**FIELD INSPECTION FORM**

Loc ID 321654 Inspector Name: COSTA, RYAN On-Site Inspection  2A Doc Num: \_\_\_\_\_

**Status Summary:**

- THIS IS A FOLLOW UP INSPECTION
- FOLLOW UP INSPECTION REQUIRED
- NO FOLLOW UP INSPECTION REQUIRED

**Operator Information:**

ECMC Operator Number: 96730  
Name of Operator: WILLIFORD ENERGY COMPANY  
Address: 6060 AMERICAN PLAZA SUITE 760  
City: TULSA State: OK Zip: 74135

**Findings:**

- 4 Number of Comments
- 3 Number of Corrective Actions
- Corrective Action Response Requested

**ANY CORRECTIVE ACTION(S) FROM PREVIOUS INSPECTIONS THAT HAVE NOT BEEN ADDRESSED ARE STILL APPLICABLE**

**Contact Information:**

Contact Name	Phone	Email	Comment
Storts, Doug	(918) 495-2710	pds@willifordenergy.com	
Growns, Larry		lgrowsn@willifordenergy.com	

**Inspected Facilities:**

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
207690	WELL	PR	10/19/1986	OW	017-06625	RHOADES UNIT 5-5	RI

**General Comment:**

This is a follow up reclamation inspection of the RHOADES Unit #5-5 wellsite.  
See attached photos and additional details within this report.

**Location**

Overall Good:

Emergency Contact Number:

Comment:

Corrective Action:

Date: \_\_\_\_\_

Overall Good:

**Spills:**

Type	Area	Volume		
	WELLHEAD			
Comment:	The spill that was initially observed on 3/26/24 has not been cleaned up. There are still stained soils around the wellhead and southwest of the well that have not been cleaned up and properly disposed. There has been no form 19 spill report submitted to report the spill. Previous corrective action was not completed.			
Corrective Action:	Control and contain spills/releases and clean up per Rule 912.a. Report spill or release of E&P waste or produced fluids Remove free fluids and contact EPS staff per Rule 912.b.		Date:	
	Pump Jack			
Comment:	The leaking engine motor has been removed since the previous inspection. There is still stained soils at the base of the pumpjack that have not been cleaned up. Previous CA was not completed.			
Corrective Action:	Non E&P Waste not properly stored, handled, transported, treated, or disposed per Rule 906		Date:	

In Containment: No

Comment:

Multiple Spills and Releases?

**Venting:**

Yes/No			
Comment:			
Corrective Action:		Date:	

**Flaring:**

Type			
Comment:			
Corrective Action:		Date:	

**Reclamation - Storm Water - Pit**

**Storm Water:**

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment

Comment: There are still areas of the access road that are not stabilized or maintained. There has been a road base material applied onto areas of the road however, this material has not been graded, crowned, or compacted. The access road needs to be repaired and maintained with BMP's installed per good engineering practice. Previous corrective action has not been completed.

Corrective Action: Install or repair required BMPs per Rule 1002.f.(2)

Date: \_\_\_\_\_

**Pits:**  NO SURFACE INDICATION OF PIT

**Attached Documents**

You can go to ECMC Images (<https://ecmc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
404357956	INSPECTION SUBMITTED	<a href="http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=7240970">http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=7240970</a>
713602411	Inspection Photos	<a href="http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=7240969">http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=7240969</a>