

**FORM
INSP**

Rev
X/20

**State of Colorado
Energy and Carbon Management Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

09/17/2025

Submitted Date:

09/26/2025

Document Number:

719200247

FIELD INSPECTION FORM

Loc ID 335209 Inspector Name: Gaasche, Emily On-Site Inspection 2A Doc Num: _____

Status Summary:

- THIS IS A FOLLOW UP INSPECTION
- FOLLOW UP INSPECTION REQUIRED
- NO FOLLOW UP INSPECTION REQUIRED

Operator Information:

ECMC Operator Number: 96850
Name of Operator: TEP ROCKY MOUNTAIN LLC
Address: 1058 COUNTY ROAD 215
City: PARACHUTE State: CO Zip: 81635

Findings:

- 4 Number of Comments
- 3 Number of Corrective Actions
- Corrective Action Response Requested

ANY CORRECTIVE ACTION(S) FROM PREVIOUS INSPECTIONS THAT HAVE NOT BEEN ADDRESSED ARE STILL APPLICABLE

Contact Information:

Contact Name	Phone	Email	Comment
, TEP		ECMCInspectionReports@flywheelenergy.com	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
335209	LOCATION	AC			-	Jolley KP 22-21	RI

General Comment:

On 09/17/2025, NW Reclamation Specialist Emily Gaasche conducted an inspection at TEP Rocky Mountain LLC's Jolley/KP 22-21 location in Garfield County, Colorado.

Location is within CPW High Priority Habitat: Elk Severe Winter Range, Elk Winter Concentration Area and Mule Deer Winter Concentration Area.

The following compliance issues were observed during this inspection:

- 1003 reclamation
- Stormwater
- Secondary containment

Refer to the Location, Reclamation and Stormwater sections of this report for additional details.

Refer to the photo-documentation attached to this report for additional details.

Any outstanding CA's from previous inspections remain applicable.

Location

Overall Good:

Emergency Contact Number:

Comment:

Corrective Action:

Date: _____

Overall Good:

Spills:

Type	Area	Volume			

In Containment: No

Comment:

Multiple Spills and Releases?

Tanks and Berms:

Contents	#	Capacity	Type	Tank ID	SE GPS
Comment: <input type="text"/>					
Corrective Action: <input type="text"/>					Date: <input type="text"/>

Paint

Condition	<input type="text"/>
Other (Content)	<input type="text"/>
Other (Capacity)	<input type="text"/>
Other (Type)	<input type="text"/>

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Metal				
Comment: Inspection #708906299 observed holes in the secondary containment geotextile liner with a CA date of 5/10/2025. It was observed during this inspection that holes remain in the secondary liner. This CA remains outstanding.				
Corrective Action: The liner will be sufficiently impervious so that any discharge from a primary containment system will not escape containment before cleanup occurs.				Date: <input type="text"/>

Venting:

Yes/No	<input type="text"/>		
Comment:	<input type="text"/>		
Corrective Action:	<input type="text"/>		Date: <input type="text"/>

Flaring:

Type	<input type="text"/>	
Comment:	<input type="text"/>	
Corrective Action:	<input type="text"/>	Date: <input type="text"/>

Inspected Facilities

Facility ID: 335209 Type: LOCATION API Number: - Status: AC Insp. Status: RI

The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12

Reclamation - Storm Water - Pit

Interim Reclamation:

Date Interim Reclamation Started: _____ Date Interim Reclamation Completed: _____

Land Use: RANGELAND

Comment: _____

1002 SITE PREPARATION AND STABILIZATION

1002a. FENCING _____

Comment _____

Corrective Action _____

Date _____

1002b. SOIL REMOVAL AND SEGREGATION _____

Comment _____

Corrective Action _____

Date _____

1002c. PROTECTION OF SOILS _____

Comment _____

Corrective Action _____

Date _____

1002E. SURFACE DISTURBANCE MINIMIZATION _____

Comment _____

Corrective Action _____

Date _____

1003a. Waste and Debris removed? _____

Comment _____

Corrective Action _____

Date _____

Unused or unneeded equipment onsite? _____

Comment _____

Corrective Action _____

Date _____

Pit, cellars, rat holes and other bores closed? _____

Comment _____

Corrective Action _____

Date _____

Guy line anchors marked? _____

Comment _____

Corrective Action _____

Date _____

1003b. Area no longer in use? _____ Production areas stabilized ? _____
 1003c. Compacted areas have been cross ripped? _____
 1003d. Drilling pit closed? _____ Subsidence over on drill pit? _____
 Cuttings management: _____
 1003e. Areas no longer needed for drilling or subsequent operations for have been re-vegetated to 80% of pre-existing? _____
 Production areas have been stabilized? _____ Segregated soils have been replaced? _____

RESTORATION AND REVEGETATION

Cropland

Top soil replaced _____ Recontoured _____ Perennial forage re-established _____

Non-Cropland

Top soil replaced _____ Recontoured _____ 80% Revegetation _____

1003e. INTERIM VEGETATION TRANSECT
 TRANSECT RESULTS OF DISTURBED AREA% _____
 TRANSECT RESULTS OF REFERENCE AREA% _____
 TOTAL % OF DESIRABLE VEGETATION COVER _____
 VEGETATIVE COVER _____

1003 f. Weeds Noxious weeds? _____

Comment Some portions of the interim areas are composed of big sagebrush, Sandberg bluegrass, tansyasters, hairy false golden aster and curlycup gumweed. Perennial establishment in these areas is not uniform. Portions of the interim remain predominantly bare or are composed of undesirable plant species such as cheatgrass and prickly wire lettuce. The southeastern and western interim areas require additional reclamation efforts.

Corrective Action Comply with 1003 series rules and establish desirable, perennial, uniform vegetation with eighty (80) percent cover of the reference area. Date _____

Overall Interim Reclamation Fail

Final Reclamation/ Abandoned Location:

Date Final Reclamation Started: _____ Date Final Reclamation Completed: _____

Final Land Use: RANGELAND _____

Reminder: _____

Comment: _____

Well plugged _____ Pit mouse/rat holes, cellars backfilled _____

Debris removed _____ No disturbance /Location never built _____

Access Roads Regraded _____ Contoured _____ Culverts removed _____

Gravel removed _____

Location and associated production facilities reclaimed _____ Locations, facilities, roads, recontoured _____

Compaction alleviation _____ Dust and erosion control _____

Non cropland: Revegetated 80% _____ Cropland: perennial forage _____

Weeds present _____ Subsidence _____

1004.d. FINAL VEGETATION TRANSECT
 TRANSECT RESULTS OF DISTURBED AREA% _____
 TRANSECT RESULTS OF REFERENCE AREA% _____
 TOTAL % OF DESIRABLE VEGETATION COVER _____
 VEGETATIVE COVER _____

Comment: _____

Corrective Action: _____	Date _____
Overall Final Reclamation _____	Well Release on Active Location <input type="checkbox"/>
	Multi-Well Location <input type="checkbox"/>

Storm Water:

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment

Comment: A stormwater control on the northern portion of the site is in disrepair, and erosion and sediment transportation is occurring. Check dams appear to be in disrepair. Stormwater BMP's appear to be missing or insufficient.

Corrective Action: Comply with Rule 1002.f.

Date: _____

Pits: NO SURFACE INDICATION OF PIT

Attached Documents

You can go to ECMC Images (<https://ecmc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
404370376	INSPECTION SUBMITTED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=7256254
719200248	Inspection Photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=7256253