

Document Number:
404226041
Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

ECMC Operator Number: 47120 Contact Name: CANDICE BARBER
 Name of Operator: KERR MCGEE OIL & GAS ONSHORE LP Phone: (307) 233-4513
 Address: P O BOX 173779 Fax: _____
 City: DENVER State: CO Zip: 80217- Email: CANDICE_BARBER@OXY.COM

For "Intent" 24 hour notice required, Name: _____ Tel: _____
 ECMC contact: Email: _____

Type of Well Abandonment Report: Notice of Intent to Abandon Subsequent Report of Abandonment

API Number 05-123-15355-00
 Well Name: TUTTLE INVESTMENT Well Number: 1
 Location: QtrQtr: NENW Section: 8 Township: 3N Range: 66W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: _____
 Field Name: WATTENBERG Field Number: 90750

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.243208 Longitude: -104.805104
 GPS Data: GPS Quality Value: 1.4 Type of GPS Quality Value: PDOP Date of Measurement: 05/06/2025

Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other _____

Casing to be pulled: Yes No Estimated Depth: _____

Fish in Hole: Yes No If yes, explain details below

Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below

Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7332	7348	02/05/2025	RETAINER/SQUEEZED	7038
J SAND	7776	7846	02/04/2025	B PLUG CEMENT TOP	7700

Total: 2 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J-55	24	0	672	425	672	0	VISU
1ST	7+7/8	5+1/2	I-80	17	0	8187	1015	8187	3860	CBL
S.C. 1.1	7+7/8	5+1/2		17	0	3802	1174	3802	165	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7700 with 4 sacks cmt on top. CIBP #2: Depth 300 with 50 sacks cmt on top.
 CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
 CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at 7068 ft. with 115 sacks. Leave at least 100 ft. in casing 7038 CICR Depth
 Perforate and squeeze at 4269 ft. with 105 sacks. Leave at least 100 ft. in casing 4239 CICR Depth
 Perforate and squeeze at 2700 ft. with 100 sacks. Leave at least 100 ft. in casing 2670 CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged:
 Set 50 sacks at surface
 Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No
 Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Number of Days from Setting Surface Plug to Capping or Sealing the Well: 87
 Surface Plug Setting Date: 02/08/2025 Cut and Cap Date: 05/06/2025
 *Wireline Contractor: CUTTERS *Cementing Contractor: SLB
 Type of Cement and Additives Used: _____
 Flowline/Pipeline has been abandoned per Rule 1105 Yes No

Technical Detail/Comments:
 CONTINUED PLUGGING PROCEDURE:
 PERF AT 1275' WITH 165 SACKS OF CEMENT, CICR SET AT 1245' IN CASING

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.
 Signed: _____ Print Name: CANDICE BARBER
 Title: REG ANALYST Date: _____ Email: DJREGULATORY@OXY.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with ECMC Rules and applicable orders and is hereby approved.

ECMC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY LIST

COA Type	Description
0 COA	

ATTACHMENT LIST

Att Doc Num	Name
404407623	OPERATIONS SUMMARY
404407624	OTHER
404407625	WELLBORE DIAGRAM
404407626	WIRELINE JOB SUMMARY
404407628	CEMENT JOB SUMMARY

Total Attach: 5 Files

General Comments

User Group	Comment	Comment Date
Permit	2 months PA. Reviewed attachments. Pass.	08/14/2025

Total: 1 comment(s)