



DE	ET	OE	ES
Document Number: 404423686			
Date Received:			

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

ECMC Operator Number: 47120 Contact Name: CANDICE BARBER
 Name of Operator: KERR MCGEE OIL & GAS ONSHORE LP Phone: (307) 233-4513
 Address: P O BOX 173779 Fax: _____
 City: DENVER State: CO Zip: 80217- Email: CANDICE_BARBER@OXY.COM

For "Intent" 24 hour notice required, Name: _____ Tel: _____
 Email: _____

Type of Well Abandonment Report: Notice of Intent to Abandon Subsequent Report of Abandonment

API Number 05-123-32154-00
 Well Name: WILDFLOWER Well Number: 37-27
 Location: QtrQtr: NESE Section: 27 Township: 2N Range: 68W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: _____
 Field Name: WATTENBERG Field Number: 90750

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.107660 Longitude: -104.982247
 GPS Data: GPS Quality Value: 1.3 Type of GPS Quality Value: PDOP Date of Measurement: 11/03/2025

Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other _____

Casing to be pulled: Yes No Estimated Depth: _____
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7994	8014	08/13/2025	RETAINER/SQUEEZED	7648
NIOBRARA	7698	7880	08/13/2025	RETAINER/SQUEEZED	7648
J SAND	8436	8456	08/13/2025	B PLUG CEMENT TOP	8336

Total: 3 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J-55	24	0	854	540	854	0	VISU
1ST	7+7/8	4+1/2	I-80	11.6	0	8594	730	8594	3879	CBL
	7+7/8	4+1/2		Stage Tool	0	3879	464	3879	1050	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 8336 with 2 sacks cmt on top. CIBP #2: Depth 1610 with 2 sacks cmt on top.
 CIBP #3: Depth 300 with 100 sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
 CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 100 sks cmt from 300 ft. to 10 ft. Plug Type: CASING Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at 7698 ft. with 100 sacks. Leave at least 100 ft. in casing 7648 CICR Depth
 Perforate and squeeze at 4720 ft. with 100 sacks. Leave at least 100 ft. in casing 4670 CICR Depth
 Perforate and squeeze at 1294 ft. with 100 sacks. Leave at least 100 ft. in casing 1244 CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 160 sacks half in. half out surface casing from 1000 ft. to 547 ft. Plug Tagged:
 Set 0 sacks at surface
 Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No
 Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: 1000 ft. of 4+1/2 inch casing
 Surface Plug Setting Date: 08/18/2025 Cut and Cap Date: 11/03/2025 Number of Days from Setting Surface Plug to Capping or Sealing the Well: 77

*Wireline Contractor: RANGER *Cementing Contractor: RANGER

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1105 Yes No

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: CANDICE BARBER
 Title: REG ANALYST Date: _____ Email: DJREGULATORY@OXY.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with ECMC Rules and applicable orders and is hereby approved.

ECMC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY LIST

<u>COA Type</u>	<u>Description</u>
0 COA	

ATTACHMENT LIST

<u>Att Doc Num</u>	<u>Name</u>
404423689	OPERATIONS SUMMARY
404423690	OTHER
404423691	OTHER
404423692	CEMENT JOB SUMMARY
404423693	WELLBORE DIAGRAM
404423694	WIRELINE JOB SUMMARY

Total Attach: 6 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
		Stamp Upon Approval

Total: 0 comment(s)