

**FORM
INSP**

Rev
X/20

**State of Colorado
Energy and Carbon Management Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

11/05/2025

Submitted Date:

11/07/2025

Document Number:

715203345

FIELD INSPECTION FORM

Loc ID 314206 Inspector Name: Welsh, Brian On-Site Inspection 2A Doc Num: _____

Status Summary:

- THIS IS A FOLLOW UP INSPECTION
- FOLLOW UP INSPECTION REQUIRED
- NO FOLLOW UP INSPECTION REQUIRED

Operator Information:

ECMC Operator Number: 83130
Name of Operator: STRACHAN EXPLORATION INC
Address: 992 S 4TH AVE SUITE 100-461
City: BRIGHTON State: CO Zip: 80601

Findings:

- 11 Number of Comments
- 5 Number of Corrective Actions
- Corrective Action Response Requested

ANY CORRECTIVE ACTION(S) FROM PREVIOUS INSPECTIONS THAT HAVE NOT BEEN ADDRESSED ARE STILL APPLICABLE

Contact Information:

| Contact Name | Phone | Email | Comment |
|--------------|--------------|-------------------------------|---------|
| Reed, Shawn | 303-562-6530 | shawn@sreedconsulting.com | |
| Harms, Jason | | Jason@strachanexploration.com | |

Inspected Facilities:

| Facility ID | Type | Status | Status Date | Well Class | API Num | Facility Name | Insp Status |
|-------------|------|--------|-------------|------------|-----------|---------------|-------------|
| 228026 | WELL | PR | 01/01/2018 | GW | 099-06353 | HOFFMAN 2-31 | PR |

General Comment:

[This is a field audit of the scout card, related documents and the location conducted by SE Compliance Specialist Brian Welsh](#)

Location

| | | | |
|--------------------|---------------------------|-------|--|
| Lease Road: | | | |
| Type | Access | | |
| comment: | Two track through pasture | | |
| Corrective Action: | | Date: | |

Overall Good:

| | | | |
|----------------------|---|-------|------------|
| Signs/Marker: | | | |
| Type | WELLHEAD | | |
| Comment: | Lease sign by separator | | |
| Corrective Action: | | Date: | |
| Type | TANK LABELS/PLACARDS | | |
| Comment: | Tank only has capacity label | | |
| Corrective Action: | Install sign to comply with Rule 605.h. | Date: | 12/05/2025 |

Emergency Contact Number:

| | | | |
|--------------------|--|-------|--|
| Comment: | | | |
| Corrective Action: | | Date: | |

Overall Good:

| | | | |
|----------------|------|--------|--|
| Spills: | | | |
| Type | Area | Volume | |

In Containment: No

Comment:

Multiple Spills and Releases?

| | | | |
|--------------------|---|-------|------------|
| Fencing/: | | | |
| Type | WELLHEAD | | |
| Comment: | Pipe fence around wellhead | | |
| Corrective Action: | | Date: | |
| Type | TANK BATTERY | | |
| Comment: | Wire fence around tank, separator and meter shed. Fence is in disrepair and needs fixed immediately. The pasture is actively being grazed and cattle inside fencing around meter shed at time of inspection | | |
| Corrective Action: | Comply with the fencing requirements per the 1002a rules | Date: | 11/10/2025 |

| | | | |
|-----------------------------------|--|-------|-----------------|
| Equipment: | | | corrective date |
| Type: Horizontal Heated Separator | # 1 | | |
| Comment: | Separator is on south side of tank | | |
| Corrective Action: | | Date: | |
| Type: Gas Meter Run | # 1 | | |
| Comment: | Meter shed is on east side of water tank | | |
| Corrective Action: | | Date: | |
| Type: Plunger Lift | # 1 | | |
| Comment: | | | |

| | |
|--------------------|-------|
| Corrective Action: | Date: |
|--------------------|-------|

Tanks and Berms:

| Contents | # | Capacity | Type | Tank ID | SE GPS |
|----------------|---|----------|----------------|---------|-----------------------|
| PRODUCED WATER | 1 | 200 BBLs | FIBERGLASS AST | | 37.913990,-102.506710 |

| | |
|--------------------|-------|
| Comment: | Date: |
| Corrective Action: | Date: |

Paint

| | | | |
|------------------|--|--|--|
| Condition | | | |
| Other (Content) | | | |
| Other (Capacity) | | | |
| Other (Type) | | | |

Berms

| Type | Capacity | Permeability (Wall) | Permeability (Base) | Maintenance |
|---|------------|---------------------|---------------------|------------------|
| Earth | Inadequate | Walls Sufficient | Base Sufficient | Inadequate |
| Comment: Berms need maintenance for capacity | | | | |
| Corrective Action: Repair or install berms or other secondary containment devices per Rule 912.d.(1). | | | | Date: 12/05/2025 |

Venting:

| | | | |
|--------------------|--|--|-------|
| Yes/No | | | |
| Comment: | | | |
| Corrective Action: | | | Date: |

Flaring:

| | | | |
|--------------------|--|--|-------|
| Type | | | |
| Comment: | | | |
| Corrective Action: | | | Date: |

Inspected Facilities

Facility ID: 228026 Type: WELL API Number: 099-06353 Status: PR Insp. Status: PR

Producing Well

Comment: Producing. There was an audible gas leak detected on the north side of the separator on the 90 degree elbow of the 1/4" line for the regulator.

Corrective Action: Securely fasten all valves, pipes, fittings, and Production Facilities to ensure good mechanical condition, inspect at regular intervals and maintain in good mechanical condition per Rule 608.e.

Date: 11/10/2025

The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12

Reclamation - Storm Water - Pit

Storm Water:

| Loc Erosion BMPs | BMP Maintenance | Lease Road Erosion BMPs | Lease BMP Maintenance | Chemical BMPs | Chemical BMP Maintenance | Comment |
|------------------|-----------------|-------------------------|-----------------------|---------------|--------------------------|---------|
| Compaction | Pass | Compaction | Pass | | | |

Comment: [Access has deep tracks and needs to be maintained](#)

Corrective Action: [Repair and maintain access](#)

Date: 12/05/2025

Pits: NO SURFACE INDICATION OF PIT

Attached Documents

You can go to ECMC Images (<https://ecmc.state.co.us/weblink/>) and search by document number:

| Document Num | Description | URL |
|--------------|--|---|
| 715203363 | wellhead photo | http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=7322051 |
| 715203364 | separator and tank | http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=7322052 |
| 715203365 | separator leak at 1/4" line on regulator | http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=7322053 |
| 715203366 | meter shed | http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=7322054 |