

**FORM  
INSP**

Rev  
X/20

**State of Colorado  
Energy and Carbon Management Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203  
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

10/29/2025

Submitted Date:

11/07/2025

Document Number:

701104307

**FIELD INSPECTION FORM**

Loc ID: 335102 Inspector Name: LONGWORTH, MIKE On-Site Inspection:  2A Doc Num: \_\_\_\_\_

**Status Summary:**

- THIS IS A FOLLOW UP INSPECTION
- FOLLOW UP INSPECTION REQUIRED
- NO FOLLOW UP INSPECTION REQUIRED

**Operator Information:**

ECMC Operator Number: 10844  
Name of Operator: QB ENERGY OPERATING LLC  
Address: 1001 17TH STREET SUITE 1600  
City: DENVER State: CO Zip: 80202

**Findings:**

- 3 Number of Comments
- 1 Number of Corrective Actions
- Corrective Action Response Requested

**ANY CORRECTIVE ACTION(S) FROM PREVIOUS INSPECTIONS THAT HAVE NOT BEEN ADDRESSED ARE STILL APPLICABLE**

**Contact Information:**

Contact Name	Phone	Email	Comment
Schlagenhauf, Mark		mark.schlagenhauf@state.co.us	
,		ecmc.inspections@qb-energy.com	
Heil, John		john.heil@state.co.us	

**Inspected Facilities:**

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
272024	WELL	PR	12/01/2004	GW	045-09998	GMR 34-3 (B34NW)	EG
272025	WELL	PR	11/23/2004	GW	045-09999	GMR 34-2 (B34NW)	EG
272026	WELL	PR	01/01/2024	GW	045-10000	GMR 34-1B (B34NW)	EG
272027	WELL	PR	11/29/2004	GW	045-10001	GMR 34-2B (B34NW)	EG
491149	SPILL OR RELEASE	AC	08/25/2025		-	B34NW Separator Release	EG

**General Comment:**

Flowline Integrity Inspection and Tank Integrity Inspection  
Follow up to 10/03/2025 Integrity Inspection # 701104277  
Risers have been labeled "Do Not Operate" to comply with OOSLAT  
Communication with QB EHS Specialist Derek Horn made by email.  
"So far, we have sampled the point of release and attempted to delineate impacts last week. I am currently waiting on lab results to determine the next steps in our remediation efforts. Following sample results, we will determine the repair efforts necessary to not interfere with remediation. The failure is a tee- fitting that failed at the riser connection. This has not been removed or examined until the next steps are determined. Currently the 3D and 5CX are shut in at the C34NW.  
I plan to have an initial Form 27 submitted in the next day or two. You are correct though; the release occurred on the B34NW but was the result of an associated well on the C34NW."  
In the Supplemental Form 19, identify the root cause of the failure and explain how reoccurrence on this pipeline and the other pipelines associated with this facility will be prevented, per Rule 912.d.(3). Coordinate with ECMC Western Integrity Inspector, Mike Longworth, regarding pipeline excavation, assessment, and repair. Provide a minimum 48-hours of advance notice to Mike Longworth via email (michael.longworth@state.co.us) prior to pressure testing of equipment.

**Location**

Overall Good:

**Signs/Marker:**

Type OTHER

Comment: Risers have been labeled "Do Not Operate" to comply with OOSLAT

Corrective Action:

Date:

**Emergency Contact Number:**

Comment:

Corrective Action:

Date: \_\_\_\_\_

Overall Good:

**Spills:**

Type	Area	Volume		

In Containment: No

Comment:

Multiple Spills and Releases?

**Venting:**

Yes/No

Comment:

Corrective Action:

Date:

**Flaring:**

Type

Comment:

Corrective Action:

Date:

**Inspected Facilities**

Facility ID: 272024 Type: WELL API Number: 045-09998 Status: PR Insp. Status: EG

The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12

Facility ID: 272025 Type: WELL API Number: 045-09999 Status: PR Insp. Status: EG

The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12

Facility ID: 272026 Type: WELL API Number: 045-10000 Status: PR Insp. Status: EG

The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12

Facility ID: 272027 Type: WELL API Number: 045-10001 Status: PR Insp. Status: EG

The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12

Facility ID: 491149 Type: SPILL OR API Number: - Status: AC Insp. Status: EG

The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12

**Attached Documents**

You can go to ECMC Images (<https://ecmc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
404428402	INSPECTION SUBMITTED	<a href="https://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=7322937">https://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=7322937</a>
701104308	Flowline integrity inspection 701104307 photos	<a href="https://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=7322936">https://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=7322936</a>