

**FORM
INSP**

Rev
X/20

**State of Colorado
Energy and Carbon Management Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

11/25/2025

Submitted Date:

12/01/2025

Document Number:

719500688

FIELD INSPECTION FORM

Loc ID 323836 Inspector Name: Morris, Matthew On-Site Inspection 2A Doc Num: _____

Status Summary:

- THIS IS A FOLLOW UP INSPECTION
- FOLLOW UP INSPECTION REQUIRED
- NO FOLLOW UP INSPECTION REQUIRED

Operator Information:

ECMC Operator Number: 10844
Name of Operator: QB ENERGY OPERATING LLC
Address: 1001 17TH STREET SUITE 1600
City: DENVER State: CO Zip: 80202

Findings:

- 10 Number of Comments
- 1 Number of Corrective Actions
- Corrective Action Response Requested

ANY CORRECTIVE ACTION(S) FROM PREVIOUS INSPECTIONS THAT HAVE NOT BEEN ADDRESSED ARE STILL APPLICABLE

Contact Information:

Contact Name	Phone	Email	Comment
Energy, QB		ecmc.inspections@qb-energy.com	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
210930	WELL	PR	08/01/2025	GW	045-06688	CEDAR BENCH FEDERAL 6305	PR

General Comment:

This is a field audit of the location, scout card, and related documents.

On 11/25/2025 at approximately 10:10, Compliance Inspector Matthew Morris conducted a follow-up audit at QB ENERGY OPERATING LLC, CEDAR BENCH FEDERAL-66S100W/17SWSE at Location ID #323836 in Garfield County, Colorado.

This location is within or in close proximity to, a CPW Density/High Priority Habitat, Black Bear, NSO Habitat, or Wildlife Management area.

Location

Overall Good:

Signs/Marker:

Type	OTHER		
Comment:	Separator units include attached storage tanks. The sight glass on the side of the unit indicates that the storage tank contains an unknown fluid. No form of labeling or markers is present to identify a potential hazard or the contents of the storage tank.		
Corrective Action:		Date:	
Type	WELLHEAD		
Comment:			
Corrective Action:		Date:	
Type	BATTERY		
Comment:			
Corrective Action:		Date:	
Type	TANK LABELS/PLACARDS		
Comment:			
Corrective Action:		Date:	

Emergency Contact Number:

Comment:

Corrective Action:

Date:

Overall Good:

Spills:

Type	Area	Volume		

In Containment: No

Comment:

Multiple Spills and Releases?

Fencing/:

Type	SEPARATOR		
Comment:	Livestock fencing		
Corrective Action:		Date:	
Type	TANK BATTERY		
Comment:	Livestock fencing		
Corrective Action:		Date:	
Type	WELLHEAD		
Comment:	Pipe rails		
Corrective Action:		Date:	

Equipment:

Type: Bradenhead	# 1		corrective date
Comment:			
Corrective Action:		Date:	

Type: Horizontal Heated Separator	# 1		
Comment:			
Corrective Action:			Date:
Type: Plunger Lift	# 1		
Comment:			
Corrective Action:			Date:
Type: Bird Protectors	# 2		
Comment:			
Corrective Action:			Date:
Type: Gas Meter Run	# 1		
Comment:			
Corrective Action:			Date:

Tanks and Berms:

Contents	#	Capacity	Type	Tank ID	SE GPS
CONDENSATE	1	200 BBLs	HEATED STEEL AST		
Comment:					
Corrective Action:					Date:

Paint

Condition	Adequate	
Other (Content)		
Other (Capacity)		
Other (Type)		

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Metal				
Comment:				
Corrective Action:				Date:

Venting:

Yes/No	NO	
Comment:		
Corrective Action:		Date:

Flaring:

Type	
Comment:	
Corrective Action:	Date:

Inspected Facilities

Facility ID: 210930 Type: WELL API Number: 045-06688 Status: PR Insp. Status: PR

Producing Well

Comment:

Corrective Action:

Date:

The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12

Reclamation - Storm Water - Pit

Storm Water:

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
		Ditches				
		Check Dams				
		Culverts				
		Other	Fail			Insufficient erosion controls
Berms						
Compaction						
		Compaction	Fail			Lack of stabilization
Gravel						
		Gravel				

Comment: Lease road surface lacks stabilization; insufficient BMPs in place to minimize transportation of sediment.

Corrective Action: Install or repair required BMPs.

Date: 12/17/2025

Pits: NO SURFACE INDICATION OF PIT

ECMC Comments

Comment	User	Date
<p>During the audit, the following compliance issue(s) were observed:</p> <p>1) Lease road surface lacks stabilization; insufficient BMPs in place to minimize transportation of sediment</p> <p>A follow-up on this site audit will be conducted to ensure the compliance issues have been corrected to comply with CECMC rules.</p>	morrism	12/01/2025

Attached Documents

You can go to ECMC Images (<https://ecmc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
719500689	Photo Log	https://ecmc.state.co.us/weblink/DownloadDocumentPDF.aspx?DocumentId=7354405