

**FORM
INSP**

Rev
X/20

**State of Colorado
Energy and Carbon Management Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

11/25/2025

Submitted Date:

12/02/2025

Document Number:

719500690

FIELD INSPECTION FORM

Loc ID 323807 Inspector Name: Morris, Matthew On-Site Inspection 2A Doc Num: _____

Status Summary:

- THIS IS A FOLLOW UP INSPECTION
- FOLLOW UP INSPECTION REQUIRED
- NO FOLLOW UP INSPECTION REQUIRED

Operator Information:

ECMC Operator Number: 10844
Name of Operator: QB ENERGY OPERATING LLC
Address: 1001 17TH STREET SUITE 1600
City: DENVER State: CO Zip: 80202

Findings:

- 12 Number of Comments
- 1 Number of Corrective Actions
- Corrective Action Response Requested

ANY CORRECTIVE ACTION(S) FROM PREVIOUS INSPECTIONS THAT HAVE NOT BEEN ADDRESSED ARE STILL APPLICABLE

Contact Information:

Contact Name	Phone	Email	Comment
Energy, QB		ecmc.inspections@qb-energy.com	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
210845	WELL	PR	08/01/2025	GW	045-06603	CEDAR BENCH FEDERAL 6306	PR

General Comment:

This is a field audit of the location, scout card, and related documents.

On 11/25/2025 at approximately 10:15, Compliance Inspector Matthew Morris conducted a follow-up audit at QB ENERGY OPERATING LLC, CEDAR BENCH FEDERAL-66S100W/20NESE at Location ID #323807 in Garfield County, Colorado.

This location is within or in close proximity to, a CPW Density/High Priority Habitat, Black Bear, NSO Habitat, or Wildlife Management area.

Location

Overall Good:

Signs/Marker:			
Type	BATTERY		
Comment:			
Corrective Action:		Date:	
Type	TANK LABELS/PLACARDS		
Comment:			
Corrective Action:		Date:	
Type	OTHER		
Comment:	Separator units include attached storage tanks. The sight glass on the side of the unit indicates that the storage tank contains an unknown fluid. No form of labeling or markers is present to identify a potential hazard or the contents of the storage tank.		
Corrective Action:		Date:	
Type	WELLHEAD		
Comment:			
Corrective Action:		Date:	

Emergency Contact Number:			
Comment:	911/(970)285-2615		
Corrective Action:		Date:	_____

Overall Good:

Spills:			
Type	Area	Volume	

In Containment: No _____

Comment: _____

Multiple Spills and Releases?

Fencing/:			
Type	TANK BATTERY		
Comment:	Livestock fencing		
Corrective Action:		Date:	
Type	SEPARATOR		
Comment:	Livestock fencing		
Corrective Action:		Date:	
Type	WELLHEAD		
Comment:	Pipe rails		
Corrective Action:		Date:	

Equipment:			corrective date
Type: Plunger Lift	# 1		
Comment:			
Corrective Action:		Date:	

Type: Dehydrator	# 1		
Comment:			
Corrective Action:			Date:
Type: Bird Protectors	# 3		
Comment:			
Corrective Action:			Date:
Type: Horizontal Heated Separator	# 1		
Comment:			
Corrective Action:			Date:
Type: Bradenhead	# 1		
Comment:			
Corrective Action:			Date:
Type: Gas Meter Run	# 1		
Comment:			
Corrective Action:			Date:

Tanks and Berms:

Contents	#	Capacity	Type	Tank ID	SE GPS
PRODUCED WATER	1	200 BBLs	HEATED STEEL AST		
Comment:					
Corrective Action:					Date:

Paint

Condition	Adequate	
Other (Content)		
Other (Capacity)		
Other (Type)		

Berms

Type	Capacity	Permeability (Wall)	Permeability (Base)	Maintenance
Metal				
Comment:				
Corrective Action:				Date:

Venting:

Yes/No	NO	
Comment:		
Corrective Action:		Date:

Flaring:

Type	
Comment:	
Corrective Action:	Date:

Inspected Facilities

Facility ID: 210845 Type: WELL API Number: 045-06603 Status: PR Insp. Status: PR

Producing Well

Comment:

Corrective Action:

Date:

The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12

Reclamation - Storm Water - Pit						
Storm Water:						
Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
		Compaction	Fail			Lack of stabilization
Compaction	Fail					Lack of stabilization
		Check Dams				
		Gravel				
		Culverts				
		Other	Fail			Insufficient erosion controls
Berms						
		Ditches				
Other	Fail					Insufficient tracking BMPs
Gravel						
Comment:		1) Location surface lacks stabilization with insufficient vehicle tracking BMPs in place to minimize transportation of sediment offsite 2) Lease road surface lacks stabilization; insufficient BMPs in place to minimize transportation of sediment				Date: <u>12/18/2025</u>
Corrective Action:		Oil and gas operators shall implement and maintain Best Management Practices (BMPs) at all oil and gas locations to control Stormwater runoff in a manner that minimizes erosion, transport of sediment offsite, and site degradation. BMPs shall be maintained until the facility is abandoned and final reclamation is achieved. Install or repair required BMPs.				
Pits: <input checked="" type="checkbox"/> NO SURFACE INDICATION OF PIT						

ECMC Comments		
Comment	User	Date
During the audit, the following compliance issue(s) were observed: 1) Location surface lacks stabilization with insufficient vehicle tracking BMPs in place to minimize transportation of sediment offsite 2) Lease road surface lacks stabilization; insufficient BMPs in place to minimize transportation of sediment A follow-up on this site audit will be conducted to ensure the compliance issues have been corrected to comply with CECMC rules.	morrism	12/02/2025

Attached Documents

You can go to ECMC Images (<https://ecmc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
719500691	Photo Log	https://ecmc.state.co.us/weblink/DownloadDocumentPDF.aspx?DocumentId=7357125