

Document Number:
 404347328
 Date Received:
 09/09/2025

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

ECMC Operator Number: 47120 Contact Name: CANDICE BARBER
 Name of Operator: KERR MCGEE OIL & GAS ONSHORE LP Phone: (307) 233-4513
 Address: P O BOX 173779 Fax: _____
 City: DENVER State: CO Zip: 80217- Email: CANDICE_BARBER@OXY.COM

For "Intent" 24 hour notice required, Name: _____ Tel: _____
 Email: _____

Type of Well Abandonment Report: Notice of Intent to Abandon Subsequent Report of Abandonment

API Number 05-123-20353-00
 Well Name: HSR-DEEPE Well Number: 3-22A
 Location: QtrQtr: NENW Section: 22 Township: 2N Range: 67W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: _____
 Field Name: WATTENBERG Field Number: 90750

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.129514 Longitude: -104.878666
 GPS Data: GPS Quality Value: 2.7 Type of GPS Quality Value: PDOP Date of Measurement: 08/26/2024
 Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other _____
 Casing to be pulled: Yes No Estimated Depth: _____
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7610	7630	05/17/2024	RETAINER/SQUEEZED	7370
NIOBRARA	7400	7486	05/17/2024	RETAINER/SQUEEZED	7370
J SAND	8061	8082		B PLUG CEMENT TOP	7800

Total: 3 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
SURF	12+1/4	8+5/8	J-55	24	0	681	480	681	0	VISU
1ST	7+7/8	4+1/2	I-80	11.6	0	8324	335	8324	7050	CBL
S.C. 1.1						5316	300	5360	4100	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7800 with 2 sacks cmt on top. CIBP #2: Depth 300 with 93 sacks cmt on top.
 CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
 CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 116 sks cmt from 683 ft. to 383 ft. Plug Type: OPEN HOLE Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
 Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at 7400 ft. with 100 sacks. Leave at least 100 ft. in casing 7370 CICR Depth
 Perforate and squeeze at 4510 ft. with 100 sacks. Leave at least 100 ft. in casing 4480 CICR Depth
 Perforate and squeeze at 2300 ft. with 160 sacks. Leave at least 100 ft. in casing 1950 CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 380 sacks half in. half out surface casing from 1600 ft. to 683 ft. Plug Tagged:
 Set 93 sacks at surface
 Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No
 Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: 1550 ft. of 4+1/2 inch casing Number of Days from Setting Surface Plug to Capping or Sealing the Well: 87
 Surface Plug Setting Date: 05/31/2024 Cut and Cap Date: 08/26/2024
 *Wireline Contractor: RANGER *Cementing Contractor: RANGER
 Type of Cement and Additives Used: _____
 Flowline/Pipeline has been abandoned per Rule 1105 Yes No

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.
 Signed: _____ Print Name: CANDICE_BARBER
 Title: REG ANALYST Date: 9/9/2025 Email: DJREGULATORY@OXY.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with ECMC Rules and applicable orders and is hereby approved.

JENKINS, STEVE

ECMC Approved:

Date: 12/4/2025

CONDITIONS OF APPROVAL, IF ANY LIST

<u>COA Type</u>	<u>Description</u>
0 COA	

ATTACHMENT LIST

<u>Att Doc Num</u>	<u>Name</u>
404347328	FORM 6 SUBSEQUENT SUBMITTED
404347355	OPERATIONS SUMMARY
404347383	OTHER
404347548	CEMENT JOB SUMMARY
404347554	OTHER
404347555	WELLBORE DIAGRAM
404347556	WIRELINE JOB SUMMARY

Total Attach: 7 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Permit	2 months PA. Pass.	11/17/2025

Total: 1 comment(s)