

**FORM
INSP**

Rev
X/20

**State of Colorado
Energy and Carbon Management Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

12/09/2025

Submitted Date:

12/09/2025

Document Number:

716301799

FIELD INSPECTION FORM

Loc ID 324565 Inspector Name: Beardslee, Tom On-Site Inspection 2A Doc Num: _____

Status Summary:

- THIS IS A FOLLOW UP INSPECTION
- FOLLOW UP INSPECTION REQUIRED
- NO FOLLOW UP INSPECTION REQUIRED

Operator Information:

ECMC Operator Number: 10816
Name of Operator: SILVER MOUNTAIN ENERGY LLC
Address: 31487 STATE HIGHWAY 37
City: HINTON State: OK Zip: 73047

Findings:

- 15 Number of Comments
- 2 Number of Corrective Actions
- Corrective Action Response Requested

ANY CORRECTIVE ACTION(S) FROM PREVIOUS INSPECTIONS THAT HAVE NOT BEEN ADDRESSED ARE STILL APPLICABLE

Contact Information:

Contact Name	Phone	Email	Comment
,		dnr_ecmc_engineering@state.co.us	
Wright, Lonnie	(405) 542-7836	lonnie@sme.llc	All Forms
Wright, Taylir	(405) 952-4604	taylir@sme.llc	All Forms
Flick, Jay	(580) 799-1075	jay@sme.llc	All Forms

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
265121	WELL	PR	03/01/2025	CO2	055-06285	CADDELL 1	PR
435037	WELL	PR	03/01/2025	CO2	055-06312	Caddell 2	PR
439694	WELL	PR	05/01/2025	OW	055-06319	Caddell 3	PR

General Comment:

"This is a field audit of the scout card, related documents and the location."

Location

Overall Good:

Signs/Marker:			
Type			
Comment:	PHOTO 1: API # ON POSTED WELLHEAD SIGN IS INACCURATE AND 911 IS NOT LISTED.		
Corrective Action:	Install sign to comply with Rule 605.e. THIS IS THE SECOND NOTICE FOR THIS CA, IMMEDIATE ACTION IS REQUIRED.	Date:	

Emergency Contact Number:			
Comment:	<input style="width: 100%;" type="text"/>		
Corrective Action:	<input style="width: 100%;" type="text"/>		Date: <input style="width: 100%;" type="text"/>

Good Housekeeping:			
Type	WEEDS		
Comment:	PHOTO 4: TALL SHRUBS AROUND LOCATION. MAINTAIN WEEDS PER RULE 606.		
Corrective Action:	THIS IS THE SECOND NOTICE FOR THIS CA, IMMEDIATE ACTION IS REQUIRED.	Date:	

Overall Good:

Spills:			
Type	Area	Volume	

In Containment: No

Comment:

Multiple Spills and Releases?

Equipment:			corrective date
Type: Bradenhead	# 1		
Comment:	IS ACCESSABLE		
Corrective Action:		Date:	
Type: Gas Meter Run	# 2		
Comment:			
Corrective Action:		Date:	

Venting:			
Yes/No	NO		
Comment:			
Corrective Action:		Date:	

Flaring:			
Type			
Comment:			
Corrective Action:		Date:	

Inspected Facilities			
Facility ID: <u>265121</u>	Type: <u>WELL</u>	API Number: <u>055-06285</u>	Status: <u>PR</u> Insp. Status: <u>PR</u>
Producing Well			
Comment: <u>PR</u>			
Corrective Action:		Date:	
BradenHead			
Date of Last Brhd Test: <u>10/30/2024</u>	Annual Brhd Completed? _____		
Last Brhd Test Results	Initial Surf Csg Pressure: <u>305</u>	Fluid Type: <u>GAS</u>	
	End Surf Csg Pressure: <u>0</u>		
Comment: <u>SUBMIT REPORTS</u>			
Corrective Action:		Date:	
Workover			
Comment: <u>OPERATOR PERFORMED MIT TOP OF PERFS @ 5205' TOP OF PKR @ 5170' START TEST 359.7 PSI 5 MIN. 359.1 PSI 10 MIN. 358.7 PSI FINAL 15 MIN. 358.5 PSI. FOR A TOTAL OF 1.2 PSI LOSS, W/ .2 LOSS IN LAST 5 MIN. BRHD HAD 260 PSI, REMOVED GUAGE, OPENED VALVE AND A MIST OF FLUID CAME TO SURFACE HOWEVER THERE WASNT ENOUGH TO GET A FLUID SAMPLE, OPERATOR COLLECTED A GAS SAMPLE AND BRHD BLEW DOWN TO A WISPER IN APP. 16 SECONDS AND TO 0 IN APP. 3 MIN.</u>			
Corrective Action:		Date:	

The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12

Facility ID: <u>435037</u>	Type: <u>WELL</u>	API Number: <u>055-06312</u>	Status: <u>PR</u> Insp. Status: <u>PR</u>
Producing Well			
Comment: <u>PR</u>			
Corrective Action:		Date:	
BradenHead			
Date of Last Brhd Test: <u>10/30/2024</u>	Annual Brhd Completed? _____		
Last Brhd Test Results	Initial Surf Csg Pressure: <u>10</u>	Fluid Type: <u>NONE</u>	
	End Surf Csg Pressure: <u>0</u>		
Comment: <u>SUBMIT REPORTS</u>			
Corrective Action:		Date:	

The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12

Facility ID: <u>439694</u>	Type: <u>WELL</u>	API Number: <u>055-06319</u>	Status: <u>PR</u> Insp. Status: <u>PR</u>
Producing Well			
Comment: <u>PR</u>			
Corrective Action:		Date:	

BradenHead

Date of Last Brhd Test: 10/30/2024 Annual Brhd Completed?

Last Brhd Test Results Initial Surf Csg Pressure: 2 Fluid Type: NONE

End Surf Csg Pressure: 0

Comment:

Corrective Action:

Date:

The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12

Reclamation - Storm Water - Pit

Storm Water:

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
Gravel	Pass	Gravel	Pass			
Compaction	Pass	Compaction	Pass			

Comment:

Corrective Action:

Date: _____

Pits: NO SURFACE INDICATION OF PIT

ECMC Comments

Comment	User	Date
<p>ECMC Inspection Report Summary On Tuesday 12-8-2025 at approximately 12:11, I Tom Beardslee Conducted an on-site inspection an Evergreen Natural Resources location CADDELL #1, #2 & #3 API# 05-055-06285 in Las Animas County Colorado. While there, I observed production operation. During this inspection the following possible compliance issues were observed: API # INACCURATE, RULE 605, SECOND NOTICE IMMEDEATE ACTION REQUIRED. WEEDS, RULE 606, SECOND NOTICE IMMEDEATE ACTION REQUIRED A follow up on this site inspection needs to be conducted to ensure the Compliance issues have been corrected to comply with ECMC rules.</p>	beardslt	12/09/2025

Attached Documents

You can go to ECMC Images (<https://ecmc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
716301800	INSP. PHOTOS	https://ecmc.state.co.us/weblink/DownloadDocumentPDF.aspx?DocumentId=7367030