

DE	ET	OE	ES
----	----	----	----

Document Number:  
 404468827  
 Date Received:

**WELL ABANDONMENT REPORT**

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

ECMC Operator Number: 47120 Contact Name: CANDICE BARBER  
 Name of Operator: KERR MCGEE OIL & GAS ONSHORE LP Phone: (307) 233-4513  
 Address: P O BOX 173779 Fax: \_\_\_\_\_  
 City: DENVER State: CO Zip: 80217- Email: CANDICE\_BARBER@OXY.COM

**For "Intent" 24 hour notice required,** Name: \_\_\_\_\_ Tel: \_\_\_\_\_  
 ECMC contact: Email: \_\_\_\_\_

Type of Well Abandonment Report:  Notice of Intent to Abandon  Subsequent Report of Abandonment

API Number 05-123-40744-00  
 Well Name: GOODIN Well Number: 16N-A6HZ  
 Location: QtrQtr: SWSE Section: 7 Township: 1N Range: 65W Meridian: 6  
 County: WELD Federal, Indian or State Lease Number: \_\_\_\_\_  
 Field Name: WATTENBERG Field Number: 90750

*Only Complete the Following Background Information for Intent to Abandon*

Latitude: 40.059844 Longitude: -104.702357  
 GPS Data: GPS Quality Value: 1.6 Type of GPS Quality Value: PDOP Date of Measurement: 12/04/2025  
 Reason for Abandonment:  Dry  Production Sub-economic  Mechanical Problems  
 Other \_\_\_\_\_  
 Casing to be pulled:  Yes  No Estimated Depth: \_\_\_\_\_  
 Fish in Hole:  Yes  No If yes, explain details below  
 Wellbore has Uncemented Casing leaks:  Yes  No If yes, explain details below  
 Details: \_\_\_\_\_

**Current and Previously Abandoned Zones**

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
NIOBRARA	7634	13327	09/26/2025	B PLUG CEMENT TOP	7200

Total: 1 zone(s)

**Casing History**

Casing Type	Size of Hole	Size of Casing	Grade	Wt/Ft	Csg/Liner Top	Setting Depth	Sacks Cmt	Cmt Btm	Cmt Top	Status
CONDUCTOR	26	16	J-55	42.1	0	40	32	40	0	VISU
SURF	13+1/2	9+5/8	J-55	36	0	1588	583	1588	0	VISU
1ST	8+3/4	7	J-55	26	0	7624	700	7624	0	CBL
1ST LINER	6+1/8	4+1/2	HCP110	11.6	6671	13386	640	13386	6671	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7200 with 61 sacks cmt on top. CIBP #2: Depth 260 with 60 sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 61 sks cmt from 7200 ft. to 6489 ft. Plug Type: CASING Plug Tagged:   
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:

Perforate and squeeze at 4575 ft. with 100 sacks. Leave at least 100 ft. in casing 4545 CICR Depth  
Perforate and squeeze at 2240 ft. with 100 sacks. Leave at least 100 ft. in casing 2210 CICR Depth  
Perforate and squeeze at 1740 ft. with 160 sacks. Leave at least 100 ft. in casing 1710 CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set \_\_\_\_\_ sacks half in. half out surface casing from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Tagged:   
Set 60 sacks at surface  
Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker:  Yes  No  
Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Number of Days from Setting Surface Plug to Capping or Sealing the Well: 63  
Surface Plug Setting Date: 10/01/2025 Cut and Cap Date: 12/03/2025

\*Wireline Contractor: AXIS \*Cementing Contractor: AXIS

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1105  Yes  No

Technical Detail/Comments:

NOTE: This well had a tie back string that was still in the well so the casing punch gun was for punching the tie-back at 6650' before pulling it on 9/26/2025. Those holes were not part of the permanent wellbore.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: CANDICE BARBER  
Title: REG ANALYST Date: \_\_\_\_\_ Email: DJREGULATORY@OXY.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with ECMC Rules and applicable orders and is hereby approved.

ECMC Approved: \_\_\_\_\_ Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY LIST**

**COA Type**

**Description**

0 COA	

**ATTACHMENT LIST**

**Att Doc Num**

**Name**

404468833	OPERATIONS SUMMARY
404468834	OTHER
404468835	CEMENT JOB SUMMARY
404468836	WELLBORE DIAGRAM
404468837	WIRELINE JOB SUMMARY
404468838	OTHER

Total Attach: 6 Files

**General Comments**

**User Group**

**Comment**

**Comment Date**

		Stamp Upon Approval
--	--	---------------------

Total: 0 comment(s)