

Oxy Operations Summary

Well:	GOODIN 16N-A6HZ			Spud Date:	1/13/2015 8:30:00 PM
Project:	COLORADO - WELD			Site:	T01N-R65W-S07
Event:	ABANDONMENT			Rig Name:	MOUNTAIN WEST RIG 5
Start Date:	9/25/25			End Date:	12/3/25
Datum:	HP307 25'KB @ 5004			Well UWI:	0512340744
Report Date	Time From	Time To	Duration (hr)	Operation	
9/9/25	10:00	11:00	1	FORM 17 TEST NO FLUIDS, SC START 2 PSI AND SC END 0 PSI.	
9/15/25	7:30	9:30	2	JSA / SAFETY MEETING, CHECK PRESSURES (PSI): 1550 / 1550, MIRU SLICKLINE TRUCK, RIH W/ 2" JUC TO 7,296' - PULLED BOLT, RIH W/ 2" JUC TO 7,297' - PULLED BUMPER SPRING, RIH W/ 1.75" BLIND BOX TO TAG AT 7,334', NO FLUID SEEN, SHUT IN AND SECURE WELL, RDMO SLICKLINE TRUCK	
9/24/25	12:00	18:00	6	JSA, MIRU FLOWBACK EQUIP, CHECK PSI, SITP:1534, SICP:1534, SISCP:0, OPEN CASING AND START FLARING AT 13:00 AND FLARED UNTIL 15:00, SWAP OVER TO CSG WITH 950 AND FLARED UNTIL 16:00 WHILE WOC PUMPED WELL CONTROL. RDMO ALL FLOWBACK EQUIPMENT	
9/25/25	15:30	16:30	1	SKID RIG OVER, CENTER WELLHEAD/ SPOT IN RIG / INPS DERRICK / SCOPE UP DERRICK LEVEL OUT, SECURE LINES.	
9/25/25	16:30	16:45	0.25	CHECK PRESSURE SISCP 0 / 0 LEL SICP 100 / 100% LEL SITP 250 / 100% LEL SI 7" CASING 0 PSI	
9/25/25	16:45	17:15	0.50	KILL WELL PUMP 50 BBL DOWN CASING 38 BBL DOWN TUBING / WELL WAS ON SUCK PSI TEST BOP ON STUMP	
9/25/25	17:15	17:30	0.25	BREAK DOWN WELLHEAD / TOW FLANGED 5K MASTERVALVES	
9/25/25	17:30	18:15	0.75	NU BOP TORQUE TEST 250 LOW / 5000 HIGH PIPE RAMS / BLINDS LEAK DOWN TEST ACUMULATOR (PASS)	
9/25/25	18:15	18:30	0.25	RIG UP FLOOR & TONGS	
9/25/25	18:30	19:00	0.50	RELEASE TUBING HANGER / PULLED 35K BACK OUT LOCKDOWN NUTS, LD HANGER	
9/25/25	19:00	19:30	0.50	SHUT IN SECURE LOCATION, LOCK OUT TANKS.	
9/25/25	19:30	20:30	1	TRAVEL BACK TO YARD	
9/25/25				SIGNS POSTED AT ENTRANCE OF LOCATION FOR P&A OPERATIONS 09/25/2025	
9/25/25				FORM 42 SUBMITTED 09/23/2025 APROVED TO MIRU 09/23/2025, MIRU 09/25/2025 AT 15:00	
9/26/25	5:30	6:30	1	RIG CREW TRAVEL TO LOCATION FROM YARD	

Well:	GOODIN 16N-A6HZ			Spud Date:	1/13/2015 8:30:00 PM
Project:	COLORADO - WELD			Site:	T01N-R65W-S07
Event:	ABANDONMENT			Rig Name:	MOUNTAIN WEST RIG 5
Start Date:	9/25/25			End Date:	12/3/25
Datum:	HP307 25'KB @ 5004			Well UWI:	0512340744
Report Date	Time From	Time To	Duration (hr)	Operation	
9/26/25	6:30	7:00	0.50	HELD S/M JSA, WENT OVER PLAN FOR THE DAY, PROPER FOOTING, GOOD HAHOUSE KEEPIN COMUNICATION OPEN. WENT OVER HAZARDS OF THE DAY, STAYING HYDRATED, GOOD COMUNICATION, ALSO DICUSSED PROPER VALVE ALINE MENT. GOOD HAND PLACEMENT & STOP WORK, ALL HAZARDS THAT COME WITH ND & NU BOP AGAIN.	
9/26/25	7:00	7:15	0.25	CK PSI / WELL SHUT IN 12 HOURS SISCP 0, 0 LEL SICP 0, 0 LEL SITP 0, 0 LEL SI 7" CSING 0 LEL	
9/26/25	7:15	7:30	0.25	INPS RIG, START WARM UP EQ, SET FLOOR & CROWN-O-MATIC, INPS HARD LINE, PRIME PUMP, INPS PIN ON PUMP SET TO 3500 PSI, INPS GROUND CABLES.	
9/26/25	7:30	9:30	2	POOH SB 230 JTS 2 3/8 L-80 / THE WAS X/N ON & PUMP JOINTS / TUBING LOOK GOOD DISP COMING OUT 11 BBL	
9/26/25	9:30	11:30	2	HELD TAIL GATE S/M RU WIRELINE LUBICATOR & FLANGE PU 3.75 GR, RIH TO 7210' POOH PU 4.5 CIBP RIH SET CIB AT 7200' POOH PU 3" DUMP BAILER RIH	
9/26/25	11:30	12:30	1	REVERSE CIRC BOTTOMS UP / 125 BBL PACKER FLUID	
9/26/25	12:30	13:30	1	ND 7" BOP AND ALL WELLHEAD PARTS TO 10K HANGER	
9/26/25	13:30	15:30	2	NU 7" BOP BACK UP / CHANGE OUT PIPE RAMS TO 4.5 / PSI TEST FLANGE ON WELLHEAD. PSI TEST 250 LOW / 5000 HIGH 10 MIN (CHARTED)	
9/26/25	15:30	16:00	0.50	TIE-BACK SINGEL LINE / MADE RIG MAX PULL 120K CHANGE OUT ELIVATORS TO 150K WT	
9/26/25	16:00	16:30	0.50	PULL ON CASING 87K CAME FREE, STRING DROPPED TO 68 K	
9/26/25	16:30	17:00	0.50	PULL CASING LD ONE JOINT & 3' PUP JOINT	
9/26/25	17:00	17:30	0.50	SHUT IN DRAIN LINES, LOCK OUT TANKS, SECURE LOCATION	
9/26/25	17:30	18:30	1	TRAVEL BACK TO YARD	
9/29/25	5:30	6:30	1	RIG CREW TRAVEL TO LOCATION	

Well:	GOODIN 16N-A6HZ			Spud Date:	1/13/2015 8:30:00 PM
Project:	COLORADO - WELD			Site:	T01N-R65W-S07
Event:	ABANDONMENT			Rig Name:	MOUNTAIN WEST RIG 5
Start Date:	9/25/25			End Date:	12/3/25
Datum:	HP307 25'KB @ 5004			Well UWI:	0512340744
Report Date	Time From	Time To	Duration (hr)	Operation	
9/29/25	6:30	7:15	0.75	HELD S/M JSA, WENT OVER PLAN FOR THE DAY, GOOD COMUNICATION TEAM WORK, STOP WORK, MADE SURE VERY ONE WAS FITE FOR DUTY, ALSO DICUSED HAZARDS THAT MAY COME UP DURRING THE DAY, WENT OVER STOP WORK, MAKE SURE THERE IS A SPOTER AT ALL TIMES WHEN BACKING UP. PROPER PPE, MAKE SURE YOUR CLOTING IS NOT TORE. PROPER BOOTS AND SAFET GLASS. HAND PLACEMENT MAKE SURE WE ARE TALKING AND LOOKING OUT FOR OUR HANDS. TEAM WORK IS KEY TO A SAFE LOCATION ALSO WENT OVER CASING LD WITH CASING CREW & HAZARDS THAT WILL COME WITH THAT.	
9/29/25	7:15	7:30	0.25	CK PSI / WELL SHUT IN FOR 48 HRS ALL VALVES SHOWED 0 / NO LEL OUR SIGNS OF ANY MIGRATION.	
9/29/25	7:30	8:00	0.50	INPS RIG / START WARM UP, SET CROWN & FLOOR MATIC, INPS BREAKS LINKAGE & ALL OILS & FLUID LEVELS, PRIME PUMP AND LINES	
9/29/25	8:00	12:30	4.50	RU CASING CREW & TONGS & SLIPS POOH LD 10 JTS / PUT RIG BACK ON TWO LINE LD TOTAL 149 JTS 4.5 / SEAL ASSEMBLY WETHERFORD	
9/29/25	12:30	12:45	0.25	CHANGE OUT PIPE RAMS TO 2 3/8 FROM 4.5	
9/29/25	12:45	13:00	0.25	HELD BOP DRILL / ASSY TIME 1.12 SEC / HELD TAIL GATE ON HAZARDS THAT WHERE MIST FROM THE BOP DRILL.	
9/29/25	13:00	15:00	2	TIH OPEN ENDED TO 7140' W/ 224 JTS	
9/29/25	15:00	15:15	0.25	HELD TAIL GATE S/M RU CEMENT CREW, WENT OVER HAZARDS	
9/29/25	15:15	15:45	0.50	PUMP STAGE # 1 NIO / 61 SXS ON TOP CIBP & TWO SXS 15.8 / 1.31 YEILD / 5.527H20 / 14.2 BBL WATER TEMP 70, 7 PH, 500 CLORIDES TOC 6489' BOC 7140'	
9/29/25	15:45	17:30	1.75	POOH LD 82 JTS 2 3/8 L-80 TUBING	
9/29/25	17:30	18:00	0.50	SHUT IN DRAIN LINES, LOCK OUT TANKS, SECURE LOCATION	
9/29/25	18:00	19:00	1	RIG CREW TRAVEL BACK TO YARD	
9/30/25	5:30	6:30	1	RIG CREW TRAVEL TO LOCATION	
9/30/25	6:30	7:00	0.50	HELD S/M JSA, WENT OVER PLAN FOR THE DAY, GOOD COMUNICATION TEAM WORK, STOP WORK, MADE SURE VERY ONE WAS FITE FOR DUTY, ALSO DICUSED HAZARDS THAT MAY COME UP DURRING THE DAY, WENT OVER STOP WORK, HAND PLACEMENT, GOOD COMUNICATION. BIG THINGS TALK ABOUT IS USING A SPOTTER, GOOD COMUNICATION WITH PEOPLE COMING IN LOCATION. THINGS WITHT HE RIG WE NEED TO GET INLINE, GROUND CABLES, MAKE SURE THERE ARE INSTALLED PROPERLY.	
9/30/25	7:00	7:15	0.25	CK PSI / WELL SHUT IN FOR 48 HRS ALL VALVES SHOWED 0 / NO LEL OUR SIGNS OF ANY MIGRATION.	

Well:	GOODIN 16N-A6HZ			Spud Date:	1/13/2015 8:30:00 PM
Project:	COLORADO - WELD			Site:	T01N-R65W-S07
Event:	ABANDONMENT			Rig Name:	MOUNTAIN WEST RIG 5
Start Date:	9/25/25			End Date:	12/3/25
Datum:	HP307 25'KB @ 5004			Well UWI:	0512340744
Report Date	Time From	Time To	Duration (hr)	Operation	
9/30/25	7:15	7:30	0.25	INPS RIG / START WARM UP, SET CROWN & FLOOR MATIC, INPS BREAKS LINKAGE & ALL OILS & FLUID LEVELS, PRIME PUMP AND LINES. INPS SAFETY RESTRAINTS.	
9/30/25	7:30	8:30	1	POOH SB 144 JTS DISP COMING OUT 3 BBL	
9/30/25	8:30	8:45	0.25	HELD TAIL GATE S/M RU WIRELINE / LUBICATOR & FLANGE	
9/30/25	8:45	9:30	0.75	PU TWO 4' 3.125 4 SPF 22.7 G, 120 DEG PH, .46 EH, 41" PEN DEEP PEN, RIH TO 4575' PERF PULL UP TO 2240' PERF, POOH (ALL SHOTS FIRED)	
9/30/25	9:30	9:45	0.25	RD WIRELINE / LUBICATOR & FLANGE	
9/30/25	9:45	11:15	1.50	PU 7" CICR RIH TO 4545' 143 JTS, SET CICR	
9/30/25	11:15	11:30	0.25	INJ TEST 4575' PERF 1.0 BBL AT 2350 / PSI BREAK OVER AT 2500 / PUMP ONE BBL AWAY / SHUT DOWN PSI DROP TO 1800 / LFT PSI ON CICR STING OUT	
9/30/25	11:30	11:45	0.25	HELD TAIL GATE S/M RU CASING CREW	
9/30/25	11:45	12:30	0.75	STAGE # 2 SUSSEX AGM PUMP 100 SXS / 15.8 1.17 YIELD / 5.083 GAL/SACK / DISP 15.5 WATER TEMP 70 DEG / 7 PH / 500 CLORIDES TOC 4495' BOC 4575'	
9/30/25	12:30	13:15	0.75	POOH LD 77 JTS DISP COMING OUT 2 BBL	
9/30/25	13:15	13:45	0.50	POOH SB 70 JTS / LD SETTING TOOL DISP COMING OUT 2 BBL	
9/30/25	13:45	15:00	1.25	PU 7" CICR RIH 2210' W/ 69 JTS, SET CICR	
9/30/25	15:00	15:15	0.25	INJ TEST 2240' PERF 1.0 BBL AT 1800 / PSI BREAK OVER AT 2200 / PUMP ONE BBL AWAY / SHUT DOWN PSI DROP TO 1500 / LFT PSI ON CICR STING OUT	
9/30/25	15:15	15:30	0.25	HELD TAIL GATE S/M RU CEMENT CREW	
9/30/25	15:30	16:00	0.50	STAGE # 3 LOWER AGM PUMP 100 SXS / 15.8 1.18 YIELD / 5.083 GAL/SACK / DISP 15.5 WATER TEMP 70 DEG / 7 PH / 500 CLORIDES TOC 2154' BOC 2240'	
9/30/25	16:00	16:30	0.50	POOH LD 15 JTS	
9/30/25	16:30	16:45	0.25	REVERSE CIRC BOTTOMS UP (NO CEMENT BACK)	
9/30/25	16:45	17:00	0.25	POOH SB 54 JTS DISP 3 BBL / TOP OFF SURFACE CASING	
9/30/25	17:00	17:30	0.50	DRAIN LINES, LOCK OUT TANKS, CLEAN TANK, SECURE LOCATION	
9/30/25	17:30	18:30	1	TRAVEL BACK TO YARD IN EATON, CO	
10/1/25	5:30	6:30	1	TRAVEL TO LOCATION	

Well:	GOODIN 16N-A6HZ			Spud Date:	1/13/2015 8:30:00 PM
Project:	COLORADO - WELD			Site:	T01N-R65W-S07
Event:	ABANDONMENT			Rig Name:	MOUNTAIN WEST RIG 5
Start Date:	9/25/25			End Date:	12/3/25
Datum:	HP307 25'KB @ 5004			Well UWI:	0512340744
Report Date	Time From	Time To	Duration (hr)	Operation	
10/1/25	6:30	7:00	0.50	HELD S/M JSA/ WENT OVER PLAN FOR THE DAY, GOOD COMMUNICATION TEAM WORK, STOPE WORK AND HAND SIGNALS. WHEN RIGGING DOWN TAKE A GOOD LOOK AT THE DERRICK & CROWN PRIOR TO RAICING THE DERRICK. HELD MORNING S/M WITH CEMENT CREW & RIG SUPERVISOR	
10/1/25	7:00	7:15	0.25	CK WELLHEAD PSI SICP 0, 0 LEL SISCP 0, 0 LEL	
10/1/25	7:15	7:30	0.25	START WARM UP EQ, INPS LINES, SET FLOOR & CROWN-O-MATIC, INPS HARD LINE, PUMP & FLUID LEVELS, CHECK FUEL LEVELS	
10/1/25	7:30	7:45	0.25	RU WIRELINE / LUBICATOR & BOP	
10/1/25	7:45	8:15	0.50	PU 3.125 4' DEEP PEN 1740'	
10/1/25	8:15	8:30	0.25	RD WIRELINE LUBICATOR & FLANGE	
10/1/25	8:30	9:30	1	PU 7" CICR TIH TO 1710' W/ 53 JTS / SET CICR	
10/1/25	9:30	9:45	0.25	RU CEMENT CREW / PSI TEST LINES TO 3000 PSI	
10/1/25	9:45	10:00	0.25	ESTABLISH INJ TEST 1.0 AT 1300 PSI BREAK OVER 2100 / PUMP 1 BBL AWAY ON TEST / DROP OFF 1000 / 500 AFTER TWO MIN	
10/1/25	10:00	10:15	0.25	STAGE # 4 UPPER AGM / SHOE PLUG PUMP 160 SXS / 15.8 / 1.19 YEILD / 5.089 H2O / 70 DEG / 7 PH / 500 CLORIDES TOC 1430 BOC 1740'	
10/1/25	10:15	10:30	0.25	POOH LD 20 JTS	
10/1/25	10:30	10:45	0.25	REVERSE CIRC BOTTOMS UP / NO CEMENT BACK	
10/1/25	10:45	13:00	2.25	COA / WAIT ON CEMENT TO TAG	
10/1/25	13:00	13:15	0.25	TIH TAG TOC W/ 41 JTS AT 1308'	
10/1/25	13:15	14:00	0.75	POOH LD 32 JTS	
10/1/25	14:00	14:15	0.25	POOH SB 8 JTS	
10/1/25	14:15	14:30	0.25	PSI TEST 7" CASING 500 PSI / HELD 10 MIN (PASS)	
10/1/25	14:30	15:00	0.50	PU 7" CIBP RIH TO 260' SET CIBP	
10/1/25	15:00	15:15	0.25	POOH LD SETTING TOOL	
10/1/25	15:15	15:30	0.25	TIH TO 260' / INSTALL HANGER 10' PUP / DIDNT WAT CEMENT IN RIG BOP	
10/1/25	15:30	15:45	0.25	HELD TAIL GATE S/M RIG UP CEMENT CREW	
10/1/25	15:45	16:00	0.25	STAGE # 5 TOP OFF PLUG 60 SXS / 15.8 / 1.19 YIELD / 5.089 H2O / 60 SXS/ 12.7 BBL / WATER 70 DEG / PH 7/ 500 CLORIDES. TOC 0' BOC 260'	
10/1/25	16:00	16:15	0.25	POOH LD 8 JTS	
10/1/25	16:15	16:30	0.25	RD FLOOR TONGS	
10/1/25	16:30	17:00	0.50	ND BOP / CLEAN CEMENT OUT LINES	
10/1/25	17:00	18:00	1	RD RIG / RELEASE ALL EQ	
10/1/25	18:00	19:00	1	TRAVEL BACK TO YARD	
10/1/25				WOC RIH TAG TOC AT 1308' / 10/01/2025	
10/1/25				DO TO PROXIMITY OF WETLAND, USED SECONDARY CONTAIMENTS, STORM WATER BPMS. 10/01/2025	

Well:	GOODIN 16N-A6HZ			Spud Date:	1/13/2015 8:30:00 PM
Project:	COLORADO - WELD			Site:	T01N-R65W-S07
Event:	ABANDONMENT			Rig Name:	MOUNTAIN WEST RIG 5
Start Date:	9/25/25			End Date:	12/3/25
Datum:	HP307 25'KB @ 5004			Well UWI:	0512340744
Report Date	Time From	Time To	Duration (hr)	Operation	
10/1/25				CHECK PSI PRIOR TO PLACIN PLUG AT 1710' WELL SHUT IN FOR 12 HRS, ALL VALVES SHOWED 0 PSI / NO FLOW / 0 LEL. 10/01/2025	
10/1/25				ALL PLUGS ARE AT LEAST 100' LONG. 10/01/2025	
11/19/25	8:00	10:00	2	FLUSH FLOW LINE.	
12/3/25	7:00	7:00	0	COA ISOLATION CONFIRMATION	
12/3/25	14:00	14:30	0.50	DUG UP SURFACE CASING. CEMENT TO SURFACE	
12/3/25	14:30	15:00	0.50	WELDING ON CUT & CAP NAME PLATE. BACKFILLED	