

State of Colorado
Energy & Carbon Management Commission



1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Document Number:
404517066

Date Received:
01/23/2026

FIR RESOLUTION FORM

Overall Status:

CA Summary:

3 of 3 CAs from the FIR responded to on this Form

3 CA Completed
0 Factual Review Request

OPERATOR INFORMATION

ECMC Operator Number: 10133
Name of Operator: HILCORP ENERGY COMPANY
Address: P O BOX 61229
City: HOUSTON State: TX Zip: 77208

Contact Name and Telephone:
Name: _____
Phone: () _____ Fax: () _____
Email: _____

Additional Operator Contact:

Contact Name	Phone	Email
<u>Labowskie, Steve</u>		<u>steve.labowskie@state.co.us</u>
<u>.General</u>		<u>FarmingtonRegulatoryTechs@hilcorp.com</u>

ECMC INSPECTION SUMMARY:

FIR Document Number: 719001180
Inspection Date: 01/21/2026 FIR Submit Date: 01/22/2026 FIR Status: _____

Inspected Operator Information:

Company Name: HILCORP ENERGY COMPANY Company Number: 10133
Address: P O BOX 61229
City: HOUSTON State: TX Zip: 77208

LOCATION - Location ID: 326308

Location Name: HUBER-ARADO-N35N8W Number: 13SWNE County: LA PLATA
Qtrqr: SWNE Sec: 13 Twp: 35N Range: 8W Meridian: N
Latitude: 37.305690 Longitude: -107.692160

FACILITY - API Number: 05-067-00 Facility ID: 216208

Facility Name: HUBER-ARADO Number: 1-13
Qtrqr: SWNE Sec: 13 Twp: 35N Range: 8W Meridian: N
Latitude: 37.305690 Longitude: -107.692160

CORRECTIVE ACTIONS:

1 CA# 210534

Corrective Action: Materials Handling and Spill Prevention Procedures and practices per rule 1002.f.(2)B Date: 01/25/2026

Response: CA COMPLETED Date of Completion: 01/23/2026

Operator Comment: Built berm around lube oil tank for secondary containment. See attached photo.

ECMC Decision: _____

ECMC Representative: _____

2 CA# 210535

Corrective Action: OOSLAT pre rule 1101.a (3)

Date: 01/25/2026

Response: CA COMPLETED

Date of Completion: 01/23/2026

Operator Comment: Marked unmarked rig anchor. See attached photo.

ECMC Decision: _____

ECMC Representative: _____

3 CA# 210536

Corrective Action: Return to service or properly abandon per 1100 series rules or explain why flowline is necessary for ongoing operations via FIRR

Date: 04/22/2026

Response: CA COMPLETED

Date of Completion: 01/23/2026

Operator Comment: Removed wooden pallets and properly disposed of. One inch pipe on edge of location as scrap material that was not attached to any process on location. Removed pipe and disposed of properly. See attached photos

ECMC Decision: _____

ECMC Representative: _____

OPERATOR COMMENT AND SUBMITTAL

Comment: _____

I hereby certify that the statements made in this form are, to the best of my knowledge, true, correct, and complete.

Print Name: Priscilla Shorty

Signed: _____

Title: OperationsRegulatory Tech

Date: 1/23/2026 11:54:32 AM

ATTACHMENT LIST

View Attachments in Imaged Documents on ECMC website (<http://ecmcweblink.state.co.us/>) - Search by Document Number.

<u>Document Number</u>	<u>Description</u>
404517066	FIR RESOLUTION SUBMITTED
404517069	HUBER-ARADO 1-13_719001180_Resolved Photos

Total Attach: 2 Files