

FORM INSP Rev X/20	State of Colorado Energy and Carbon Management Commission 1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109	 	Inspection Date: <u>02/11/2026</u> Submitted Date: <u>02/11/2026</u> Document Number: <u>719001317</u>
FIELD INSPECTION FORM			

Loc ID _____ Inspector Name: GARCIA, CHARLES On-Site Inspection
 326205 _____ 2A Doc Num: _____

Status Summary:

THIS IS A FOLLOW UP INSPECTION
 FOLLOW UP INSPECTION REQUIRED
 NO FOLLOW UP INSPECTION REQUIRED

Findings:

5 _____ Number of Comments
 0 _____ Number of Corrective Actions
 Corrective Action Response Requested

Operator Information:

ECMC Operator Number: 10133
 Name of Operator: HILCORP ENERGY COMPANY
 Address: P O BOX 61229
 City: HOUSTON State: TX Zip: 77208

ANY CORRECTIVE ACTION(S) FROM PREVIOUS INSPECTIONS THAT HAVE NOT BEEN ADDRESSED ARE STILL APPLICABLE

Contact Information:

Contact Name	Phone	Email	Comment
, General		FarmingtonRegulatoryTechs@hilcorp.com	SJB inspect
Labowskie, Steve		steve.labowskie@state.co.us	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
216040	WELL	PR	03/28/2000	CBM	067-07646	HUBER/SPC-FEDERAL 1-24	PR

General Comment:

Inspection Report Summary
 On 2/11/26 | Inspector Charles Garcia conducted an on-site follow up inspection.
 Location: HUBER/SPC-FEDERAL 1-24
 API# 067-07646
 Operator: HILLCORP ENERGY COMPANY
 County: LaPlata
 DOC#719001174
 FIR#404520312
 CA,S HAVE BEEN RESOLVED SEE LOCATION PICTURES

Location

Overall Good:

Emergency Contact Number:

Comment:

Corrective Action:

Date: _____

Overall Good:

Spills:

Type	Area	Volume			

In Containment: No

Comment:

Multiple Spills and Releases?

Equipment:

corrective date

Type: Prime Mover

1

Comment:

GAS ENGINE FOR PRIME MOVER LEAKING OIL BOTH SIDES OF ENGINE SKID SATURATED WITH OIL
 Corrective Action: MAINTAIN ENGINE RULE 608.e AND CLEAN UP IMPACTED SOIL AROUND ENGINE SKID rule 1002.f
 CA RESOLVED

Corrective Action:

Date:

Type: Ancillary equipment

1

Comment:

LUBE OIL CONTAINER WITH SPILL PREVENTION FOR PRIME MOVER APPROXIMATELY 3 IN FROM TOP SEE LOCATION PICTURES
 Corrective Action: "Maintain adequate freeboard in spill prevention to prevent overflow. Fluid is discolored and may have some product mixed in, fluid should be disposed as waste in approved manner for type of chemical used"
 CA RESOLVED

Corrective Action:

Date:

Venting:

Yes/No

Comment:

Corrective Action:

Date:

Flaring:

Type

Comment:

Corrective Action:

Date:

Inspected Facilities

Facility ID: 216040 Type: WELL API Number: 067-07646 Status: PR Insp. Status: PR

Producing Well

Comment:

Corrective Action:

Date:

BradenHead

Date of Last Brhd Test: 04/14/2025 Annual Brhd Completed? Yes

Last Brhd Test Results Initial Surf Csg Pressure: 0 Fluid Type:

End Surf Csg Pressure: 0

Comment:

Corrective Action:

Date:

The subreport 'InspWellFlowline' could not be found at the specified location \\10.14.12

Reclamation - Storm Water - Pit

Storm Water:

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
Culverts	Pass					

Comment: **CULVERT AT LOCATION ENTERANCE FILLED WITH SEDIMENT AND NOT FUNCTIONING PROPERLY**
 Corrective Action: Install or repair required BMPs per Rule 1002.f.(2)C
CA RESOLVED

Corrective Action:

Date: _____

Pits: NO SURFACE INDICATION OF PIT

Attached Documents

You can go to ECMC Images (<https://ecmc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
719001318	LOCATION PICTURES	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=7447330