

**FORM
INSP**

Rev
X/20

**State of Colorado
Energy and Carbon Management Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

04/30/2026

Submitted Date:

04/30/2026

Document Number:

719001934

FIELD INSPECTION FORM

Loc ID 333661 Inspector Name: GARCIA, CHARLES On-Site Inspection 2A Doc Num: _____

Status Summary:

- THIS IS A FOLLOW UP INSPECTION
- FOLLOW UP INSPECTION REQUIRED
- NO FOLLOW UP INSPECTION REQUIRED

Operator Information:

ECMC Operator Number: 53255
Name of Operator: MARALEX RESOURCES INC
Address: P O BOX 338
City: IGNACIO State: CO Zip: 81137

Findings:

- 14 Number of Comments
- 5 Number of Corrective Actions
- Corrective Action Response Requested

ANY CORRECTIVE ACTION(S) FROM PREVIOUS INSPECTIONS THAT HAVE NOT BEEN ADDRESSED ARE STILL APPLICABLE

Contact Information:

Contact Name	Phone	Email	Comment
,		mollieo@maralexinc.com	All Inspections
,		pbechtolt@maralexinc.com	
Labowskie, Steve		steve.labowskie@state.co.us	

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
271095	WELL	PR	11/01/2025	GW	067-08915	KEEGAN PATRICK 33-7-11 #1	PR
294235	WELL	PR	09/01/2025	GW	067-09478	KEEGAN PATRICK 33-7-11 3B	PR

General Comment:

[Inspection Report Summary](#)
On 4/30/26 | Inspector Charles Garcia conducted an on-site inspection. LANDOWENER COMPLAINT
Location:KEEGAN PATRICK 33-7-11 #1,KEEGAN PATRICK 33-7-11 #3
Operator:MARALEX RESOURCES INC
API#: 067-08915
API# 067-09478
County: LaPlata
All prior CA's still stand

Location			
Lease Road:			
Type	Access		
comment:	Culvert at entrance of location DAMAGED STORM WATER AND IRRIGATION WATER causing extensive damage to access road. See location, pictures.		
Corrective Action:	Stormwater management Erosion Control Install or repair required BMPs per Rule 1002.f.(2)C	Date:	05/03/2026
Overall Good: <input type="checkbox"/>			
Signs/Marker:			
Type	WELLHEAD		
Comment:	WELL SIGNS		
Corrective Action:		Date:	
Emergency Contact Number:			
Comment:	970-563-4000 911 EMERGENCY		
Corrective Action:		Date:	
Overall Good: <input checked="" type="checkbox"/>			
Spills:			
Type	Area	Volume	
In Containment: No			
Comment:			
<input type="checkbox"/> Multiple Spills and Releases?			
Fencing/:			
Type	PUMP JACK		
Comment:	HOG WIRE Fencing DAMAGED SEE LOCATION PICTURES. Steve Labowskie and I responded to a land owner complaint on the Keegan Patrick 3-7-11 location. Complaint of property loss (cattle calf) due to entanglement in a pumping unit. inadequate and not maintained fencing on both pumping units (#1 067-08915 and #3B 067-09478).		
Corrective Action:	IMMEDIATE ACTION REQUIRED Comply with the fencing requirements per the 1002a rules FOR PROTECTION OF THE PUBLIC, LIVESTOCK AND WILDLIFE		Date:
Equipment:			
Type: Horizontal Heated Separator	# 2		corrective date
Comment:			
Corrective Action:		Date:	
Type: Flow Line	# 2		
Comment:			
Corrective Action:		Date:	
Type: Bradenhead	# 2		
Comment:			
Corrective Action:		Date:	
Type: Other	# 2		
Comment:	METER HOUSES		

Corrective Action:		Date:	
Type: Gas Meter Run	# 2		
Comment:			
Corrective Action:		Date:	
Type: Prime Mover	# 2		
Comment:			
Corrective Action:		Date:	
Type: Bird Protectors	# 2		
Comment:			
Corrective Action:		Date:	
Type: Other	# 2		
Comment:	WELLHEAD HAS LUBRICATION SYSTEM LEAK IMPACTING SOIL SEE LOCATION PICTURES		
Corrective Action:	608.e MAINTAIN LUBRICATION SYSTEM CLEAN UP IMPACTED SOIL AROUND WELLHEAD rule 1002.f	Date:	05/03/2026
Type: Pump Jack	# 2		
Comment:	Both belt guards for pump jacks have been removed and are on the side of skid SEE LOCATION PICTURES. Removing belt guards and safety equipment does not meet manufacturers specifications for safe working conditions. For protection of the public, livestock and wildlife.		
Corrective Action:	IMMEDIATE ACTION REQUIRED. Equipment must be returned to manufacturers safety specifications FOR SAFETY AND PROTECTION OF THE PUBLIC, LIVESTOCK AND WILDLIFE FOR ONGOING OPERATIONS		Date:

Venting:

Yes/No			
Comment:			
Corrective Action:		Date:	

Flaring:

Type		
Comment:		
Corrective Action:		Date:

Inspected Facilities

Facility ID: 271095 Type: WELL API Number: 067-08915 Status: PR Insp. Status: PR

Producing Well

Comment: PR
 Corrective Action: _____ Date: _____

BradenHead

Date of Last Brhd Test: 10/03/2025 Annual Brhd Completed? Yes
 Last Brhd Test Results Initial Surf Csg Pressure: 0 Fluid Type: NONE
 End Surf Csg Pressure: 0
 Comment: _____
 Corrective Action: _____ Date: _____

Facility ID: 294235 Type: WELL API Number: 067-09478 Status: PR Insp. Status: PR

Producing Well

Comment: PR
 Corrective Action: _____ Date: _____

Complaint

Comment: Steve Labowskie and I responded to a land owner complaint on the Keegan Patrick 3-7-11 location. Complaint of property loss (cattle calf) due to entanglement in a pumping unit. We observed inadequate and not maintained fencing on both pumping units (#1 067-08915 and #3B 067-09478). Both units also had belt guards removed. The landowner, Mr. Whittle, reported that the incident occurred yesterday, April 29, 2026 and he is currently working with ECMC Community Relations staff in filing a complaint. Fresh blood and hair were observed on and near one of the pumping units and he supplied us with photos. Land owner stated fencing is a requested requirement and it had been an issue previously. The #3B pumping unit was still actively pumping with cattle still in the direct vicinity today. Immediate action is required at the Keegan Patrick 3-7-11 location in order to protect the public, wildlife resources and property. ECMC staff will confirm tomorrow that unsafe conditions have been rectified with adequate fencing and wildlife protections or cessation of pumping unit until work can be performed. Seve Labowskie called the 24-hour contact number at 4:30 PM and was only able to speak to the secretary who was unable to get him in touch with anyone with operational knowledge or authority. She took a message for him and he reiterating that we need immediate action at the location and the Rule 605 24-hour operator contact number do Rule 605 a response and not just a message taken by an employee who stated she "just answered phones". Further action may be taken by staff including those pursuant to Rule 603.f
 Corrective Action: _____ Date: _____

BradenHead

Date of Last Brhd Test: 10/03/2025 Annual Brhd Completed? Yes
 Last Brhd Test Results Initial Surf Csg Pressure: 15 Fluid Type: NONE
 End Surf Csg Pressure: 0
 Comment: _____
 Corrective Action: _____ Date: _____

Reclamation - Storm Water - Pit

Storm Water:

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
Culverts	Fail					
Compaction	Pass	Compaction	Pass			
Gravel	Pass	Gravel	Pass			

Comment: No culvert at entrance of location IRRIGATION WATER AND STORM WATER causing extensive damage to access road. See location, pictures.

Corrective Action: Install or repair required BMPs per Rule 1002.f.(2)C

Date: 05/03/2026

Pits: NO SURFACE INDICATION OF PIT

ECMC Comments

Comment	User	Date
Immediate Action required for ongoing operations due to safety conditions for public, livestock and wildlife.	garciacr1	04/30/2026

Attached Documents

You can go to ECMC Images (<https://ecmc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
404642544	INSPECTION SUBMITTED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=7534130
719001935	LOCATION PICTURES	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=7534129