

**FORM
INSP**

Rev
X/20

**State of Colorado
Energy and Carbon Management Commission**

1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109



Inspection Date:

05/07/2026

Submitted Date:

05/22/2026

Document Number:

721100379

FIELD INSPECTION FORM

Loc ID: 326465 Inspector Name: Blair, Jamie On-Site Inspection: 2A Doc Num: _____

Status Summary:
 THIS IS A FOLLOW UP INSPECTION
 FOLLOW UP INSPECTION REQUIRED
 NO FOLLOW UP INSPECTION REQUIRED

Findings:
 7 Number of Comments
 1 Number of Corrective Actions
 Corrective Action Response Requested

Operator Information:
 ECMC Operator Number: 10133
 Name of Operator: HILCORP ENERGY COMPANY
 Address: P O BOX 61229
 City: HOUSTON State: TX Zip: 77208

ANY CORRECTIVE ACTION(S) FROM PREVIOUS INSPECTIONS THAT HAVE NOT BEEN ADDRESSED ARE STILL APPLICABLE

Contact Information:

Contact Name	Phone	Email	Comment
Blair, Jamie		jamie.blair@state.co.us	
Labowskie, Steve		steve.labowskie@state.co.us	
General		FarmingtonRegulatoryTechs@hilcorp.com	All SW field inspections

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
216544	WELL	PR	09/11/1998	CBM	067-08150	DAVIS 2-5	PR

General Comment:

On Thursday, May 7, 2026 southwest compliance inspector Jamie Blair performed a follow-up inspection on the Davis 2-5 location, and again with Jamie Blair and southwest Compliance Supervisor Steve Labowskie on May 18, 2026. Two corrective actions were identified in inspection Doc # 721100079 dated 1/20/26, pertaining to exposed wiring and stormwater BMPs.

- Corrective Action pertaining to exposed wire was satisfactory.
- Corrective Action pertaining to erosional gully cutting across road below gate was satisfactory.

-Corrective actions pertaining to river rock check dam BMPs are NOT SATISFACTORY.
 -Corrective actions pertaining to the river rock armored drain on the fill slope are NOT SATISFACTORY
 -Storm water retention feature at north end of eyebrow ditch is full of sediment. NOT SATISFACTORY

See before-and-after photos, plus additional photos included as link in attachments.

Note - Erosional gully on east side of cut slope at location of red arrow. Photo 22, 23.
 Note - Vegetative debris accumulating in eyebrow ditches, and grass is growing in check dam ditches, diminishing effectiveness. Photo 16, 18.
 Note: Fresh thistle sprouting in on some check dams. (do not show up well in photos).

SKETCH MAP PHOTO 24.

Location

Overall Good:

Emergency Contact Number:

Comment:

Corrective Action:

Date: _____

Overall Good:

Spills:

Type	Area	Volume		

In Containment: No

Comment:

Multiple Spills and Releases?

Equipment:

Type: Other	#		corrective date
Comment: Wellhead "Comply with rule 608.d by maintaining and operating equipment in a way that prevents static charge or stray current hazards." Yellow circle on sketch map. SATISFACTORY Photos 1, 2.			
Corrective Action:			Date:

Venting:

Yes/No			
Comment:			
Corrective Action:		Date:	

Flaring:

Type		
Comment:		
Corrective Action:		Date:

Inspected Facilities

Facility ID: 216544 Type: WELL API Number: 067-08150 Status: PR Insp. Status: PR

Producing Well

Comment: PR

Corrective Action:

Date:

Reclamation - Storm Water - Pit

Storm Water:

Loc Erosion BMPs	BMP Maintenance	Lease Road Erosion BMPs	Lease BMP Maintenance	Chemical BMPs	Chemical BMP Maintenance	Comment
Ditches	Pass					eyebrow ditches
Gravel	Pass	Gravel	Pass			
Rip Rap	Fail					
Berms	Pass	Check Dams	Fail			
Compaction	Pass	Compaction	Pass			
Drains	Fail					
Check Dams	Pass					

Comment: "Items 1, 2, & 3: Maintain & repair existing BMPs, or install additional BMPs in area where erosion is occurring across access road per Rule 1002.f.(2)C."

SATISFACTORY - Erosional gully crossing road has been repaired. Photos 13, 14.

NOT SATISFACTORY: Check dams not excavated completely w/ a few exceptions.

Photo 3, 4, 4b, 4c, 5, 6, 7, 8,

NOT SATISFACTORY -River Rock Armored Drain on Fill Slope Edge of Pad. Photos 9, 10, 10B, 11, 12

NOT SATISFACTORY - Stormwater retention and sediment basin. Photos 19, 20, 21.

Original CA dates apply

Corrective Action: **Install or maintain to manufacturer or other accepted BMP specification to comply with with Rule 1002.f.(2)C.**

Date: _____

Pits: NO SURFACE INDICATION OF PIT

ECMC Comments

Comment	User	Date
<p>This was a follow up inspection. Satisfactory - Wires Not Satisfactory - Some Stomwater BMPs require additional work Photos linked in the attachments, along with a sketch map. Note - Erosional gully east side of cut slopw at location of red arrow. Photo 22, 23. Note - Vegetative debris appears to be accumulating in eyebrow ditches and grass in check dam ditches will dimisish effectiveness. Photo 16, 18</p>	blairj1	05/07/2026

Attached Documents

You can go to ECMC Images (<https://ecmc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
404669758	INSPECTION SUBMITTED	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=7557457
721100420	Photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=7557454