

Inspection Photos
Operator: Arkoma/Catamount
API: 067-05412
Date: 8/6/2021



Photo 1. View of the project area from the well pad entrance facing center.

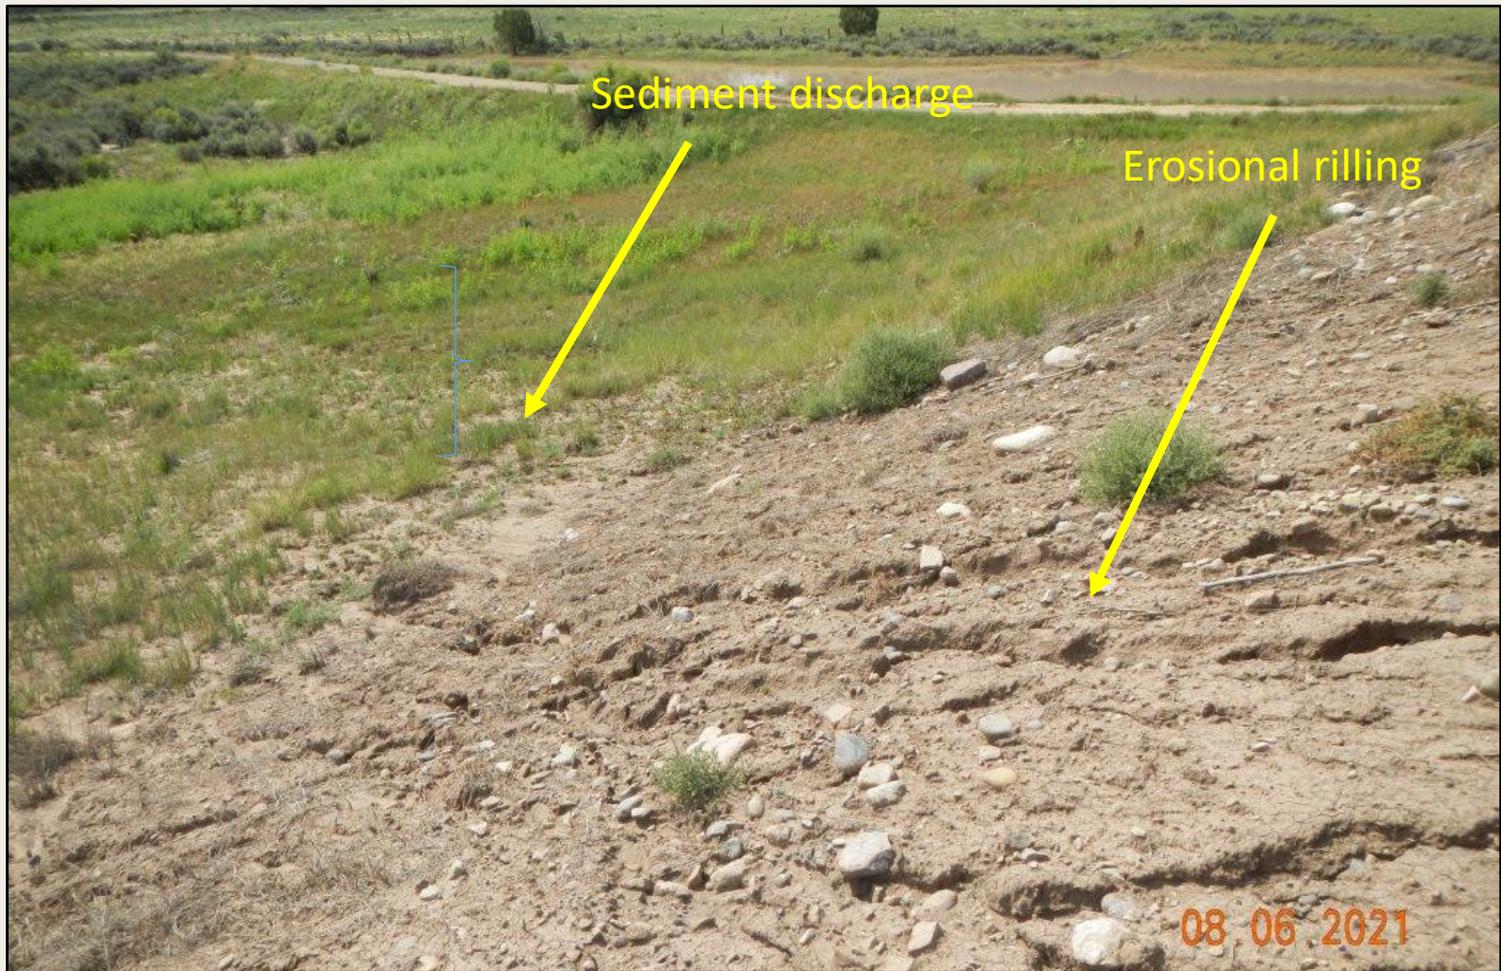


Photo 2. View of erosional rilling and sediment deposition within the eastern fill slope. Area needs erosion controls and sediment controls installed and maintained until stabilized with long term perennial vegetation.



Photo 3. View of failed wattles and erosion occurring on the well pad cut-slope. Wattles are not an adequate BMP here. Long term stabilization measures are needed until stabilized with desirable perennial vegetation.



Photo 4. Another view of erosional channeling and failure of wattles on well pad cut-slope.



Photo 5. View of reference area comprised of sagebrush shrubland, open grass field, and pinyon and juniper woodland mosaic, with grasses and forbs such as western wheatgrass, James galleta, matt penstemon, and goldenaster.