

attach to Sundry  
of 5/15/95  
in office



PHILLIPS PETROLEUM COMPANY  
North America E&P

FAX COVER SHEET

Post Office Box 1967  
Houston, Texas 77251

6330 West Loop South  
Bellaire, Texas 77401  
713/669-3666



00062654

Fax Numbers: 713/669-3754  
669-3755  
669-4313

Problems? Call 669-7932

To: Jimie Adkins

From: Kari Wido

Company: State of Colorado O&G

Room/Ext: (113) 669-3773

Fax Number: (970) 858-7521

Number of Pages 10 Including Cover Sheet

MESSAGE

Please call me should you have any questions.

FOR INTERNAL USE ONLY

Transmitted By: \_\_\_\_\_

Date: \_\_\_\_\_

Time: \_\_\_\_\_





**PHILLIPS PETROLEUM COMPANY**

HOUSTON, TEXAS 77251-1987  
BOX 1987

NORTH AMERICA  
EXPLORATION AND PRODUCTION

BELLAIRE, TEXAS  
6330 WEST LOOP SOUTH  
PHILLIPS BUILDING

September 25, 1995

**FAX LETTER**

State of Colorado  
Oil & Gas Commission  
P. O. Box 98  
Loma, Colorado 81524

Attention: Mr. Jamie Adkins

103-5262


Re: Mannel #2  
SE NE Section 26-T1N-R95W  
Rio Blanco County

Dear Mr. Adkins:

As per requested, enclosed is an outline of work proposed to re-abandon the subject well. Due to some problems locating and obtaining access agreements from land owners, the proposed work will not be completed until approximately October 15, 1995.

If you should have any questions, please call Kari Olds at (713) 669-3773 or (713) 669-3755 FAX. Thank you for your assistance in this matter.

Sincerely,

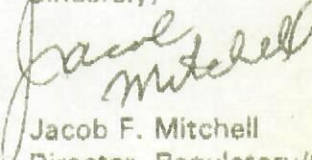  
Jacob F. Mitchell  
Director, Regulatory/Compliance

JFM/KMO  
Attachments

cc: S. D. McCoy (r) K. M. Olds  
A. J. Lasche



**Mannel No. 2  
Re-abandon****History:**


The Mannel No. 2 was spudded on August 12, 1958, and plugged and abandoned as a dry hole on September 1, 1958. Due to reports of hearing gas bubbles inside dry hole marker, Phillips requested and received approval to investigate and possibly re-abandon on May 19, 1995. On August 7, 1995, an investigation of the well was performed and gas was found to be escaping at surface. After thorough research into the area and the well, it was determined the cause of the gas leak is most likely from shallow sands. (Maximum reservoir pressure gradient ever encountered during drilling was 0.65 psi/ft.)

**Outline of Proposed Procedure Re-abandonment:**


The procedure calls for the following: (See attached schematics for details.)

Hold safety meeting. Remove dry hole marker and drill through surface plugs. Run-in-hole and tag cement at 367', fill casing with 10.0 ppg fluid, and pressure test to 275 psi (exceeds reservoir pressure). If pressure holds, cement plug and surface casing integrity exists. Spot 20 sacks of cement at surface (60' cement plug). (See proposed schematic number 1.) If pressure will not hold, cement plug and or surface casing integrity doesn't exist. Drill out cement plug at casing shoe and spot 155 sacks of cement to surface. (See proposed schematic number 2.) ND BOP's, cut off wellhead, weld cap on 8-5/8" casing with weep hole, and restore well site.



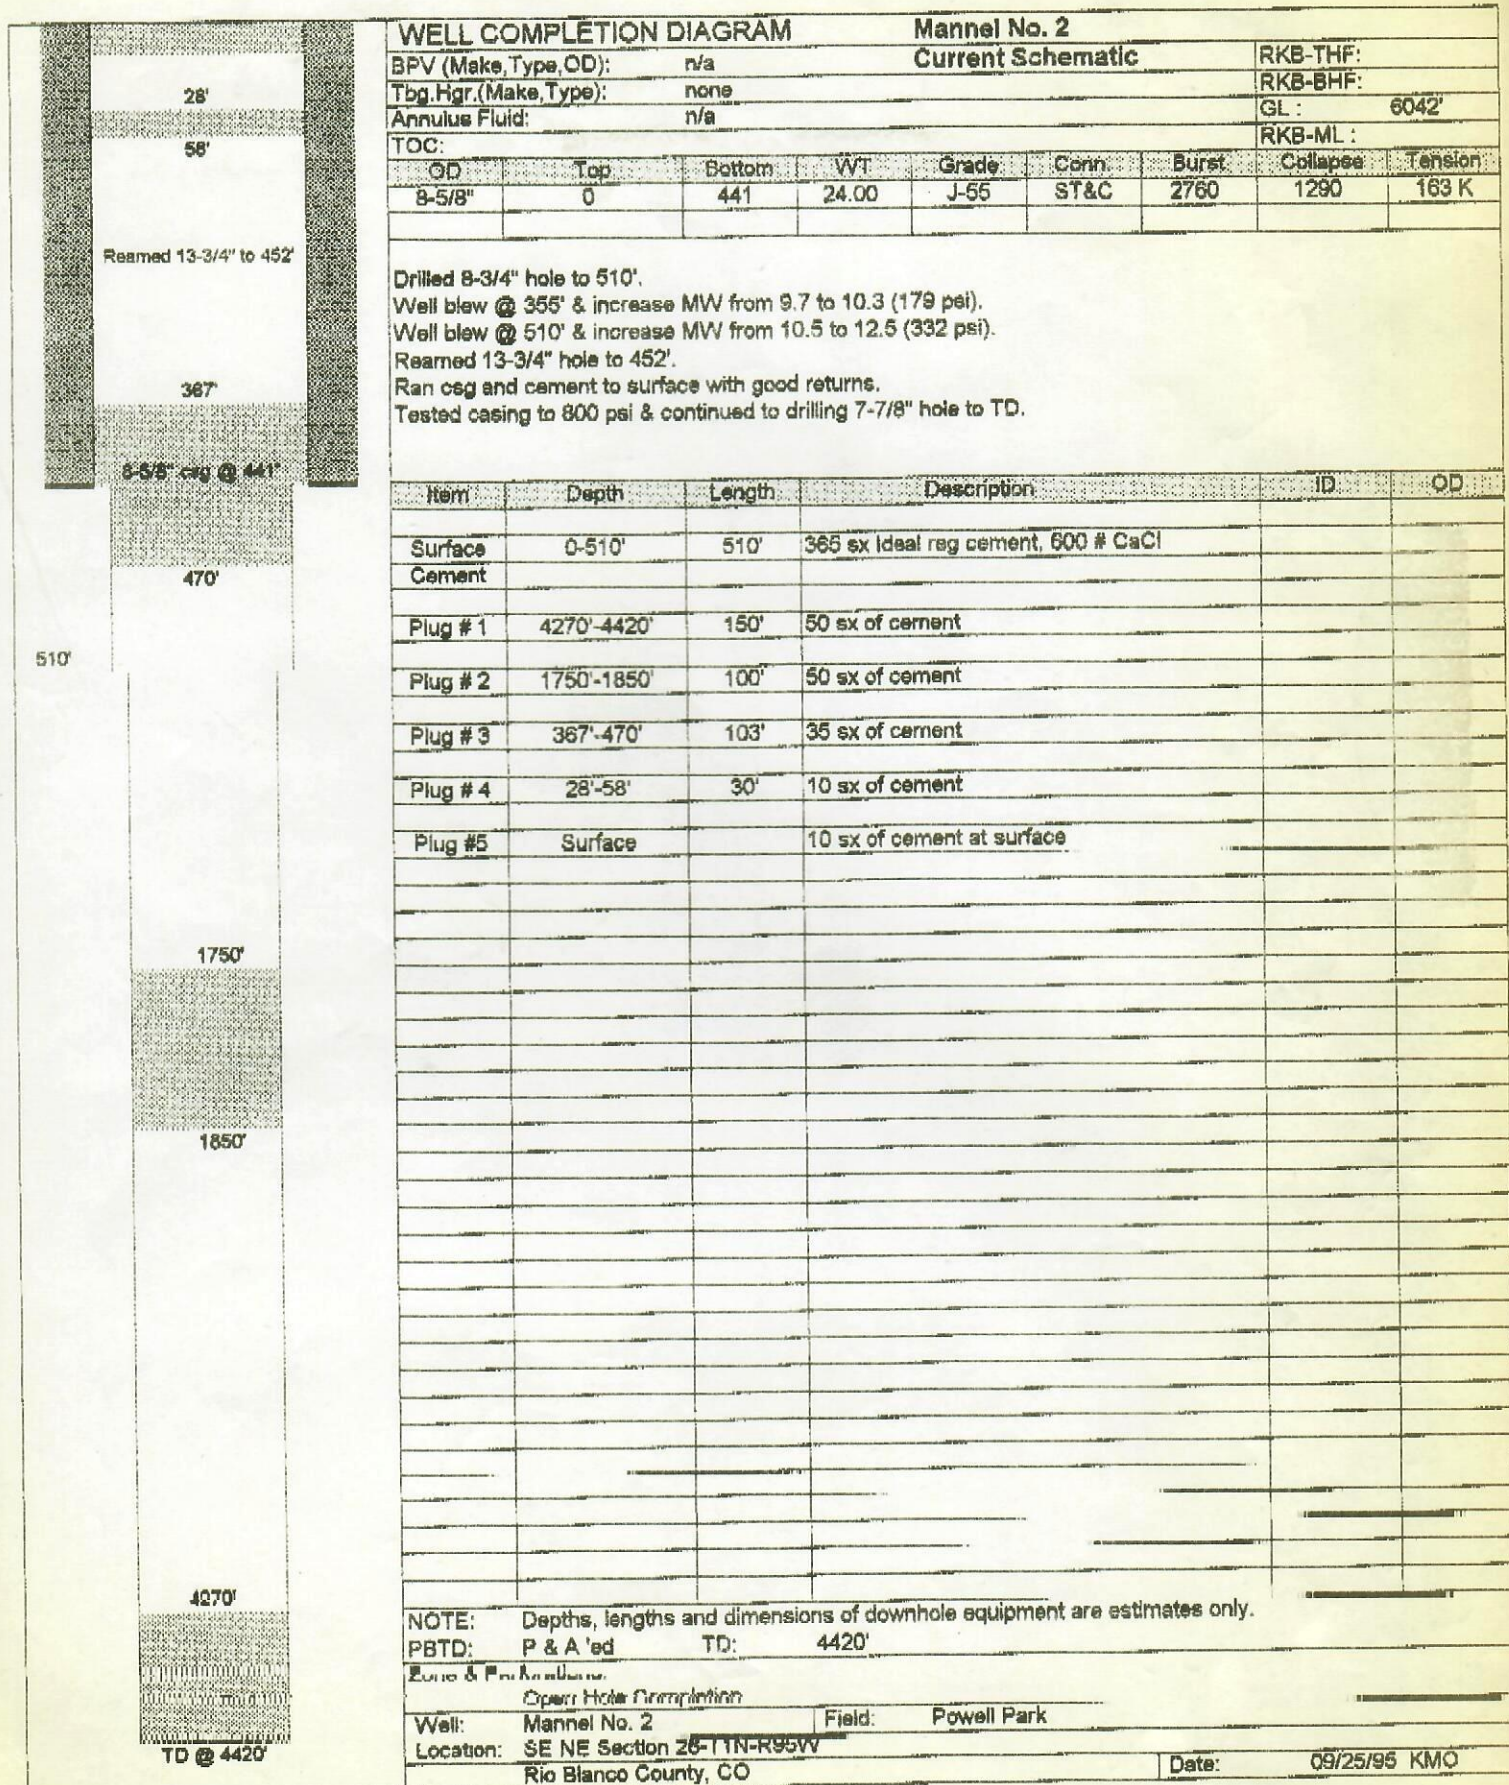



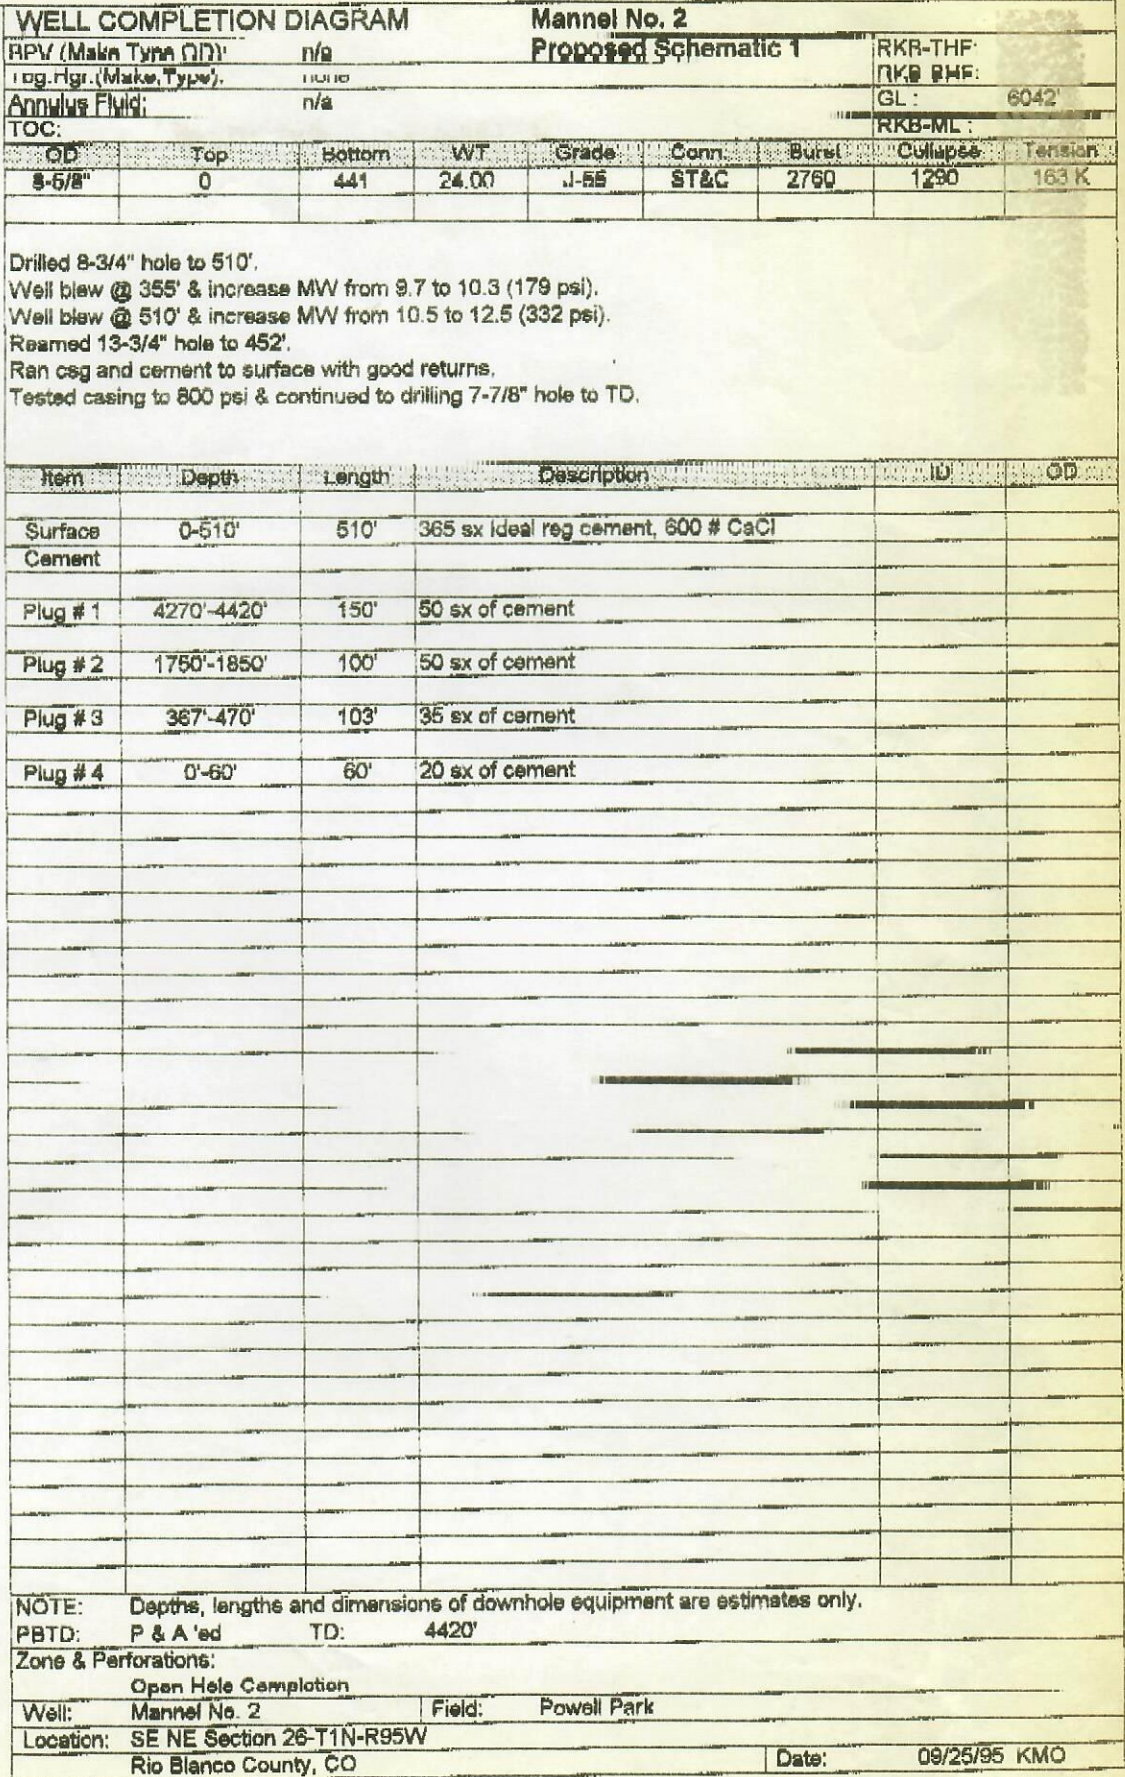



## Mannell No. 2

17/8

RKB-THF:

none

RKB-BHF:

na

GL : 6042

TOC:

RKB-ML:

[illegible]

Well blew @ 355' & increase MW from 9.7 to 10.3 (179 psi).

Well blew @ 510' & increase MW from 10.5 to 12.5 (332 psi).

Reamed 13-3/4" hole to 452'.

Ran csg and cement to surface with good returns.

Tested casing to 800 psi & continued to drilling 7-7/8" hole to TD.

[illegible]

PBTD: P & A 'ed TD: 4420

### Zone & Perforations:

### Open Hole Completion

Well:	Mannel No. 2
-------	--------------

Field: Powell Park

Location: SE NE Section 26-T1N-R95W

Rio Blanco County, CO

Date: 09/25/95 KMO

8-53' csg @ 441

491'

510'

1750\*

1850'

4270'

TD @ 4420'