

Interim Reclamation and Stormwater Inspection

November 22, 2017

Operator: CONFLUENCE DJ LLC- #10518

Location ID: 452048

Weld County, CO

SWSW Section 33 T1N R65W

Chris Binschus
Reclamation Specialist, COGCC



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

Inspection Photos
Location Name: Freedom /33
Location ID: 452048



Google Earth imagery taken on June 2, 2014 illustrating the location that was mapped on November 22, 2017 using a Trimble Juno 3B handheld device that indicated a total disturbance of 17.20 acres.

Inspection Photos
Location Name: Freedom /33
Location ID: 452048



Photo 1. Photo taken from the entrance of the location, facing North. Tracking pad devices installed at the entrance off County Road 2.



Photo 2. Photo taken from the northwest location, facing South. Ditch and berm BMP installed around the perimeter of the location. Appears portions of the berm have been tracked with equipment for temporary stabilization but portions have been left unconsolidated.

Inspection Photos
Location Name: Freedom /33
Location ID: 452048



Photo 3. Photo taken from the northwest location, facing East. See comments under Photo 2.



Photo 4. Photo taken from the northern location, facing East. Appears topsoil has been salvaged and stored along the northern perimeter. Topsoil has been temporarily stabilized by equipment tracking. See comments under Photo 2.

Inspection Photos
Location Name: Freedom /33
Location ID: 452048



Photo 5. Photo taken from the northeast location, facing South. See comments under Photo 2.



Photo 6. Photo taken from the eastern location, facing South. See comments under Photo 2.

Inspection Photos
Location Name: Freedom /33
Location ID: 452048



Photo 7. Photo taken from the southeastern location, facing South. Berm BMP has not been properly stabilized and has been left unconsolidated.



Photo 8. Photo taken from the southeastern location, facing South. See comments under Photo 7.

Inspection Photos
Location Name: Freedom /33
Location ID: 452048



Photo 9. Photo taken from the southern location, facing North. Operator has installed a stabilized outlet which is directed to the perimeter berm and ditch BMP.



Photo 10. Photo taken from the southern location, facing West. See comments under Photo 2. Check dam BMPs have been installed along portions of the southern ditch and berm BMP.

Inspection Photos
Location Name: Freedom /33
Location ID: 452048



Photo 11. Photo taken from the southwest location, facing West. Sediment trap has been installed with a stabilized outlet; however, the sediment trap does not appear to be properly sized for 17 acres of disturbance.

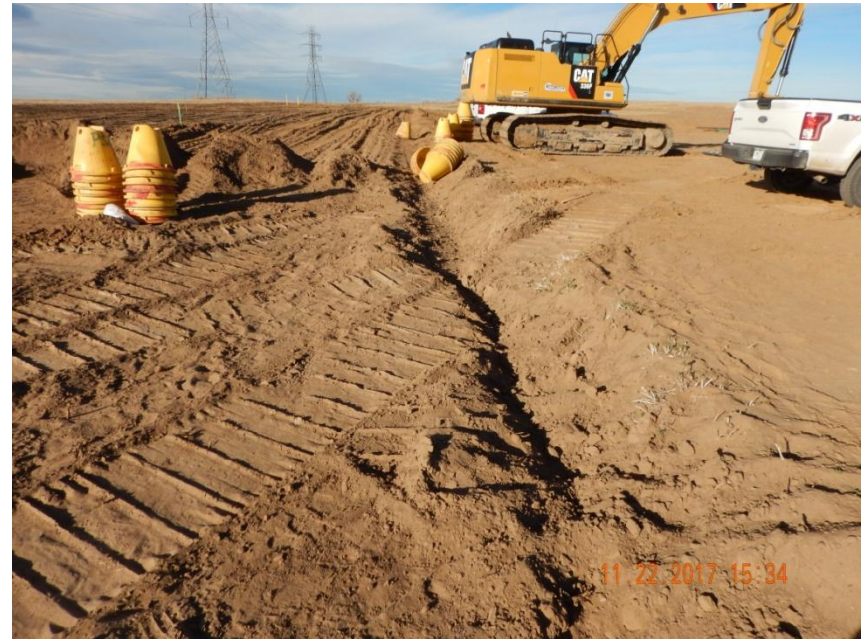


Photo 12. Photo taken from the northwestern location, facing North. Appears disturbances from pipeline construction have damaged the ditch and berm BMP. BMP maintenance is required.