

Construction and Stormwater Inspection

June 20, 2018

Operator: BURLINGTON RESOURCES OIL & GAS LP- #26580

Location ID: 454808

Inspection Document #: 682403719

Arapahoe County, CO

NWSW Section 3 T4S R64W

Chris Binschus
Reclamation Specialist, COGCC




COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

Inspection Photos

Location Name: Arkansas 4-64 3-2

Location ID: 454808

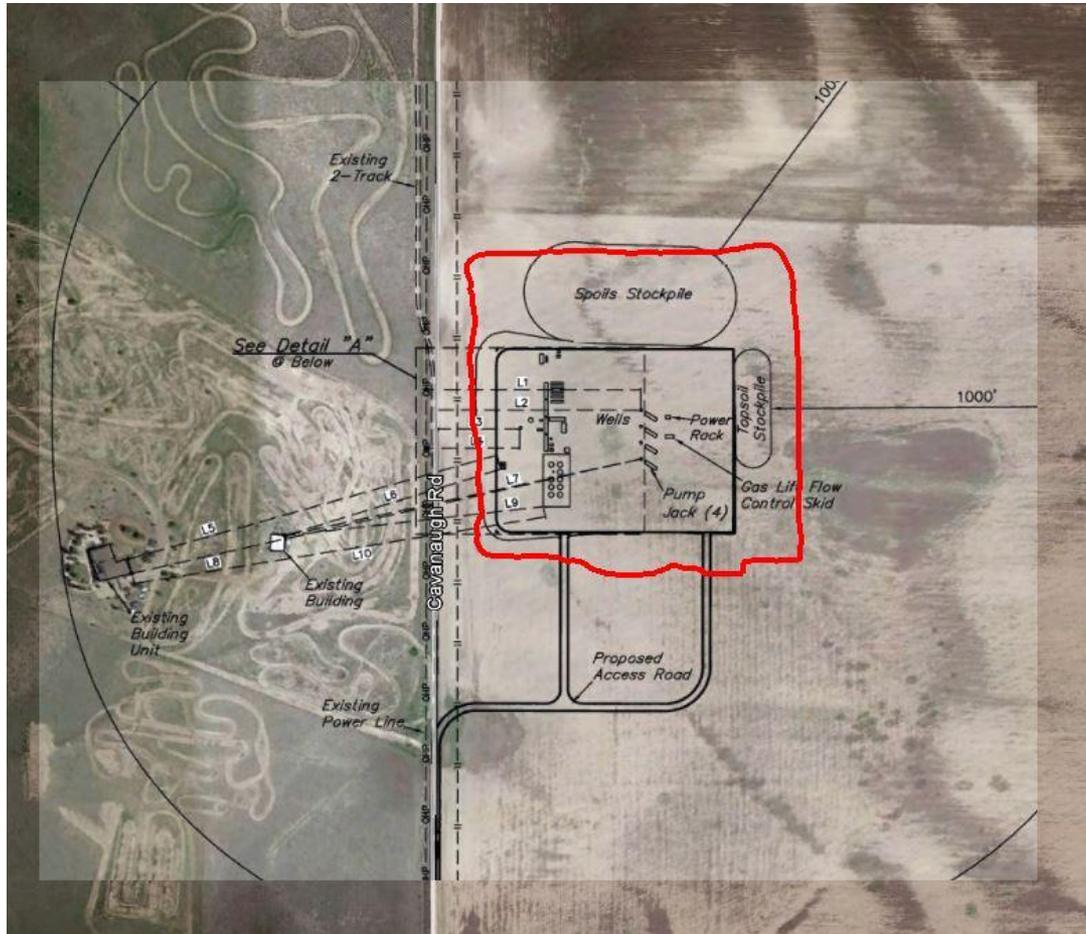

Google Earth aerial imagery taken on 6/9/2017, prior to construction operations. Facility Layout Drawing (Doc. #1010399) has been overlaid with field collected data from 6/20/2018, illustrating the approximate areas that have exceeded the permitted boundary. Field collected data on 6/20/2018, using a Trimble handheld GPS (red line), would indicate total disturbance after construction operations is approximately 13.78 acres. This does not appear to be the approved total permitted disturbance. Appears the Operator may not have accounted for soil stockpile storage areas and stormwater BMP areas for the total disturbance area.

Inspection Photos
Location Name: Arkansas 4-64 3-2
Location ID: 454808



Photo 1. Photo taken from the entrance of location, illustrating the Operator sign.



Photo 2. Photo taken from the entrance of location, facing South. Photo illustrates a portion of the access road which has been gravelled.

Inspection Photos
Location Name: Arkansas 4-64 3-2
Location ID: 454808



Photo 3. Photo taken from the southeastern perimeter of the location, facing East. Photo illustrates the sediment trap BMP. A ditch BMP has been installed along portion of the perimeter of the location which is directed to this sediment trap. Disturbance areas have been mulched and crimped, and appear to be seeded. Crimped mulch does not appear to be crimped along portions.



Photo 4. Photo taken from the southeastern perimeter of the location, facing North. Filtrex wattle has been installed along portions of the perimeter of the location. Topsoil appears to be stored along the eastern perimeter of the location.

Inspection Photos
Location Name: Arkansas 4-64 3-2
Location ID: 454808



Photo 5. Photo taken from the northeastern perimeter of the location, facing West. Photo illustrates the northern spoils stockpile.



Photo 6. Photo taken from the northern perimeter of the location, facing West. Appears soil material was pushed over the top of the wattle BMP from equipment traffic which is no long in proper functioning condition.

Inspection Photos
Location Name: Arkansas 4-64 3-2
Location ID: 454808



Photo 7. Photo taken from the northwestern perimeter of the location, facing East. Cut slope has been stabilized with erosion control blankets.



Photo 8. Photo taken from the northwestern perimeter of the location, facing South. See comments under Photo 7.

Inspection Photos
Location Name: Arkansas 4-64 3-2
Location ID: 454808



Photo 9. Photo taken from the western perimeter of the location, facing South. See comments under Photo 3.



Photo 10. Photo taken from the southwestern perimeter of the location, facing East. Photo illustrates well pad operational areas have been stabilized with gravel, as well as cut slopes with erosion control blankets.

Inspection Photos
Location Name: Arkansas 4-64 3-2
Location ID: 454808



Photo 11. Photo taken from the southwest perimeter of the location, facing East. See comments under Photo 3.



Photo 12. Photo taken from the southwestern perimeter of the location, facing East. See comments under Photo 3.